Newlin Gulch Major Drainageway Plan - Draft Baseline Hydrology March 2015









March 5, 2015



Ms. Shea Thomas, P.E.
Senior Project Engineer, Master Planning
Urban Drainage and Flood Control District
2480 West 26th Avenue, Suite 156 B
Denver, Colorado 80211-5301

RE:

Newlin Gulch MDP & FHAD Final Baseline Hydrology Report Agreement No. 12-09.02

Dear Ms. Thomas:

Muller Engineering Company is pleased to submit the final Baseline Hydrology Report for the Newlin Gulch Major Drainageway Plan. The final report addresses review comments provided by the project sponsors on the draft Baseline Hydrology.

The previous hydrology for Newlin Gulch was documented in the 1993 OSP by Kiowa Engineering. This study updates the 1993 OSP hydrology for the Newlin Gulch watershed to recognize the flood detention benefits of the recently constructed Rueter-Hess Reservoir. Since the reservoir has substantially altered the hydrology of the watershed, this study is well-timed to guide future development and serve as a foundation for subsequent evaluations of flooding and stream stability improvements along Newlin Gulch.

This study includes revised subwatershed boundaries according to current UDFCD guidelines and according to existing and future development flow patterns, updates to existing and future development projections, and publically maintained regional detention facilities. The updated hydrology will be used as the basis for the development of alternatives and for conceptual design of the selected alternative.

We appreciate the opportunity to work with you on this report, and look forward to our continuing collaboration on the next phases of the project.

Sincerely,

MULLER ENGINEERING COMPANY, INC.

Derch D. Johns

Derek D. Johns, P.E.

Project Manager

777 South Wadsworth Boulevard, Suite 4-100 | Lakewood, Colorado 80226 | 303-988-4939 | www.mullereng.com

8.		

Table of Contents

1 IN	ITRODUCTION	1-1
1.1	Authorization	1-1
1.2	Purpose and Scope	1-1
1.3	PLANNING PROCESS	1-1
1.4	Mapping and Surveys	1-2
1.5	Data Collection	1-2
1.6	ACKNOWLEDGEMENTS	1-2
2 ST	TUDY AREA DESCRIPTION	2-1
2.1	Project Area	2-1
2.2	LAND USE	2-1
2.3	REACH DESCRIPTION	2-2
2.4	FLOOD HISTORY	2-2
2.5	Environmental Assessment	2-2
3 H\	YDROLOGIC ANALYSIS	3-3
3.1	Overview	3-3
3.2	Design Rainfall	3-3
3.3	SUBWATERSHED CHARACTERISTICS	3-4
3.4	Hydrograph Routing	3-4
3.5	Previous Studies	3-5
3.6	Model Calibration	3-5
3.7	RESULTS OF ANALYSIS	3-7
4 RE	EFERENCES	4-1

List of Figures

Figure 2-1: Vicinity Map	2-1
Figure B-1: Hydrology Map	B-1
Figure B-2: SWMM Schematic – Upper Watershed	B-8
Figure B-3: SWMM Schematic – Lower Watershed	B-9
Figure B-4: Existing Development Hydrographs	B-10
Figure B-5: Future Development Hydrographs	B-11
Figure B-6: Peak Flow Profile – Existing Development	B-12
Figure B-7: Peak Flow Profile – Future Development	B-13
List of Tables	
Table 1-1: Project Meetings	1-2
Table 1-2: Project Participants	1-2
Table 3-1: Point Rainfall Depths	3-3
Table 3-2: Depth Reduction Factors	3-4
Table 3-3: Model Calibration	3-6
Table 3-4: Comparison to Previous Studies	3-7
Table B-1: Rainfall Distributions	B-2
Table B-2: CUHP Input	B-3 through B-5
Table B-3: Detention Rating Curves	B-6
Table B-4: Peak Flow Rates	_
Table B-5: Runoff Volumes – Existing Development	B-16
Table B-6: Runoff Volumes – Future Development	B-17
Table B-7: Sample SWMM Input	B-18 through B-29
Table B-8: Sample SWMM Output	B-30 through B-41
Table C-1: Rueter-Hess Reservoir Routing Alternatives	C-6

- **Appendix A: Project Correspondence**
- **Appendix B: Hydrologic Analysis**
- **Appendix C: Rueter-Hess Reservoir Routing Analysis**
- **Appendix D: Rueter-Hess Adequate Assurances Agreement**

1 INTRODUCTION

1.1 AUTHORIZATION

The Urban Drainage and Flood Control District (UDFCD), in agreement with Douglas County and the Town of Parker, contracted with Muller Engineering Company, Inc. to conduct a Major Drainageway Plan (MDP) for Newlin Gulch. The work is authorized under UDFCD Agreement No. 12-09.02, dated November 13, 2012.

1.2 PURPOSE AND SCOPE

The Newlin Gulch watershed was last studied in the Newlin and Baldwin Gulches and Basin 4600-09 Outfall Systems Planning Study (OSP), published in August 1993 by Kiowa Engineering Corporation. The Newlin Gulch regulatory floodplain was established in a 1977 Flood Hazard Area Delineation (FHAD) prepared by Howard, Needles, Tammen & Bergendoff along with Happy Canyon Creek, Baldwin, Sulphur, and Tallman Gulches. Several Letter of Map Revision (LOMR) updates to the floodplain have been incorporated since the 1977 FHAD.

UDFCD typically updates master plans every 20-30 years based on requests and support from local governments. In the case of the Newlin Gulch watershed, significant development in the lower portion of the watershed within the Town of Parker has occurred since the 1993 OSP. More development is expected in the near future, in particular in the City of Castle Pines in the upper portion of the watershed as construction begins on the Canyons Development. The most dramatic change to the watershed has been the recent construction of the Rueter-Hess Reservoir, a large water storage reservoir. The large normal pool (1.7 square miles) impacts the hydrology of the lower two-thirds of the watershed. This update is therefore well-timed to help guide channel improvements, address flooding concerns in conjunction with development, and reflect the impact of Rueter-Hess Reservoir on hydrology and channel stability.

The overall scope of work for the MDP includes the following main tasks:

- 1. Meet periodically with the project sponsors and other stakeholders to exchange information and to solicit input and direction.
- 2. Set up and maintain a project web site to present information and receive input from interested parties.
- 3. Collect and review available reports and studies related to existing and proposed stormwater facilities, local hydrology, floodplains, current and future land use, and water quality.
- 4. Review the 1993 hydrologic model and create new historic, existing, and future land-use hydrologic models using the latest versions of CUHP and SWMM. Include current publicly-maintained regional

detention facilities, account for the increased imperviousness and inadvertent flood storage of Reuter-Hess Reservoir, and reflect other watershed conditions that currently exist.

- 5. Perform hydraulic calculations necessary to assess the adequacy of existing stormwater facilities and to size alternative improvement plans.
- 6. Identify existing and potential future drainage, erosion, water quality, and flooding problems in the project area, including a general identification of wetland and riparian zones and potential detention sites.
- 7. Formulate and evaluate conceptual alternative plans to address drainage, erosion, water quality, and flood hazard problems associated with the drainageway, considering probable costs, water quality effects, and maintenance aspects.
- 8. Prepare a draft alternatives analysis report to document the formulation and evaluation of alternative plans and to recommend a preferred alternative, review with project sponsors and stakeholders, and revise to address the comments received.
- 9. Undertake a conceptual design of the selected alternative and prepare drawings and probable cost information for the plan, documenting in a draft, then final conceptual design report.

A FHAD was also authorized under the same agreement, and will be presented in a separate document.

1.3 PLANNING PROCESS

Based on input from the project sponsors and on observations of the current condition of various reaches of Newlin Gulch, the following main objectives for this master plan were identified:

- ➤ Determine the impact of the Reuter-Hess Reservoir on existing and future peak flow rates. Use the hydrologic models as the basis for an agreement with the reservoir concerning flood storage and discharge.
- Estimate the existing and future floodplain downstream of Reuter-Hess using the updated hydrology.
- ➤ Identify floodplain and channel stability concerns associated with the new development and develop appropriate alternatives to address the issues.
- > Develop conceptual design improvements to be implemented with adjacent development.
- Achieve the objectives of project sponsors and stakeholders while preserving a natural channel character and supporting riparian vegetation communities and resident wildlife habitat

Periodic meetings were held to gather input from project sponsors and stakeholders. A summary of project meetings is shown in **Table 1-1**; meeting minutes are included in **Appendix A**.

Table 1-1: Project Meetings

Meeting	Date	Purpose
Kickoff Meeting	November 19, 2012	Review project scope and project approach, identify information needs
Progress Meeting #2	March 18, 2013	Hydrology status update, review land use assumptions, review SWMM and CUHP model assumptions
Progress Meeting #3	May 15, 2013	Discuss course of action relative to Rueter-Hess Reservoir Routing and Adequate Assurances Agreement with PWSD
Progress Meeting #4	December 17, 2014	Restart project following hiatus while Rueter-Hess Adequate Assurances Agreement was being coordinated and approved

1.4 MAPPING AND SURVEYS

Mapping data sources used for the Newlin Gulch MDP included the following:

- ➤ Color aerial photography was provided by UDFCD. The photography was part of an aerial imagery project by the Town of Parker. Photographs are from early 2012.
- ➤ 2-foot interval topography within the northern project area (north of Lincoln Avenue) was obtained from the Denver Democratic National Convention (DNC) LIDAR Survey compiled by Sanborn Geospatial on July 25, 2008.
- ➤ 2-foot interval topography along the main stem of Newlin Gulch was provided by UDFCD. The topography was prepared by Merrick & Company GeoSpatial and was based on LiDAR imaging taken in October of 2012.
- > 5-foot interval topography in Douglas County was provided by the County and was used to delineate watershed boundaries and define subwatershed and channel properties south of Lincoln Avenue. The source of the mapping was Merrick & Company's 1996 Digital Elevation Model (DEM) "Mass Points."
- > Supplemental ground survey of the Hess Road Bridge, Bradbury Ranch Pond IV, and the Newlin Gulch channel at Challenger Regional Park was provided by UDFCD. Survey was conducted by Accurate EngiSurv, LLC in April 2013.

All mapping is on the Colorado State Plane Central Zone (0502) projection, horizontal datum NAD83, and vertical datum NAVD 1988.

Existing parcel boundaries, zoning, jurisdictional boundaries, and Digital Flood Insurance Rate Map (DFIRM) data were provided by Douglas County in Geographic Information System (GIS) format.

1.5 DATA COLLECTION

Numerous reports, studies, and design plans were reviewed and utilized in the preparation of this report. A listing of the primary references is as follows; a full listing is included in the References section at the end of this report.

- > 1977 Flood Hazard Area Delineation, Happy Canyon Creek, Badger Gulch, Newlin Gulch, Baldwin Gulch, Sulphur Gulch, Tallman Gulch (Howard, Needles, Tammen & Bergendoff)
- ➤ 1993 Newlin and Baldwin Gulches and Basin 4600-09 Outfall Systems Planning Study (Kiowa Engineering Corporation)

1.6 ACKNOWLEDGEMENTS

This report could not have been prepared without the participation and support of the following project sponsors and stakeholders. We are grateful for their contributions.

Table 1-2: Project Participants

Project Sponsors	Agency
Shea Thomas	Urban Drainage and Flood Control District
Brad Robenstein	Douglas County
Tom Williams	Town of Parker
Jacob James	Town of Parker
Project Stakeholders	Agency
Project Stakeholders Brad Meyering	Agency City of Castle Pines
Brad Meyering	City of Castle Pines

2 STUDY AREA DESCRIPTION

2.1 Project Area

Newlin Gulch originates in the City of Castle Pines, located along I-25 about 3 1/2-miles north of Castle Rock. The creek and its tributaries flow northeast through areas of Castle Pines, unincorporated Douglas County, and the Town of Parker before emptying into Cherry Creek near Challenger Park in the Town of Parker. The Newlin Gulch watershed area is approximately 15 square miles.

The upper third of the watershed is primarily within the City of Castle Pines. West of I-25, recently annexed areas are slated for residential and commercial development. East of I-25, the watershed includes the majority of the planned Canyons development, also in Castle Pines. The middle third of the watershed starts upstream of the new Rueter-Hess Reservoir and ends at Mainstreet in the Town of Parker. A portion of the Parker Homestead development is located in the watershed just north of

Urban Drainage and Flood Control District

ADAMS

DEFFESON

Cod

Code

DENVER

DOUGLAS

Newlin

Gulch

Watershed

February 2007

Figure 2-1: Vicinity Map

Rueter-Hess. The lower third of the watershed, located north of Mainstreet, is nearly fully developed by the Stonegate Village and Challenger Park Estates developments, among others.

The Newlin Gulch watershed is approximately 8.8 miles in length and has an average width of 1.8 miles for most of its length, tapering to 0.5 miles wide at the north end. The total area is 15.0 square miles or 9,600 acres. Approximately 20% of the watershed area is developed. Another 12% of the watershed is within the projected maximum normal pool of Rueter-Hess Reservoir, which encompasses 1.8 square miles. The highest and lowest points of the watershed are 6680 and 5768 feet above mean sea level, respectively, and the average watershed slope is 1.8%. Underlying soils include hydrologic group A along the mainstem downstream of Hess Road and in some areas within the normal pool of Rueter-Hess, surrounded by areas of group B soils. The majority of the tributary area is underlain by hydrologic group C soils. A map of soil classifications is included as **Figure B-1** in **Appendix B**.

Newlin Gulch is UDFCD Project Reuse watershed #4612.

The Major Drainageway Plan project area includes approximately 4 miles of mainstem Newlin Gulch downstream of the Reuter-Hess Reservoir, from Hess Road to the Newlin Gulch confluence with Cherry

2.2 LAND USE

Land use within the Newlin Gulch watershed varies from rangeland and open space to high density city center. Existing development conditions were generally based on visual assessment of the aerial photography provided by UDFCD, and future development conditions were based on information provided by project sponsors and stakeholders, including planning documents, zoning, master drainage plans, and direct input. In a few cases, roads were identified separately in land use analysis: the I-25 corridor is reflected as 50% impervious to reflect separation between travel lanes and additional right-of-way, while Hess Road, Chambers Road and Lincoln Avenue are assumed 100% impervious. All other existing or planned roads are assumed to be accounted for in the impervious values of adjacent development. The projected maximum normal pool of Rueter-Hess Reservoir is treated as 100% impervious under both

The overall existing weighted impervious value for the Newlin Gulch watershed is 22.5%. Future development is projected to increase watershed imperviousness to 34.7%. The interactive hydrology map in Appendix B shows existing and future land use boundaries and impervious values (Figures B-2 and B-3).

Upper Watershed: Castle Pines Town Center to Rueter-Hess Reservoir

existing and future development conditions.

The upper watershed extends from approximately two miles south of the I-25 and Castle Pines Parkway Interchange north to the boundary of the Rueter-Hess Reservoir normal pool. The mainstem channel length is slightly less than three miles. A small portion of the watershed west of I-25 includes existing medium-density residential and commercial lots which are part of the City of Castle Pines. The extreme south end of the watershed includes existing large-lot residential from the Sapphire Pointe development. Undeveloped parcels cover the remainder of the upper watershed in the existing condition. Future development includes The Canyons, Castle Pine Town Center, and LaGae Ranch. The Canyons is the largest of the three and extends from the edge of Rueter-Hess Reservoir to beyond the southern boundary of the watershed. Future land-use and impervious values for the future developments were based on the most current drainage plans available. The weighted impervious value for the upper watershed is 21% (future development condition).

The upper watershed includes numerous tributary "fingers" to the mainstem: the Spring Tributary, the Roundtop Tributary, the Mesa Tributary, South Newlin Gulch, and the Big Windmill Tributary. The majority of these tributaries (with the exception of the Spring Tributary) are currently undeveloped.

Lower Watershed: Rueter-Hess Reservoir to Cherry Creek Confluence

Rueter-Hess Reservoir is a water supply reservoir owned by Parker Water and Sanitation District (PWSD). It is located on the mainstem of Newlin Gulch in the central portion of the watershed. The construction of

the reservoir was completed in 2012 and consists of a 170-foot tall earthen dam that is designed to store 72,000 acre-feet of water. Though the reservoir will not be full for several years, the planned normal pool will have a surface area of approximately 1.8 square miles (1,150 acres), which is approximately 12% of the entire watershed. Downstream of the reservoir, the recent Hess Road extension to I-25 provides a boundary between the reservoir and existing and future residential development. Existing medium to dense residential lots cover a large portion of the lower watershed. These lots are part of a number of subdivisions, including (from north to south): Challenger Park Estates, Stonegate Village, Bradbury Ranch, New Horizon, The Regency, and Newlin Meadows. Additionally, construction is currently underway for the Parker Homestead development just north of Hess Road. The remaining undeveloped areas are centered on the intersection of Chambers and Mainstreet. West of Chambers, commercial and residential development is currently in the planning stages as part of Meridian Village. The weighted impervious value for the lower watershed is 37% (future development condition, excluding the Rueter-Hess normal pool).

The Sandpit Tributary passes through the northern edge of the Parker Homestead development and empties into the mainstem just east of Chambers Road. West of Parker Homestead, construction is currently underway for the new Parker Water and Sanitation District water treatment plant. The upper portion of the Sandpit Tributary remains undeveloped with no plans for future development.

The Jordan Road tributary, which empties into the mainstem just west of Jordan Road, is fully developed with portions of Stonegate Village and Bradbury Ranch.

2.3 REACH DESCRIPTION

Reach descriptions will be included in subsequent reports.

2.4 FLOOD HISTORY

The 1993 OSP does not include a record of flooding for the watershed, in part because the majority of development in the lower watershed (downstream of Rueter-Hess Reservoir) occurred after the 1993 OSP study. The floodplain was effectively managed during development to leave sufficient capacity for major storms flows while preventing damage to adjacent structures. The addition of Rueter-Hess Reservoir will reduce the peak flows in the developed portions of the watershed, further reducing the flooding impacts.

In Challenger Park, Newlin Gulch crosses Recreation Drive with an on-grade crossing which has caused recent flooding problems. The crossing is signed with flood warnings including flashing hazard lights. Despite these warnings, vehicles have been documented using the crossing during flood events. In one recent case, a vehicle stalled in the moving water. Alternatives to an on-grade crossing will be analyzed in subsequent reports.

2.5 ENVIRONMENTAL ASSESSMENT

An environmental assessment will be included in subsequent reports.

3 HYDROLOGIC ANALYSIS

3.1 OVERVIEW

In watersheds where hydrologic models exist, master planning efforts generally utilize the existing models as a starting point for baseline hydrology, with revisions made as necessary to reflect changes in the watershed and to update the models to current software. For Newlin Gulch, hydrologic models from the 1993 OSP were provided by UDFCD. Electronic AutoCAD or GIS files were not available for the OSP subwatershed delineation. A number of challenges arose while reviewing and attempting to recreate the boundaries based on the Hydrological Basin Map from the 1993 report. Most evident was the impact of Rueter-Hess Reservoir on the watershed: the maximum normal pool of the Reservoir covers about 12% of the total watershed area. As a result, the Big Windmill, Canal, and Parkway Tributaries have been significantly shortened, and the Benchmark Tributary has been completed eliminated by the Reservoir permanent pool. Accordingly, the subwatershed delineations, design points, and routing elements necessary to model the Reservoir are different from the 1993 OSP. In addition, significant development in the lower watershed necessitated numerous changes to subwatershed boundaries, design points, and routing elements. As a result, though the 1993 boundaries were used as a guide, a new subwatershed delineation was performed.

These watersheds were evaluated using UDFCD's Colorado Urban Hydrograph Procedure (CUHP) 2005, version 1.3.3 (release date January 2010). Hydrographs generated in CUHP were then routed through the Environmental Protection Agency's (EPA) Storm Water Management Model (SWMM), version 5.0.020. Due to the numerous changes that would have been needed to reflect the updated delineation, the design team elected to create a new SWMM model as well rather than update the previous model. This facilitated numerous improvements to the model to make it more user-friendly with the current software, including a revised naming scheme for subwatersheds, conveyance elements, and design points; layout of the SWMM model elements in the graphical user interface (GUI) over a background image of the watershed; and updating SWMM node elevations to match the project mapping.

3.2 DESIGN RAINFALL

One-hour point rainfall depths for the 2-, 5-, 10-, 25-, 50-, and 100-year storm events were obtained from UDFCD rainfall maps for the project area and compared with the values used in the 1993 OSP. Current values are slightly lower than those used in 1993 for all but the 50-year storm, as shown in **Table 3-1.**

UDFCD is currently in the process of updating the criteria presented in the USDCM. Updates include changes to the

Table 3-1: Point Rainfall Depths

	One-Hour Rainfall Depth (in)									
Storm										
Event	1993 OSP	Current Study								
2-year	1.06	0.95								
5-year	1.43	1.41								
10-year	1.66	1.66								
25-year	N/A	1.97								
50-year	2.26	2.28								
100-year	2.6	2.57								

design storm duration and adjustments based on watershed size. The September 2012 draft version of Chapter 4 – Rainfall of the USDCM was used to develop the design rainfall distributions for this study. While the 1993 OSP used a 3-hour design storm for the Newlin Gulch watershed, the updated criteria eliminates 3-hour design storms and extends the use of a 2-hour storm duration to watersheds up to 15 square miles. Because the Newlin Gulch watershed is almost exactly 15 square miles, only a 2-hour storm distribution was used.

Adjustments to the incremental rainfall point values based on watershed area have also changed with the September 2012 draft criteria. Depth Reduction Factors (DRFs) are only applied to watershed areas greater than 15 square miles for the 25-, 50-, and 100-year storm events; therefore no adjustment for these design storms was made. For the smaller 2-, 5-, and 10-year storm events, DRFs are applied when watershed areas exceed 2 square miles. In order to apply a DRF, adjustment values are interpolated from tables provided in the draft criteria based on the applicable contributing area. CHUP and SWMM are then run with the adjusted incremental rainfall values, and design peak flow rates from the DRF-adjusted models are used for design points where the cumulative area exceeds the limits given. Several DRF-adjusted runs may be required as the cumulative watershed area increases down the mainstem. For design points in the upper watershed or off the mainstem, where the cumulative area is below the DRF threshold, the unadjusted models are used to generate design peak flow rates.

In this case, Rueter-Hess Reservoir effectively disconnects the upper watershed from the lower watershed by drastically minimizing the contributions of the upper watershed on the lower watershed peak flow rates. As a result, the project team elected to apply the DRFs separately in the upper and lower watersheds in order to avoid over-correcting for the contributing watershed area below the reservoir. Upstream of Rueter-Hess, the 2 square mile limit is exceeded at the confluence of Newlin Gulch, Spring Tributary, and Roundtop Tributary, with a combined area of 2.8 square miles. The contributing watershed area increases to 3.2 square miles at the edge of the projected normal reservoir pool. DRFs based on a 3 square mile area were interpolated from the 2 square mile and 5 square mile values listed in the draft criteria and applied to design points NG014 (edge of normal pool), NG013, and NG220 (total reservoir inflow). Downstream of Rueter-Hess (excluding the area contributing to the reservoir), the 2 square mile limit is exceeded at the confluence of Newlin Gulch and Sandpit Tributary, with an combined area of 2.2 square miles. The contributing watershed area increases to 4.5 square miles at the confluence of Newlin Gulch and Cherry Creek. For simplicity, the same 3 square mile DRF adjustment was made for the lower watershed, and applied to mainstem design points NG006 (at Stonegate Parkway) through NG000 (at the confluence with Cherry Creek).

Adjustment factors for the 3 square mile DRF are presented in **Table 3-2.** Rainfall distributions for all return periods, adjusted and unadjusted, are listed in **Table B-1**, **Appendix B**. Tables 4-1, 4-3, and 4-4 of the draft criteria update, which detail the applications of DRFs, are also included in **Appendix B**.

Table 3-2: Depth Reduction Factors

	3 Square Mile Area DRF
	2-, 5-, and 10-Year
Time (minutes)	Design Rainfall
5	1.00
10	1.00
15	0.99
20	0.95
25	0.95
30	0.95
35	0.99
40	0.99
45	1.00
50	1.00
55	1.00
60	1.00
65-120	1.00

3.3 SUBWATERSHED CHARACTERISTICS

Subwatershed characteristics were defined according to the revised delineation and current mapping and land use information. For each subwatershed, the flow path from the highest point in the basin was determined from the project mapping and used to define the length and distance to centroid. The length-weighted slope along the flow path was then calculated according to the method described in the USDCM. Existing and future imperviousness was determined based on the land use assumptions outlined in **Section 2.2**. Hydrologic soil group classifications were determined via the Natural Resources Conservation Service Web Soil Survey. Based on the soil groups present in each subwatershed, weighted values were calculated for initial and final infiltration rates as well as for the Horton's decay coefficient. Depression losses in pervious and impervious areas were set at 0.5 and 0.1, respectively, to match the values used in the 1993 OSP. A unit hydrograph time increment of 1 minute was used, since some of the subwatersheds are less than 90 acres (USDCM Table RO-1).

A total of 98 subwatersheds were defined. Areas ranged from 22 acres to 177 acres, with an average size of 87 acres (excluding the Rueter-Hess basin A-220). At the outset of the study, the maximum desired subwatershed area was 130 acres, however, this requirement was relaxed to allow for more reasonable subwatershed delineations in undeveloped areas. With the exception of Rueter-Hess, four subwatersheds (A-165, A-210, C-110, and C-120) significantly exceed the 130 acre guideline.

Hydrologic soil groups, existing and future impervious values, and subwatershed boundaries are shown on the interactive hydrology map in **Figure B-1**, **Appendix B**. A summary of all subwatershed values used in CUHP is presented in **Table B-2**, **Appendix B**.

3.4 HYDROGRAPH ROUTING

A new SWMM model was created for routing of the hydrographs generated in CUHP. Channel geometry was approximated from the project mapping, utilizing 2' interval topography north of Rueter-Hess Reservoir, and 5' interval topography in the remainder of the watershed. Trapezoidal elements were used exclusively for conveyance. SWMM determines channel slopes based on the segment length and elevations of upstream and downstream nodes; node elevations were defined based on the project mapping. Manning's n values were calculated using the Jarrett equation (USDCM Equation RO-10), and then were compared to the 1993 OSP values. Design points were placed at the downstream end of each subwatershed, with additional points included to reflect flow rates before and after the confluence with each tributary channel. Two detention storage areas were identified as eligible for inclusion into the baseline hydrology: Rueter-Hess Reservoir and Bradbury Ranch Pond IV. These are further discussed in Sections 3.4.1 and 3.4.2 below.

SWMM model conveyance elements, subwatershed nodes, design points and storage elements are shown on the interactive hydrology map in **Figure B-1**, **Appendix B**. SWMM routing schematics are provided as **Figures B-2 and B-3** in **Appendix B**. SWMM input parameters and output results for the 100-year future development condition are included in **Tables B-7 and B-8**, **Appendix B**.

3.4.1 Rueter-Hess Reservoir Routing

The most significant storage area within the Newlin Gulch watershed is Rueter-Hess Reservoir, located on the Newlin gulch mainstem. The reservoir is owned and operated by Parker Water and Sanitation District (PWSD). Although the reservoir is designed only for water storage, the reservoir surface area is so large relative to the tributary watershed that it provides significant inadvertent flood detention. Outflows from the reservoir are controlled through a gated, multi-chambered tower that connects to two 78-inch diameter outlet conduits. The service spillway is comprised of two of the upper openings in the outlet works tower, each approximately 10-feet wide and 5-feet tall. The maximum normal pool elevation for the reservoir is elevation 6215.1 (NAVD88) which is equal to the crest of the service spillway. According to an evaluation conducted by the reservoir design engineer, the service spillway can convey both the 100-year and 500-year storm events. An auxiliary (or emergency) spillway consisting of a 500-foot long labyrinth weir is located on the west side of the dam embankment. The auxiliary spillway crest is at elevation 6216.7, which is 1.6-feet above the service spillway crest. The auxiliary spillway is designed to convey extreme flood events (greater that the 500-year).

To determine the flood detention impacts of Rueter-Hess, several options for routing floods through the reservoir were evaluated with the SWMM model. These options included flood routing through the service spillway, routing through the auxiliary spillway, and routing without the reservoir. The results of the routing options are summarized in a memorandum completed in May 2013 entitled *Rueter-Hess Reservoir Flood Control Benefits*. This memorandum, along with a summary table comparing downstream flows for the different routing options, are provided in **Appendix C**. The project sponsors, in cooperation with

PWSD, selected the option of routing through the auxiliary spillway for the baseline hydrology. The modeling results for this option show that, in the future development condition, a peak 100-year inflow of over 10,000 cfs routed through the reservoir will be discharged downstream of the Reservoir at less than 1,000 cfs and the reservoir water surface will surcharge or rise by approximately 0.8-feet. No modification to the outlet works or spillways is necessary to achieve this flood detention/attenuation. The project sponsors and PWSD selected the auxiliary spillway routing option because it accounts for the significant inadvertent flood detention provided by the Reservoir, while still allowing for some flexibility to change the service spillway elevation in the future to accommodate additional water storage without altering 100-year flood discharges downstream.

The baseline hydrology model assumes the following for Rueter-Hess: the reservoir normal pool is 100% impervious, the reservoir is full to the auxiliary spillway crest (elev. 6216.7) prior to the storm event, the service spillway is ignored/blocked, and the upstream hydrograph is routed through the auxiliary spillway.

The project sponsors entered into an agreement with PWSD on November 13, 2014, entitled "Agreement Regarding the Intent to Assure the Flood Routing Capability of Rueter-Hess Reservoir in Douglas County, Agreement No. 14-05.05". This agreement officially recognizes the inadvertent flood routing capability of the Reservoir for the 100-year discharge along Newlin Gulch and the intention to assure that this flood routing capability is maintained. A copy of the agreement is included as **Appendix D**.

The reservoir stage-area and stage-discharge curves used for the baseline SWMM model are included in **Table B-3, Appendix B**. These curves were taken directly from the original storage and discharge rating curves shown on Drawing No. A-05 of the reservoir record drawings. A copy of this drawing is also included in **Appendix B**.

3.4.2 Bradbury Ranch Pond IV

Currently, the only regional detention pond recognized in the Newlin Gulch watershed is the Bradbury Ranch Pond IV located along the Jordan Road Tributary just south of Mainstreet. The detention pond was built with Phase 1 of the Bradbury Ranch development in the late 1990's and early 2000's. Pond IV is referred to in many of the Phase III drainage reports for the various filings of the development, but despite extensive searching no design plans were found. A stage-area curve was developed based on Douglas County 5-foot interval topography. A stage-discharge curve was developed based on a detailed ground survey of the two-stage pond outlet works, which consist of a 60-inch open-ended culvert (lower stage), and a 30-foot broad-crested weir (upper stage). The SWMM analysis shows that the upper stage will overtop in storm events exceeding a 50-year recurrence. Overtopping flows will cross Mainstreet at Bradbury Parkway before rejoining the Jordan Road Tributary.

Stage-area and stage-discharge curves for Bradbury Ranch Pond IV are included in Table B-3, Appendix B.

3.5 Previous Studies

Newlin Gulch was previously analyzed in a 1977 FHAD and a 1993 OSP. The FHAD established the regulatory FEMA flow rates. Hydrographs were based on a 24-hour design storm with a Type IIA SCS rainfall distribution; peak discharges were calculated with the Soil Conservation Service's computer programs WSP2 and TR20.

The 1993 OSP utilized 2-hour and 3-hour design storms. Hydrographs were generated with the PC version of CUHP and routed through UDSWM2-PC. In 1993, the OSP notes that less than five-percent of the watershed area was impervious. The future land-use assumptions made in the OSP significantly increased the watershed imperviousness, but are still much lower than the current future land use projections. The future land use maps included in the OSP indicate that the upper portion of the watershed was modeled as about 80% open space (2%), with about 15% large lot residential (10%) and a small area of high-density residential (45%). The future land use imperviousness estimated in this area in the current study is significantly higher.

3.6 MODEL CALIBRATION

Standard practice for master planning studies on previously studied watersheds includes calibration of the hydrologic model to reconcile the results within 10% of the previously published data. This practice ensures that changes in baseline hydrology are due to changes within the watershed or updates to criteria rather than differences in software. Calibration is generally done through adjustment of Cp and/or Ct values in the CUHP, which impact the peak flow rates and the time to peak, respectively. This study targeted the 1993 OSP existing condition peak flow rates for reconciliation. A calibration "Historic" model was prepared, using 2% imperviousness across the entire watershed, and 100-year 2-hour and 3-hour rainfall distributions.

The results were found to agree within 10% for the majority of mainstem design points compared. In portions of the upper watershed, the 1993 OSP and current historic model do not calibrate to within 10%. However, these areas are on the upper end of an undeveloped watershed, where little infrastructure has been designed and built based on the previous peak flows. These results were presented to the project sponsors at the progress meeting on March 18, 2013. It was agreed that the current study CUHP and SWMM models reconciled with the 1993 OSP, and that no calibration of the model was necessary. Results of the calibration analysis are shown in Table 3-3.

Table 3-3: Model Calibration

	FHAD	OSP	Current	1977 FHAD *	1993 (OSP **	Current Study	% Increase Historic Model	% Increase Historic
	Cross	Design	Design	100-Yr	Existing	Future	100-Yr Historic†	vs 1993	Model vs.
Location	Section	Point	Point	(cfs)	(cfs)	(cfs)	(cfs)	OSP***	1977
Newlin Gulch									
Cherry Creek	28	180	NG000	4790	5357	5513	5674	6%	18%
Lincoln Ave. (U/S)		177	NG001		5198	5396	5637	8%	
Jordan Rd. (U/S)	23	176	NG002	4720	5220	5412	5636	8%	19%
Mainstreet (U/S)	16	166	NG006	4590	5330	5545	5269	-1%	15%
Mainstem and Tributary Inflow to Rueter-Hess		150	NG013		4969	5138	4454	-10%	
I-25 (U/S)		103	NG019		321	311	412	28%	
Tributaries									
Jordan Rd. Tributary at Newlin Confluence		276	SJ000		545	785	560	3%	
South Newlin at Mesa Confluence		128	SN001		1106	1167	1369	24%	
Mesa Tributary at South Newlin Confluence		224	MT000		420	470	490	17%	
Roundtop Tributary at Newlin Confluence		217	RT000		383	393	424	11%	
Spring Tributary at Newlin Confluence		219	ST000		773	840	885	14%	

Notes:

^{* 1977} FHAD flows based on 24-hour storm and WSP-2 and TR-20 models.

^{** 1993} OSP flows based on 3-hour storm and CUHP/UDSWM models.

^{***} Comparisons are based on current study historic model vs. the Existing Conditions 1993 OSP model and the 1977 FHAD model.

[†]Used 3-hour design storm where total watershed area is greater than 10 square miles. Used 2-hour design storm elsewhere.

3.7 RESULTS OF ANALYSIS

Newlin Gulch was analyzed for the 2-, 5-, 10-, 25-, 50-, and 100-year storm events under existing and future development conditions, using a 2-hour design storm. A comparison to previous studies is presented in **Table 3-4** below. Overall, while peak flow rates have increased somewhat in the upper watershed above Rueter-Hess Reservoir, peak flow rates in the lower watershed have decreased due to the effects of the reservoir. Though the reduction is drastic immediately below of the reservoir, the effect lessens as the mainstem approaches its confluence with Cherry Creek.

Detailed results are included in **Appendix B**. Peak flow rates at each design point are listed in **Table B-4**; runoff volumes and accumulated drainage areas at key locations are listed in **Tables B-5 and B-6**. Hydrographs at key locations for the 2-year and 100-year events are shown in **Figures B-4 and B-5**. Peak flow profiles for all storm events on the mainstem of Newlin Gulch are shown in **Figures B-6 and B-7**.

Table 3-4: Comparison to Previous Studies

					1993 (OSP **	Curren	Existing (cfs) 2843 3539 2795 3450 2793 3443 2212 2660 1945 2244 905 1029 890 1015 880 999 8822 10362 5871 7649 2454 3256 426 514		
Location	FHAD Cross Section	OSP Design Point	Current Design Point	1977 FHAD * 100-Yr (cfs)	100-Yr Existing (cfs)	100-Yr Future (cfs)	100-Yr Existing (cfs)	Future		
Newlin Gulch				(2 2)	ζ γ	(,	(3.3)	(2.2)		
Cherry Creek	28	180	NG000	4790	5357	5513	2843	3539		
Lincoln Ave. (U/S)		177	NG001		5198	5396	2795	3450		
Jordan Rd. (U/S)	23	176	NG002	4720	5220	5412	2793	3443		
Stonegate Parkway (U/S)			NG004				2212	2660		
Mainstreet (U/S)	16	166	NG006	4590	5330	5545	1945	2244		
Chambers Rd. (U/S)			NG009				905	1029		
Hess Rd.			NG011				890	1015		
Rueter-Hess Reservoir Outflow			NG012				880	999		
RH Total Inflow (Including Reservoir Subwatershed)			NG220				8822	10362		
Mainstem and Tributary Inflow to RH		150	NG013		4969	5138	5871	7649		
Mainstem Inflow to RH			NG014				2454	3256		
I-25 (U/S)		103	NG019		321	311	426	514		
Tributaries										
Jordan Rd. Tributary at Newlin Confluence		276	SJ000		545	785	690	758		
South Newlin at Mesa Confluence		128	SN001		1106	1167	1388	1564		
Mesa Tributary at South Newlin Confluence		224	MT000		420	470	493	598		
Roundtop Tributary at Newlin Confluence		217	RT000		383	393	429	504		
Spring Tributary at Newlin Confluence		219	ST000		773	840	1009	1427		

Notes:

^{* 1977} FHAD flows based on 24-hour storm and WSP-2 and TR-20 models.

^{** 1993} OSP flows based on 3-hour storm and CUHP/UDSWM models.

4 REFERENCES

- Carroll & Lange, Inc. *Final Drainage Study Phase III For The Country Club at Castle Pines.* Prepared for Fidelity Castle Pines, Ltd. June 12, 1992 with revisions through November 30, 1992.
- Carroll & Lange, Inc. Newlin Meadows Filing No. 3 Addendum #1 To Final Drainage Study for Newlin Meadows. Prepared for Gateway American Properties, LLC. March 17, 2006.
- Carroll & Lange, Inc. *Phase III Drainage Report For Villas at Castle Pines.* Prepared for America West Communities, LLC. January 8, 2001.
- Civil Design Group, Inc. *Phase III Drainage Report Castle Pines Village Filing 27A.* Prepared for Toll Brother, Inc. November 10, 2000. Revised August 23, 2001.
- Civil Design Group, Inc. *Phase III Drainage Report Castle Pines Village Filing 27B.* Prepared for Aslan Development, LLC. April 7, 2003.
- Civil Design Group, Inc. *Phase III Drainage Report Castle Pines Village Filing 28A.* Prepared for Aslan Development, LLC. November 10, 2000. Revised May 4, 2001.
- CVL Consultants of Colorado, Inc. *Final Drainage Report for Filing No. 5 Bradbury Ranch Town Homes.*Prepared for Ryland Homes, Inc. November, 2000. Revised January, 2001.
- CVL Consultants of Colorado, Inc. *Final Drainage Report For The Douglas 234 Subdivision*. Prepared for Melody Homes, Inc. December, 2002 with revisions through August 25, 2004.
- CVL Consultants, Inc. *Final Drainage Report: Bradbury Ranch Phase III.* Prepared for AMREPCO Inc. October 10, 2000 with revisions through June 26, 2001.
- CVL Consultants, Inc. *Final Drainage Report: Bradbury Ranch Phase III.* Prepared for AMREPCO Inc. October 10, 2000 with revisions through June 26, 2001.
- Dewberry-Integra. Drainage Report For Parker Water and Sanitation District Reueter-Hess Water Treatment Plant. Prepared for Parker Water and Sanitation District. October 14, 2011.
- Douglas County Community Planning & Sustainable Development Department. *Douglas County Zone District Map.* October 31, 2011.
- EMK Consultants, Inc. Addendum No. 1 To The Final Drainage Study For Clarke Farms Filing Number 2. Prepared for U S Home Corporation. August, 1992.
- EMK Consultants, Inc. *Final Drainage Report For Newlin Gulch At Parker Homestead*. Prepared for Parker Homestead Investments, LLC. July 11, 2011. Revised December 9, 2011.

- EMK Consultants, Inc. Final Drainage Report For Parker Homestead Filing 2 & All Lots Northwest Of Newlin Gulch. Prepared for Parker Homestead Investments, LLC. June 24, 2011. Revised August 2, 2011.
- EMK Consultants, Inc. *Final Drainage Report For Parker Homestead Filing No. 1 And Double Angel Road.*Prepared for Parker Homestead Investments, LLC. May 16, 2011. Revised July 13, 2011.
- EMK Consultants, Inc. *Final Drainage Report For Regency Filings 1 And 2*. Prepared for Canterberry Development Company, LLC. March 1, 2006. Revised May 19, 2006.
- EMK Consultants, Inc. *Final Drainage Report For Sandpit Tributary At Parker Homestead*. Prepared for Parker Homestead Investments, LLC. July 11, 2011 with revisions through July 17, 2012.
- EMK Consultants, Inc. *Final Drainage Study And Storm Water Management Plan For Clarke Farms Filing No. 5B.* Prepared for U S Home Corporation. August, 1993.
- EMK Consultants, Inc. Final Drainage Study And Storm Water Management Plan For Clarke Farms Filing No. 6B. Prepared for U S Home Corporation. December, 1993.
- EMK Consultants, Inc. *Final Drainage Study For Clarke Farms Filing No. 5A.* Prepared for U S Home Corporation. August 24, 1992.
- EMK Consultants, Inc. *Final Drainage Study For Clarke Farms Filing No. 6A.* Prepared for U S Home Corporation. August 24, 1993.
- EMK Consultants, Inc. *Final Drainage Study For Clarke Farms Filing Number 1*. Prepared for Silverado-Elektra Venture, LTD. & MDC Construction Company. March, 1986."
- EMK Consultants, Inc. *Final Drainage Study For Clarke Farms Filing Number 2.* Prepared for Silverado-Elektra Venture, LTD. & MDC Construction Company. July 1992.
- EMK Consultants, Inc. *Final Drainage Study For Clarke Farms Subdivision Filing No. 4.* Prepared for U S Home Corporation. February, 1993.
- EMK Consultants, Inc. *Final Drainage Study For Stonegate Filing Nos. 1A, 1B And 1C.* Prepared for Mobil Land Development (Colorado) Corporation. December, 1984.
- EMK Consultants, Inc. *Final Drainage Study for Stonegate Filing No. 2.* Prepared for Mobil Land Development (Colorado) Corporation. December, 1984.
- EMK Consultants, Inc. *Master Drainage Study For Stonegate*. Prepared for Mobil Land Development (Colorado) Corporation. November, 1984. Revised April, 1985.

- EMK Consultants, Inc. *Phase 3 Drainage Study For Stonegate Filings 21 A-D.* Prepared for Stonegate Developments, Inc. March, 1995.
- EMK Consultants, Inc. *Phase 3 Drainage Study, Final Erosion Control Plan, And Stormwater Management Plan For Stonegate Filings 17 & 19.* Prepared for Stonegate Developments, Inc. April, 1995.
- EMK Consultants, Inc. *Phase III Drainage Study For Stonegate Filing 15A, 15B, And 15F.* Prepared for Stonegate Developments, Inc. May, 1993 with revisions through July 7, 1993.
- EMK Consultants, Inc. *Phase III Drainage Study For Stonegate Filing 15C, And 15E.* Prepared for Stonegate Developments, Inc. May 28, 1993 with revisions through July 22, 1993.
- EMK Consultants, Inc. *Phase III Drainage Study For Stonegate Filing 15G.* Prepared for Stonegate Developments, Inc. July, 1993.
- EMK Consultants, Inc. *Phase III Drainage Study For Stonegate Filing No. 5A and 5B.* Prepared for Stonegate Developments, Inc. February, 1987 with revisions through June, 1991.
- EMK Consultants, Inc. *Phase III Drainage Study For Stonegate Filing No. 5C.* Prepared for Stonegate Developments, Inc. January, 1992.
- Felsburg Holt & Ullevig. *Phase III Drainage Report for the Chambers Road Extension and West Mainstreet Improvements.* Prepared for Douglas County, Colorado. December 16, 2005.
- Futura Engineering Inc. *Final Drainage Report Amendment: Bradbury Ranch Filing 6.* Prepared for Ryland Homes, Inc. October 30, 2000. Revised May 14, 2001.
- Futura Engineering Inc. *Final Drainage Report: Bradbury Ranch Filing No. 1.* Prepared for AMREPCO Inc. July 3, 1995.
- Futura Engineering Inc. *Final Drainage Report: Bradbury Ranch Phase II Filing No. 3A.* Prepared for AMREPCO Inc. January 12, 1999 with revisions through July 28, 1999.
- Futura Engineering Inc. *Final Drainage Report: Bradbury Ranch Phase II Filing No. 3B.* Prepared for AMREPCO Inc. March 28, 1999 with revisions through February 4, 2000.
- Futura Engineering Inc. *Final Drainage Report: Bradbury Ranch Phase II Filing No. 4.* Prepared for Ryland Homes, Inc. October 12, 1999 with revisions through March 15, 2000.
- Galloway, Romero & Associates. *Phase III Drainage Report and Erosion Control Study for Stonegate Village Center [All Lots Formerly Filing No. 17]*. Prepared for DeRose Property Company Stonegate, LLC. September 15, 1998. Revised January 15, 1999.

- High Country Engineering, Inc. *Final Drainage Report For Newlin Meadows.* Prepared for Gateway American Properties, LLC. November 25, 2002. Revised April 9, 2003.
- Highline Engineering and Surveying Company, Inc. Final Drainage Study For Lutheran High School Of The Rockies New Horizon Subdivision Filing No. 1. Prepared for Lutheran High School Of The Rockies. March 11, 2003. Revised September 17, 2003.
- Highline Engineering and Surveying Company, Inc. *Final Drainage Study For New Horizon*. Prepared for Rocky Mountain District Lutheran Church. May 30, 2002 with revisions through August 23, 2003.
- JR Engineering, LTD. *Final Drainage And Erosion Control Report For Challenger Park Estates.* Prepared for Continental Homes. June 11, 1997. Revised March 9, 1998.
- JR Engineering, LTD. *Phase III Drainage Report For Stonegate Filing 15D.* Prepared for Stonegate Developments, Inc. June 8, 1993 with revisions through September 8, 1993.
- Kiowa Engineering Corporation. *Final Drainage Plan Douglas County Elementary School #20.* Prepared for Douglas County School District RE-1. February, 1994. Revised March, 1994.
- Kiowa Engineering Corporation. *Newlin and Baldwin Gulches and Basin 4600-09 Outfall Systems Planning Alternative Development & Evaluation*. Prepared for Urban Drainage and Flood Control District. September, 1993.
- Kirkham Michael. *Drainage and Erosion Control Report.* Prepared for KB Home. January 8, 2001. Revised November 5, 2001.
- Nolte Associates, Inc. *Phase I Drainage Report For The Canyons*. Prepared for North Canyons, LLLP. April, 2009. Revised June, 2009.
- The Lund Partnership. *Phase III Drainage Report for Lagae Ranch*. Prepared for HF Holdings, LLC. March 21, 2008 with revisions through August 22, 2008.
- Town of Parker. Zoning Map Town of Parker, Colorado. October, 2012
- Urban Drainage and Flood Control District. *Urban Storm Drainage Criteria Manual, Volumes I & II.* 2001 Edition with revisions through April 2008.
- VCDS, Inc. Castle Pines Town Center Planned Development Phase I Drainage Report. Prepared for A & A Investments, LLC. April 5, 2011. Revised July 7, 2011.
- WBC Engineering & CM, LLC. *Newlin Crossing Planned Development*. Prepared for 98 W. Parker, A Colorado LLP. January 24, 2008 with revisions through November 5, 2009.

MULLER ENGINEERING COMPANY REFERENCES PAGE 4-2

MEETING MEMORANDUM

MULLER ENGINEERING COMPANY, INC.

CONSULTING ENGINEERS 777 SOUTH WADSWORTH BLVD., SUITE 4-100 LAKEWOOD, COLORADO 80226 (303) 988-4939

Project

Newlin Gulch MDP

Sponsors

UDFCD / Douglas County / Town of Parker

Meeting Location

UDFCD

Attendees

Shea Thomas, UDFCD
Bill DeGroot, UDFCD
Brad Robenstein, Douglas County
Tom Williams, Town of Parker
Jacob James, Town of Parker
Derek Johns, Muller Engineering Company
Jim Wulliman, Muller Engineering Company
Andy Pultorak, Muller Engineering Company

Meeting Date

Nov. 19, 2012

Issue Date

Nov. 28, 2012

MEC Project No. 12-050.01

Minutes Prepared By

Andy Pultorak

Routing

ASP / DDJ / JTW

Purpose

Newlin Gulch MDP Kick-off Meeting

Action Items

All action items are requested to be completed by December 7, 2012 unless otherwise noted.

Muller Action Items:

- 1. Muller will review the Baldwin Gulch mapping provided by Shea and update the survey request for Baldwin accordingly. Muller will then send the updated request to Shea.
- 2. Muller will contact Parker Water & Sanitation District (PWSD) to obtain the Reuter-Hess spillway configuration for use in modeling the Reservoir impacts to the downstream watershed.
- 3. Muller will provide a survey request figure to Shea with survey needs at Challenger Park (Recreation Drive).
- 4. Muller will coordinate with the sponsors to setup the first progress meeting.
- 5. Muller will contact Castle Pines to obtain the latest development plans for the upper watershed.
- 6. Muller will setup the project website and invite the project team to review before posting.

UDFCD Action Items:

- 1. Shea will provide aerial mapping for Baldwin Gulch to Muller. (Complete)
- 2. Shea will invite Muller to the project Dropbox folder. (Complete)
- 3. Shea will provide new 2-foot LiDAR mapping of the Newlin Gulch watershed once processing is complete (should be the week of November 25th).

Douglas County Action Items:

- 1. Brad (Douglas County) will provide Muller with the LOMR document for the Hess Rd. crossing (LOMR 11-08-0044P).
- 2. Brad (Douglas County) will provide Muller with drainage reports and as-built plans for the requested developments within the watershed.

Newlin Gulch MDP – Kickoff Meeting – Meeting Minutes November 19, 2012

Town of Parker Action Items:

- Jacob will provide Muller with drainage reports and as-built documents for the requested developments within the watershed.
- 2. Jacob will provide Muller with LOMR documents for the crossings at Lincoln, Jordan, and Chambers (Complete).

Discussion

THE FOLLOWING IS OUR UNDERSTANDING OF THE SUBJECT MATTER COVERED IN THIS CONFERENCE. IF THIS DIFFERS WITH YOUR UNDERSTANDING, PLEASE NOTIFY US IMMEDIATELY.

Agenda

1. REVIEW PROJECT APPROACH AND SPONSOR GOALS

- a. Derek introduced the project and stated that the goal was to update the Major Drainageway Plan for the Newlin Gulch watershed based on current and projected land use.
- b. Reuter-Hess Reservoir impacts
 - Derek stated that the construction of the Reuter-Hess Reservoir significantly attenuates the downstream peak flows for major floods. Although the reservoir was not designed for flood storage, the large surface area provides significant storage for major floods. Derek said that evaluations complete by the design engineer for Reuter-Hess indicate that, with the reservoir at full capacity, the 100-year flood event would cause about 0.6-feet of rise in the reservoir. For the 100-year event, the reservoir will not crest the emergency spillway and the downstream peak flow will be reduced to near zero.
 - Derek said that recent infrastructure projects downstream of the dam utilized the reduced peak flow rates in design, resulting in significant cost savings. However, since FEMA does not recognize the reduced flow rate, the map revisions for these projects used the much higher regulatory flow rate. Therefore, these projects showed overtopping where none is likely to occur.
 - Tom said that from a land-use perspective he was in favor of keeping the FIS flow rates intact, since the watershed has already been significantly developed. However, from an infrastructure planning perspective, he saw value in having FEMA adopt the reduced flow rates so that smaller, most cost-effective crossing structures could be built.
 - Jim noted that FEMA would require an adequate assurances agreement to be entered into by Parker Water and Sanitation District (the reservoir operator) before the flood storage could be acknowledged by FEMA. Bill DeGroot said that at Standley Lake the reservoir operator had initially signed an adequate assurances agreement but later started work on a project which would have modified the reservoir operation and put houses in the floodplain. He also pointed out that designing channel crossings to the current FIS flow rate provided a factor of safety against clogging.
 - Muller will evaluate the watershed hydrology with and without the flood storage effects of Reuter-Hess, and present their findings to the team at a future progress meeting. The project team will decide which set of flow rates makes the most sense to publish for this study considering the issues mentioned above.
 - Tom stated that Reuter-Hess had held runoff from large storm events in June and July. The State Engineer's Office required release of this water, which started at 20-30 cfs and increased to a few hundred cfs. This caused noticeable stream degradation in Newlin Gulch immediately downstream. The team expected that the frequency and duration of flow releases from reservoir operations could threaten the stability of Newlin Gulch in the future.

1

2.

Newlin Gulch MDP – Kickoff Meeting – Meeting Minutes November 19, 2012

Tom has discussed operations with PWSD and would like Reuter-Hess to release at lower flow rates of 20-30 cfs over a longer time period when they have to release runoff. This study will develop recommendations to stabilize the channel and prevent downcutting and erosion.

- c. Muller will make sure that the recommendations of the MDP are consistent with the goal of preserving natural and beneficial stream functions. The team would like to preserve the natural character of the Newlin Gulch floodplain.
- d. As part of the study, the team would like Muller to prepare alternatives to address flood conveyance at the Recreation Drive "Texas" crossing in Challenger Park. The team noted that, despite flood warning devices, this area continued to pose a hazard to motorists. Tom said that one of the challenges at this location is to design a crossing in a manner that does not cause floodplain issues.
- e. The Baldwin Gulch portion of the study will focus on a stability analysis of the spillway for the Soil Conservation Service dam east of Pine Lane. The stability of the Baldwin Gulch channel between the dam and Pine Lane will also be evaluated. Muller will prepare a list of supplemental survey needs for this area (see Action Items).

2. DATA FOR BASELINE HYDROLOGY.

- a. Mapping
 - Muller presented a large scale figure of the Newlin Gulch watershed superimposed on 5-foot topography provided by Douglas County.
 - If necessary, Muller has access to the 2008 DNC LiDAR topo for areas north of Lincoln.
 - Shea thought that the new LiDAR topo she had flown this year for Newlin Gulch might cover the entire watershed.
 - Muller will use the new LiDAR topo provided by Shea (see Action Items) to delineate the basins and sub-basins, and will supplement with the Douglas County 5-foot topo as necessary.
- b. Land Use
 - Shea provided Muller with aerial imagery from 2011 for the watershed.
 - Jacob will provide Muller with updated 2012 aerial photography.
 - Muller obtained zoning maps for Douglas County and Parker.
 - Muller has already obtained some drainage reports and as-built documents for the surrounding developments as part of the adjacent Happy Canyon Creek master plan. Muller will request additional drainage reports and as-builts as necessary (see Action Items).
 - The development plan in Castle Pines (upstream of Reuter-Hess) has changed significantly since the 1994 OSP. Muller will coordinate with Brad Meyering (Castle Pines Metro District) to obtain the latest development plan in this area.
- c. Identify Existing Detention Ponds (regional and publically maintained)
 - With the exception of Reuter-Hess, Derek asked the project team if they were aware of any publically maintained detention ponds within the watershed. The team was not aware of any ponds.
- d. Reuter-Hess Reservoir
 - As part of several design projects within Stonegate Village, Muller had already obtained some documentation regarding the operation of the Reuter-Hess Reservoir. Muller will coordinate with PWSD to obtain additional information needed to complete the baseline hydrology (see Action Items).
 - Derek mentioned that in his previous experiences modeling watersheds containing large reservoirs, certain unique challenges arose. Muller plans to model the reservoir full to the normal pool elevation prior to the storm and make the reservoir a sub-basin within the watershed with an imperviousness of 100%. The team agreed with this approach. Derek

Newlin Gulch MDP – Kickoff Meeting – Meeting Minutes November 19, 2012

stated that some basin characteristics (such as average basin slope) were difficult to estimate for a reservoir. Shea said that she would work with Muller to adjust the Cp factor to create a reasonable time to peak for the reservoir sub-basin.

3. Approach to Baseline Hydrology

Derek summarized the steps for developing the baseline hydrology:

- a. Convert CUHP/SWMM file from 1994 OSP
- b. Update subwatershed boundaries and characteristics (excluding % imperv.)
- c. Calibrate to the existing FEMA flow rates (per 1977 FHAD). The FEMA flow rates are published downstream of Reuter-Hess. Upstream of Reuter-Hess, Muller will compare their peak flow rates to the 1994 OSP, but no calibration is required. Muller will also compare, but not calibrate, their flow rates to those published as part of the recent Cherry Creek FHAD study.
- d. Update % imperviousness values for existing and future land use.
- e. Add eligible publically maintained detention ponds.

4. SUPPLEMENTAL FIELD SURVEY

- a. Newlin Gulch MDP
 - The team discussed the need for supplemental ground survey at road crossings. Parker and Douglas County have LOMR studies for all of the major crossings and will send copies of these studies to Muller. The team decided that no supplemental crossing survey is warranted at this time.
 - Derek mentioned a private drive between Chambers Rd. and Hess Rd. This is a low-water crossing consisting of 18-inch culvert pipes. The team decided that no survey is necessary at this location.
 - Muller will coordinate with Shea to obtain ground survey of the Recreation Drive "Texas" crossing (see Action Items).
- b. Baldwin Gulch
 - Shea has already obtained 2-foot aerial mapping of the SCS dam on Baldwin Gulch as part of a survey effort for another project. Muller will review this survey and determine if additional ground survey is warranted (see Action Items).

5. IDENTIFY AND CONTACT STAKEHOLDERS (WHO AND WHEN)

The team discussed contacting other stakeholders (below). Muller will contact PWSD and Castle Pines initially as part of the baseline hydrology task. At Shea's recommendation, the team will wait for the completion of the baseline hydrology to involve the other stakeholders in progress meetings.

- a. Parker Water & Sanitation District
- b. Castle Pines
- c. CCBWQA and CDOT

6. PROJECT WEBSITE

- a. The project website will be similar to the website Muller created for the Happy Canyon MDP & FHAD
- b. The website will contain sponsor logos but not individual contact information.
- c. The website comment form will be setup so that comments are emailed to Muller. Muller will then distribute comments to the project sponsors.
- d. Muller will create a draft version of the website for Shea to review before making it live.

UDFCD, TOWN OF PARKER, DOUGLAS COUNTY NEWLIN GULCH MAJOR DRAINAGEWAY PLAN

Newlin Gulch MDP – Kickoff Meeting – Meeting Minutes November 19, 2012

7. PROJECT SCHEDULE.

- a. Derek presented a draft project schedule to the team.
 b. Muller anticipates completing the first draft of the baseline hydrology by early February. Shea thought that this was an appropriate timeframe.

8. OTHER ITEMS AND NEXT MEETING.

- The next meeting will be held in January. Muller will coordinate with the sponsors to establish an acceptable meeting time.
- There being no other business, the meeting was adjourned.

END OF MINUTES

MEETING MEMORANDUM

MULLER ENGINEERING COMPANY, INC.

CONSULTING ENGINEERS 777 SOUTH WADSWORTH BLVD., SUITE 4-100 LAKEWOOD, COLORADO 80226 (303) 988-4939

Project

Newlin Gulch MDP

Sponsors

UDFCD / Douglas County / Town of Parker

Meeting Location

UDFCD

Attendees

Shea Thomas, UDFCD
Bill DeGroot, UDFCD
Brad Robenstein, Douglas County
Tom Williams, Town of Parker
Jacob James, Town of Parker
Derek Johns, Muller Engineering Company
Jim Wulliman, Muller Engineering Company

April 21, 2013

Issue Date

Meeting Date

March 18, 2013

MEC Project No. 12-050.01

Minutes Prepared By

Derek Johns

Routing

ASP / DDJ / JTW

Purpose

Newlin Gulch MDP – Progress Meeting #2

Muller Action Items:

- 1. Muller will evaluate two other options for routing at Rueter-Hess Reservoir:
 - a. Route flows through the auxiliary spillway.
 - b. Eliminate Rueter-Hess Reservoir completely and model reservoir subwatershed based on historic conditions and 2% imperviousness.
- 2. Muller will email the Sandpit Tributary flow rates to the project team.
- 3. Muller will evaluate flow rates for smaller storm events (2-yr, 5-yr, etc.) on Newlin Gulch by the Parker Homestead development and email these to Parker.
- 4. Muller will update the project schedule.

UDFCD Action Items:

- 1. Shea will provide input to Muller regarding depression storage losses for subwatersheds.
- 2. Shea will provide input to Muller regarding using Jarrett's equation to compute n-values for SWMM channels.
- 3. Shea will get the project website linked up to the UDFCD website.

Douglas County Action Items:

- Brad will investigate whether or not there is a regional detention pond on the Spring Tributary upstream of I-25.
- 2. Brad and Tom will setup a meeting with PWSD to discuss Rueter-Hess Reservoir routing.

Town of Parker Action Items:

1. Jacob will provide Muller with drainage and as-built information for the regional detention pond on the Jordan Road Tributary upstream of Mainstreet.

Newlin Gulch MDP – Progress Meeting #2– Meeting Minutes March 18, 2013

Discussion

THE FOLLOWING IS OUR UNDERSTANDING OF THE SUBJECT MATTER COVERED IN THIS CONFERENCE. IF THIS DIFFERS WITH YOUR UNDERSTANDING, PLEASE NOTIFY US IMMEDIATELY.

Derek provided an overview of the draft hydrology modeling completed since the last meeting and summarized the initial results. Below is a summary of the information discussed in the meeting.

1. SUBWATERSHEDS

- a. Derek reviewed the mapping that was used for the hydrology analysis. The mapping consists of the following:
 - New 2-foot contour mapping for the Newlin Gulch channel corridor downstream of Rueter-Hess Reservoir. This mapping was completed in 2012 and provided by UDFCD.
 - Older 5-foot contour mapping for areas beyond the 2-foot mapping limits and for the watershed upstream of Rueter-Hess Reservoir. This older mapping was completed in 1996 and provided by Douglas County.
 - Aerial photography from Parker dated 2012.
- b. Derek explained that the older 5-foot mapping does not always reflect drainage patterns correctly in newly developed areas. Therefore, land development drainage reports/maps were used to help delineate subwatersheds in newly developed areas.
- c. Derek explained that the initial plan was to start with the subwatersheds from the 1993 Outfall Systems Plan (OSP) and then check the delineation based on the more current topographic mapping. However, it was discovered that the OSP subwatersheds were no longer application for the following reasons:
 - There have been many new developments since the OSP and these developments have changed drainage patterns within the watershed.
 - The Rueter-Hess Reservoir subwatershed is very large. The reservoir was delineated as a single subwatershed based on the normal pool elevation. The normal pool elevation is significantly higher than the current water level and this results in a subwatershed area of 1.8 square miles or approximately 12% of the entire Newlin Gulch watershed.
 - The OSP subwatersheds were delineated using older mapping.
- d. Given these issues, a new subwatershed delineation was completed based on the more current mapping. The 15.0 square mile Newlin Gulch watershed was subdivided into 111 subwatersheds. The average subwatershed size is approximately 90 acres and only a few subwatersheds exceed 130 acres.

2. SOILS MAP

Derek handed out a map of the hydrologic soil types within the watershed. Most of the watershed consists of Type C/D soils. Type A and B soils exist along the Newlin Gulch channel.

I

Newlin Gulch MDP – Progress Meeting #2– Meeting Minutes March 18, 2013

3. LAND USE

- a. Derek handed out land use maps for existing and future development conditions and explained that these were prepared based on the 2012 aerial photography and information provided in land development drainage reports. Imperviousness values were assigned according to UDFCD guidelines.
- b. <u>Douglas County.</u> Land use for areas within unincorporated Douglas County include the following developments:
 - 1. Stonegate Village (existing) and Meridian Business Park (future).
 - Happy Canyon Ranches, Sapphire Pointe, and development along Lemon Gulch Road.
 - a. Brad (Douglas County) agreed that these were all large lot developments and would stay that way in the future. Brad thought that the development along Lemon Gulch Road was 35-acre lots.
 - b. Brad agreed with the percent imperviousness values shown on the maps.
- c. Town of Parker. Land use within Parker includes the following existing and future developments:
 - 1. Challenger Park and Bradbury Ranch (existing).
 - 2. New Horizon, Regency, Newlin Meadows (mostly developed).
 - 3. Newlin Crossing (on-hold).
 - 4. Parker Homestead (just started).
 - 5. Reuter-Hess WTP (just started).
- d. <u>Castle Pines</u>. Land use within Castle Pines includes the following developments:
 - 1. The Canyons is a very large development being planned immediately upstream of Rueter-Hess Reservoir. Imperviousness values for this development were based on information provided in a Phase 1 drainage report.
 - 2. Lagae Ranch and Castle Pines Town Center (future).
- e. <u>Major Roads.</u> Imperviousness values assumed for major roads were as follows:
 - 1. For I-25 and Hess Road, 60% imperviousness was assumed including ROW.
 - 2. For Chambers, Lincoln, Mainstreet, and Jordan Road, the imperviousness was assumed to be 100%.
- f. For existing land use conditions, Derek said that the composite percent imperviousness for the entire watershed was 4.9% in the 1993 OSP Study and is 22.5% for the current study.
- g. For future land use conditions, Derek said that the composite percent imperviousness for the entire watershed was 12.6% in the 1993 OSP Study and is significantly higher at 34.7% for the current study.
- h. The Town of Parker and Douglas County will review the land use maps and provide comments to Muller.

4. CUHP MODEL

- a. Derek said that both 2-hr and 3-hr rainfall events were modeled.
- b. Derek stated that the depression losses used for the CUHP model approximately match the values used in the 1993 OSP. For pervious areas, a depression loss of 0.5-inches was used. For impervious areas, a depression loss of 0.1-inches was used (OSP ranged from 0.1 to 0.15-inches). These values are within the range listed in the UDFCD criteria manual but slightly higher than the "recommended" values. Shea stated that she will review these and get back to Muller with comments (see UDFCD Action Items).

3

Newlin Gulch MDP – Progress Meeting #2– Meeting Minutes March 18, 2013

- c. <u>Rueter-Hess Reservoir subwatershed.</u> Derek stated that the subwatershed for Rueter-Hess Reservoir was delineated at its normal pool elevation. An imperviousness of 100% and a subwatershed slope of 0.1% were assumed. This is consistent with how similar reservoirs have been modeled within the District. The draft results of the CUHP modeling indicate a 100-year peak flow of 2958 cfs or 2.6 cfs/acre for the Rueter-Hess subwatershed. Derek noted that this is similar to the results of a study completed on Standley Lake in Westminster, Colorado, which yielded a unit discharge of 3.1 cfs/acre for the lake.
- d. Derek said that Muller performed a unit discharge check of the CUHP results. It was found that for undeveloped areas the subwatershed unit discharge typically varied from 1.0 to 1.6 cfs/acre. For residential areas, the unit discharge ranged from 2.0 to 3.8 cfs/acre. For business/commercial areas, the unit discharge ranged from 3.8 to 4.9 cfs/acre. Shea said that the unit discharges for oddly shaped basins (i.e., not meeting the 4:1 shape factor) should be checked. If the unit discharges are outside the normal range, then the Cp value should be adjusted.

5. SWMM MODEL

- a. Derek explained that Muller developed a new SWMM model for the Newlin Gulch watershed and did not use the 1993 OSP model. This approach was used for the same reasons mentioned earlier regarding the subwatershed delineation.
- b. Natural Channel n-values.
 - Derek explained that initially Muller used typical channel n-values that would be used for hydraulic models and then increased them by 25% per UDFCD guidelines. However, it was found that the n-values computed in this way were typically lower than those in the 1993 OSP.
 - Therefore, Muller modified the n-values and used higher values that were closer to those in the 1993 OSP which were based on the Jarrett equation. Derek asked if the project sponsors had a preference on the approach for estimated n-values. Shea responded that she will look into the best approach for computing channel n-values for the SWMM model (see UDFCD Action Items).
- Rueter-Hess Reservoir. Derek described the approach that was used to route flows through Rueter-Hess (RH) Reservoir.
 - Storage/discharge data for the reservoir was based on tables shown on construction drawings provided by Parker Water and Sanitation District (PWSD).
 - The reservoir was assumed to be full at its normal pool elevation of 6215.1 at the start of the storm event.
 - Flows were routed through the service spillway which consists of a rectangular opening in the outlet works tower.
 - Subwatersheds adjacent and upstream of the reservoir were not routed but instead directly added to the reservoir inflow hydrograph.
 - Several options for routing through the reservoir were modeled.
 - 1. Historic conditions prior to the reservoir being built (entire watershed including reservoir at 2% imperviousness).
 - 2. With the RH reservoir storage in-place and flow routed through the service spillway.
 - 3. Without the RH reservoir storage attenuation benefits (but reservoir footprint at 100% imperviousness).
- d. Regional Detention Ponds. Derek stated that Muller was not aware of any eligible publically maintained detention ponds in the watershed.

Newlin Gulch MDP – Progress Meeting #2– Meeting Minutes March 18, 2013

- Tom and Bill mentioned that there is a regional pond on the Jordan Road Tributary upstream of Mainstreet. Jacob will send Muller information on this pond (see Parker Action Items).
- Brad said that there may be a regional pond on the Spring Tributary upstream of I-25 and will look into this further (see Douglas County Action Items).
- Tom mentioned that the Canyons development is proposing some regional detention ponds. However, since these are future ponds, they cannot be considered in the Baseline hydrology but would be applicable for the Master Plan conditions hydrology.
- e. <u>Draft Hydrology Results.</u> Muller prepared a table that summarizes the draft peak discharges for the 100-year event and compares them to discharges reported in the 1977 FHAD and the 1993 OSP studies. The draft results indicate the following.
 - 1. The 100-year peak discharges for the "Historic Conditions" model are very similar to the discharges reported in the 1993 OSP for existing conditions. Shea said that since these values are within 10-percent of each other, no further calibration adjustments are necessary.
 - 2. The option of accounting for RH reservoir storage and routing through the service spillway results in peak discharges that are lower than both the 1977 FHAD and 1993 OSP discharges.
 - 3. The option of modeling without RH reservoir storage attenuation (but reservoir footprint at 100% imperviousness) results in peak discharges that are substantially larger (more than double) the 1977 FHAD and 1993 OSP discharges.
 - 4. The reservoir surcharge (rise in water level) is approximately 0.8-feet in the 100-year event when routed through the service spillway.
 - 5. The 100-year storm event never spills over the reservoir's auxiliary spillway (emergency overflow spillway) because the auxiliary crest is 1.6-feet higher than the service spillway.
- f. If the storage attenuation benefits of Rueter-Hess Reservoir are ignored, the peak 100-discharges are much higher than the 1977 FHAD discharges and would result in floodplain impacts to properties downstream of reservoir. Derek presented a floodplain exhibit of Newlin Gulch that was prepared for a separate project located downstream of the reservoir. The exhibit included the delineation of the 500-year event (based on the FHAD discharge of approximately 8000 cfs) and showed that the resulting 500-year floodplain encroaches on several properties. Since the current study 100-year flows without RH reservoir are even higher than 8000 cfs, it was concluded that there would be floodplain impacts to properties downstream if the RH storage benefits were ignored.

6. NEXT STEPS FOR BASELINE HYDROLOGY EVALUATION

- a. The group discussed Rueter-Hess Reservoir routing options. To account for RH reservoir storage attenuation benefits, an "adequate assurances" agreement with the reservoir owner, PWSD, would be needed.
 - Derek suggested that perhaps routing through the auxiliary spillway should be considered to allow more flexibility in possible future changes to the reservoir. The auxiliary spillway would be more difficult to change and any changes would likely have minimal impacts to the attenuation benefits. The group agreed with evaluating this option.
 - Bill also requested that Muller look at the option of taking out RH reservoir completely and modeling the reservoir subwatershed based on historic conditions and 2% imperviousness.
 - There was some discussion regarding the reservoir's emergency release rate of 590 cfs. This is the maximum discharge rate that the reservoir can release through the outlet works if there is a need to lower the water level for dam safety issues.

Newlin Gulch MDP – Progress Meeting #2– Meeting Minutes March 18, 2013

- b. Muller will model the two additional routing options for the reservoir discussed above. Once this is complete, Tom and Brad will setup a meeting with PWSD to discuss the draft hydrology results and the associated impacts of Rueter-Hess Reservoir.
- c. Shea said that regarding rainfall duration, only the 2-hr storm needs to be evaluated for the watershed given UDFCD's new guidelines. The previous UDFCD guidelines require that the 3-hour storm be used for areas greater than 10 sq. miles. However, the new guidelines that are coming out soon recommend that the 2-hour storm be used for watershed areas up to 15 square miles and that the 3-hour storm be used for areas greater than 15 square miles.

7. PROJECT WEBSITE

Derek mentioned that the project website is complete and was sent to UDFCD. However, it appears that it has not been linked up to the "Master Plan" portion of the website. Shea will look into this (see UDFCD action items).

8. PROJECT SCHEDULE

Derek will review and update the project schedule.

9. OTHER ITEMS

- a. The project sponsors were interested in the flow rates for the Sandpit Tributary and requested that Muller email these results to the group (see Muller Action Items).
- b. Tom mentioned that a low water trail crossing of Newlin Gulch is being considered near the Parker Homestead development. Tom requested that Muller send draft peak flows at this locations for the smaller storm events such as the 2-yr, 5-yr, and 10-yr (see Muller Action Items).
- c. Shea and Brad said that they would like Muller to complete the dam breach and hazard evaluation for the Baldwin Gulch dam. Shea will send Muller a scope for this work.

END OF MINUTES

MEETING MEMORANDUM

MULLER ENGINEERING COMPANY, INC.

CONSULTING ENGINEERS 777 SOUTH WADSWORTH BLVD., SUITE 4-100 LAKEWOOD, COLORADO 80226 (303) 988-4939

Project

Newlin Gulch MDP

Sponsors

UDFCD / Douglas County / Town of Parker

Meeting Location

UDFCD

Attendees

Shea Thomas, UDFCD
Bill DeGroot, UDFCD
Fred Koch, Douglas County
Brad Robenstein, Douglas County
Tom Williams, Town of Parker
Jacob James, Town of Parker
Derek Johns, Muller Engineering Company
Jim Wulliman, Muller Engineering Company

Meeting Date

May 15, 2013

Issue Date

June 21, 2013

MEC Project No. 12-050.01

Minutes Prepared By

Derek Johns

Routing

ASP / DDJ / JTW

Purpose

Newlin Gulch MDP – Progress Meeting #3

Muller Action Items:

- Muller will prepare a memorandum that summarizes the hydrologic evaluation of Rueter-Hess Reservoir and the flood control benefits associated with reservoir.
- 2. Muller will start preparing portions of the Draft Hydrology Report but will hold-off on finishing/publishing the report until PWSD Board approves the concept of officially recognizing the flood control benefits of Rueter-Hess Reservoir.
- 3. Muller will prepare a fee for a new FHAD study on Newlin Gulch.

UDFCD Action Items:

1. Shea will send an example "adequate assurances" agreement to Douglas County and Parker.

Douglas County and Town of Parker Action Items:

- Douglas County and Parker will take the lead on coordinating with PWSD and working out the details for an adequate assurances agreement to officially recognize the flood control benefits of Rueter-Hess Reservoir.
- **2.** Douglas County and Parker will pull out information from the Rueter-Hess memorandum and provide this to PWSD staff for their presentation to their Board.

Newlin Gulch MDP – Progress Meeting #3– Meeting Minutes May 15, 2013

Discussion

THE FOLLOWING IS OUR UNDERSTANDING OF THE SUBJECT MATTER COVERED IN THIS CONFERENCE. IF THIS DIFFERS WITH YOUR UNDERSTANDING, PLEASE NOTIFY US IMMEDIATELY.

1. MEETING WITH PWSD

Tom (Parker) and Fred (Douglas County) summarized the outcome of the meeting that the Town of Parker and Douglas County had with Parker Water and Sanitation District (PWSD). They met with Ron Redd/PWSD and it went well. PWSD is open to considering an agreement that would allow the flood control benefits of Rueter-Hess Reservoir to be officially recognized. PWSD sees this as an opportunity to show some of the other benefits of the reservoir. Specifics of the routing assumptions were not discussed, but Tom said that we should proceed with the option of routing through the auxiliary spillway. Tom said that in past conversations, Jim Nichol/PWSD has mentioned that PWSD would like to have the flexibility to possibly store more water in the future within the 1.6-foot zone between the service spillway and the auxiliary spillway.

2. RUETER-HESS RESERVOIR INFORMATION

Derek said that the hydrologic modeling of Rueter-Hess Reservoir was based on storage and discharge rating curves provided on as-built drawing. Muller does not have as-built drawings of the spillway dimensions. The group decided that the as-built drawing of the rating curves is sufficient documentation. Fred said that this as-built drawing should be included as part of the "adequate assurances" agreement with PWSD (the document that would be used to officially recognize the flood control benefits of Rueter-Hess Reservoir).

3. ADEQUATE ASSURANCES AGREEMENT

Bill and Shea said that UDFCD has an example "adequate assurances" agreement to start from and will send it to Fred. The agreement with PWSD will include Parker, Douglas County, and UDFCD. Parker and Douglas County will take the lead on this effort.

4. INFORMATION FOR PWSD BOARD MEETING

Tom said that the PWSD Board meets every two weeks. The group asked Muller to prepare a technical memorandum that summarizes the hydrologic evaluation and explains the flood control benefits of Rueter-Hess Reservoir. Parker and Douglas County will pull information from the memorandum and provide this to PWSD staff for their presentation to the Board. Fred said that Wendy Holmes (Douglas County) can help write/format this information which PWSD staff can use for their presentation to the Board and also as a press release.

Newlin Gulch MDP – Progress Meeting #3– Meeting Minutes May 15, 2013

The technical memorandum should include a summary of the hydrologic evaluation of Rueter-Hess Reservoir and document the flood control benefits. Specific items that were suggested to include in the memo are as follows:

- a. Tom and Jacob suggested to state that storm flows would have increased with new development and list the percent increases.
- b. Derek suggested showing an exhibit of the current floodplain in Stonegate Village and how it is currently close to residential properties. This exhibit would help to show that any significant increases in storm flows could result in properties being in the floodplain.
- c. Tom said to mention flooding issues at Recreation Drive and how being able to recognize flood control benefits of Rueter-Hess Reservoir will allow improvements at this location to be accomplished more cost effectively.
- d. Tom said to mention that the lower flows will also allow new bridges (i.e., Jordan Road) to be constructed more cost effectively.

The group requested that the memorandum be prepared as soon as possible (next week). Shea said that UDFCD will cover the cost for preparing the memo and Fred said that Douglas County could pay for any "extra" figures and graphics needed for marketing and/or press releases.

5. FHAD

Tom said that Parker would like to pursue doing a new Flood Hazard Area Delineation (FHAD) study that recognizes the lower peak flows from Rueter-Hess Reservoir. Tom thought that a new FHAD would be beneficial for the following reasons.

- a. <u>Recreation Drive flooding issue.</u> A new bridge or culvert crossing is needed at this location that could at least convey small storms (i.e., 5-year event). A few years ago, Parker looked at putting in a new bridge at this location but there were floodplain issues along the adjacent commercial property. Recognizing lower flows from Rueter-Hess would allow for a more cost effective solution at this location.
- b. <u>Jordan Road Bridge.</u> Tom said that Parker has a project underway to widen Jordan Road and add a turn lane where it crosses Newlin Gulch. To do this, the existing bridge will need to be widened but the hydraulic evaluations are indicating that there would be a rise in the floodplain which would cause problems at this location. To resolve the floodplain issue, they would have to tear out the existing bridges and build a new bridge with a longer span. Tom said that if flows are truly lower as a result of Rueter-Hess Reservoir, then it makes sense to officially recognize this. The lower flows would allow for a more cost effective solution at this location.
- c. Tom added that any other new bridges or channel structures will be more cost effective by recognizing the lower flows in a new FHAD.
- d. Fred mentioned some concern with developing a new FHAD using the lower flows because he does not want to constrict the existing floodplain. Tom does want to constrict the floodplain either. Tom said that the entire Newlin Gulch floodplain corridor downstream of Rueter-Hess has been dedicated as open space to Stonegate Village and the Town of Parker, so no new development can occur that would constrict the floodplain.
- e. As an idea to provide more floodplain buffer, Jim mentioned the idea of adding the 590 cfs emergency flow release from Rueter-Hess Reservoir to peak storm flows. Tom thought this would be a little too conservative and not necessary.

Newlin Gulch MDP – Progress Meeting #3– Meeting Minutes May 15, 2013

f. The group decided to proceed with a new FHAD study. Bill and Shea did not originally plan on a new FHAD but said that they can find the funding for this. Shea asked Muller to provide a fee for a new FHAD.

6. DRAFT HYDROLOGY REPORT

Tom felt that we should hold-off on publishing the Draft Hydrology Report until the PWSD Board approves the concept of officially recognizing the flood control benefits of Rueter-Hess Reservoir. Shea said that Muller could start working on portions of the report but agreed with Tom that we should hold-off on finishing it until we get PWSD's response. Shea said to not include all the sections in the draft report that are specified in the checklist. Some sections are not necessary at this phase of the project. Shea said to refer to the Coal Creek/Rock Creek draft hydrology report as a good example of sections that should be included.

END OF MINUTES

MEETING MEMORANDUM

MULLER ENGINEERING COMPANY, INC.

CONSULTING ENGINEERS 777 SOUTH WADSWORTH BLVD., SUITE 4-100 LAKEWOOD, COLORADO 80226 (303) 988-4939

Project

Newlin Gulch MDP

Sponsors

UDFCD / Douglas County / Town of Parker

Meeting Location

UDFCD

Attendees

Shea Thomas, UDFCD
Brad Robenstein, Douglas County
Jacob James, Town of Parker
Derek Johns, Muller Engineering Company
Andy Pultorak, Muller Engineering Company

Meeting Date

December 17, 2014

Issue Date January 5, 2015

12-050.01

MEC Project No.

Minutes Prepared By Andy Pultorak

Routing ASP / DDJ

Purpose

Newlin Gulch MDP – Progress Meeting #4

Muller Action Items:

- 1. Muller will run subwatershed hydrology using the latest version of CUHP (v. 1.4.4) to determine if peak flowrates or volumes are impacted.
- 2. Muller will finish the draft baseline hydrology and submit to UDFCD for review.
- 3. Muller will update the project website with the revised schedule.
- 4. Muller will email the project stakeholders (Stonegate Village, Cherry Creek Water Quality Basin Authority) regarding the FHAD study.

UDFCD Action Items:

1. Shea will send the executed adequate assurances agreement to Muller for inclusion in the appendices of the baseline hydrology report.

DISCUSSION:

THE FOLLOWING IS OUR UNDERSTANDING OF THE SUBJECT MATTER COVERED IN THIS MEETING. IF THIS DIFFERS WITH YOUR UNDERSTANDING, PLEASE NOTIFY US IMMEDIATELY.

1. INTRODUCTION

Derek (Muller) summarized the status of the project. The project was on-hold for approximately 1 ½ years waiting for the adequate assurances agreement between Parker Water and Sanitation District (PWSD) and the project Stakeholders to be finalized. Prior to stopping work, Muller had prepared hydrologic models and a memorandum summarizing the flood control benefits of Rueter-Hess Reservoir. The project Sponsors used this information over a year-long process to prepare the adequate assurances agreement with PWDS. The

Newlin Gulch MDP – Progress Meeting #4– Meeting Minutes December 17, 2014

agreement was signed in October, 2014. This was a major milestone, clearing the way for the masterplan to account for the flood control benefits of the reservoir.

2. DRAFT HYDROLOGY REPORT

Prior to stopping work, Muller had written much of the draft baseline hydrology report. The report and appendices need to be finalized and assembled before they can be submitted for review by the project team. The project team discussed several elements of the report as follows:

- a. <u>Adequate Assurances Agreement:</u> The adequate assurances agreement formalizes the flood control benefits of Reuter-Hess Reservoir and the reduced peak flowrates downstream. The agreement is based on flowrates provided by Muller using the hydrologic models prepared for the eventual baseline hydrology submittal. Shea would like to include a copy of the adequate assurances agreement as an appendix in the report (see Action Items). The technical memorandum, prepared by Muller and used in the development of the agreement, should also be included as an appendix in the report. The team requested that none of the hydrologic model results which ignore the flood control benefits of Reuter-Hess be included in the text of the main report (to avoid confusion).
- Land Use: Derek noted that the hydrologic models were prepared using the best available land use information during the development of the models. This included some conceptual and preliminary drainage reports for future developments, including the Canyons development in Castle Pines. Derek noted that these development plans may or may not have changed since the hydrologic models were prepared. This could potentially impact the imperviousness and infiltration assumptions used in the hydrologic models. Brad Robenstein (Douglas County) said that he was unaware of any major changes with the Canyons development. Shea agreed that the preliminary information used during the initial model development was adequate and did not need to be revisited. Jacob James (Town of Parker) noted that there were no changes to future land use assumptions within the Town boundaries.
- c. <u>Interactive PDF</u>: Andy Pultorak (Muller) asked Shea if including static PDFs for land-use, routing, and subwatershed figures in the draft submittal was acceptable to UDFCD, since this would eliminate some repeated work if the figures changed between draft and final submittals. Shea agreed that static PDFs were acceptable for the draft submittal, as long as the interactive PDF was included in the final.

3. FLOOD HAZARD AREA DELINEATION

The scope of the masterplan work includes a Flood Hazard Area Delineation (FHAD) study of the portion of the Newlin Gulch mainstem downstream of the reservoir (upstream limits near Hess Road).

- a. Derek noted that the scope of work did not include a schedule for the FHAD study. He anticipated starting work on the FHAD study after submitting the baseline hydrology report. The preliminary FHAD submittal is anticipated 10 weeks after the submittal of the draft baseline hydrology report. Shea was OK with this timeframe. Shea noted that Muller should plan to meet with Terri Fead (UDFCD) before she reviews the first preliminary submittal.
- b. Derek mentioned that there are several challenges with the hydraulic modeling, particularly in the Stonegate reach, that might warrant a meeting earlier in the process. This includes channel work that post-dates the available LiDAR mapping. Shea agreed that this meeting could occur when Muller submits the draft cross-section locations map to UDFCD for review.
- Shea said that the floodplain group is typically notifying all impacted property owners that a FHAD is in progress. Terri and David Mallory (UDFCD) will handle this notification process.

Newlin Gulch MDP – Progress Meeting #4– Meeting Minutes December 17, 2014

d. A public meeting (included in the current scope) may not be warranted for this project. The project team may decide to distribute a flyer or have individual meetings with impacted property owners instead. Muller was asked not to include a public meeting in the schedule.

e. Derek said that Muller had recently completed several channel improvement projects in Stonegate Village for which LOMRs had not been issued. He noted that Barbara Chongtoua (UDFCD), wanted incorporate these map revisions as part of the PMR issued following the current FHAD study, rather than issue individual LOMRs for these projects. Shea generally agreed with this approach and thought that LOMRs would not be necessary, but wanted to discuss it further with Terri Fead and David Mallory.

4. ALTERNATIVES ANALYSIS

The project team discussed the following items in regards to the Alternatives Analysis:

- a. Jacob noted that Recreation Drive has been closed several times in the past two years due to flooding.
- b. Derek noted that Tom Williams (Town of Parker) had mentioned a possible flood capacity issue at the Jordan Road over Newlin Gulch bridge. This may be improved by the reduction in flowrates resulting from the Rueter-Hess flood attenuation. Brad and Jacob were unaware of any specific concern at Jordan Road.
- c. Jacob pointed out proposed trail crossing locations north and south of Chambers Road. The crossing south of Chambers (in Parker Homestead) was currently undergoing final design by Muller Engineering. The crossing north of Chambers (part of the Douglas County East-West Trail) was undergoing final design by Hartwig and Associates. Jacob noted that he would like to get a general sense for masterplanned drop structure locations in this area as soon as possible to help him locate the crossings and set inverts. Jacob would like to include the proposed crossings in the FHAD study.
- d. Jacob noted that the Town has recently seen increased aggradation upstream of Chambers Road. Downstream of Jordan, a 3-foot headcut has formed at an existing check structure. Derek said that one focus of the study will be to estimate how the addition of the reservoir will impact long term sediment transport within the watershed.
- e. Shea told Muller not to include a benefit cost analysis in the Alternatives Analysis report. She noted that a benefit cost analysis does not produce a reasonable result if there are no structures (or few structures) in the floodplain.

5. SCHEDULE

MULLER ENGINEERING COMPANY

Derek presented an updated schedule for review by the project team. Shea agreed with the milestones as shown. Muller will submit the draft baseline hydrology report and start work on the FHAD study. Muller will schedule the next progress meeting for early February. The meeting will include discussion of the draft baseline hydrology report, early results of the alternatives analysis, and early results from the FHAD study. Muller will invite Stakeholders, including Stonegate Village and Cherry Creek Basin Water Quality Authority (CCBWQA). Jacob will contact PWSD by email regarding any future water and sewer crossings of Newlin Gulch. Muller will update the major milestones dates on the project website.

END OF MINUTES

APPENDIX A PAGE A-10

UDFCD, TOWN OF PARKER, DOUGLAS COUNTY

DRAFT BASELINE HYDROLOGY COMMENTS

Draft baseline hydrology was submitted to the project sponsors on January 20, 2015 for review. Comments were received on February 9, 2015 in the form of an annotated PDF copy of the report. Select comments have been reproduced below; responses are italicized. Minor comments/corrections were addressed in the revision but are not listed here.

UDFCD COMMENTS:

Figure B-1 [Several inconsistencies were noted between future impervious values shown on the subwatershed map and values listed in Table B-2, CUHP Input]

All inconsistencies have been corrected; this may have resulted in minor changes to future composite impervious values for some subwatersheds.

TOWN OF PARKER COMMENTS

Figure B-1 [Re: Future Land Use, Newlin Crossing development area north of Mainstreet, shown as mixture of 10%, 45%, 70% impervious]

- Change everything east of Newlin Gulch to 45%
- Change everything west of Newlin Gulch to Chambers to 70%

[Re: Future Land Use, parcel at SW corner of Mainstreet and Jordan, shown as 10% impervious]

• This is slated for commercial development, use 70%

[Re: Future Land Use, area of Parker at southeast edge of Rueter-Hess, at upstream end of Benchmark Tributary, shown as 2% impervious]

• This will likely be 40% impervious

Impervious values have been updated as requested based on recent development plans. Future development CUHP/SWMM models have been re-run; peak flows and all associated tables and figures updated.

[Re: Future Land Use, Meridian development west of Chambers Rd, north and south of Mainstreet]

• Confirm with Brad that land use is slated to be this high 75% See Douglas County comments below.

DOUGLAS COUNTY COMMENTS

Figure B-1 [Re: Future Land Use, Meridian development west of Chambers Rd, north and south of Mainstreet]

This area does seem too high. I looked at the PDs for Meridian International Business Center and Sierra Ridge. The area currently shown as 75% is more likely to be around 60%. Future impervious for Meridian has been updated to 60% as requested. The small corner of the watershed that lies within the City of Lone Tree was changed to 70% to match future land use values used for the adjacent areas in the 2012 Happy Canyon Creek MDP.

HYDROLOGIC ANALYSIS

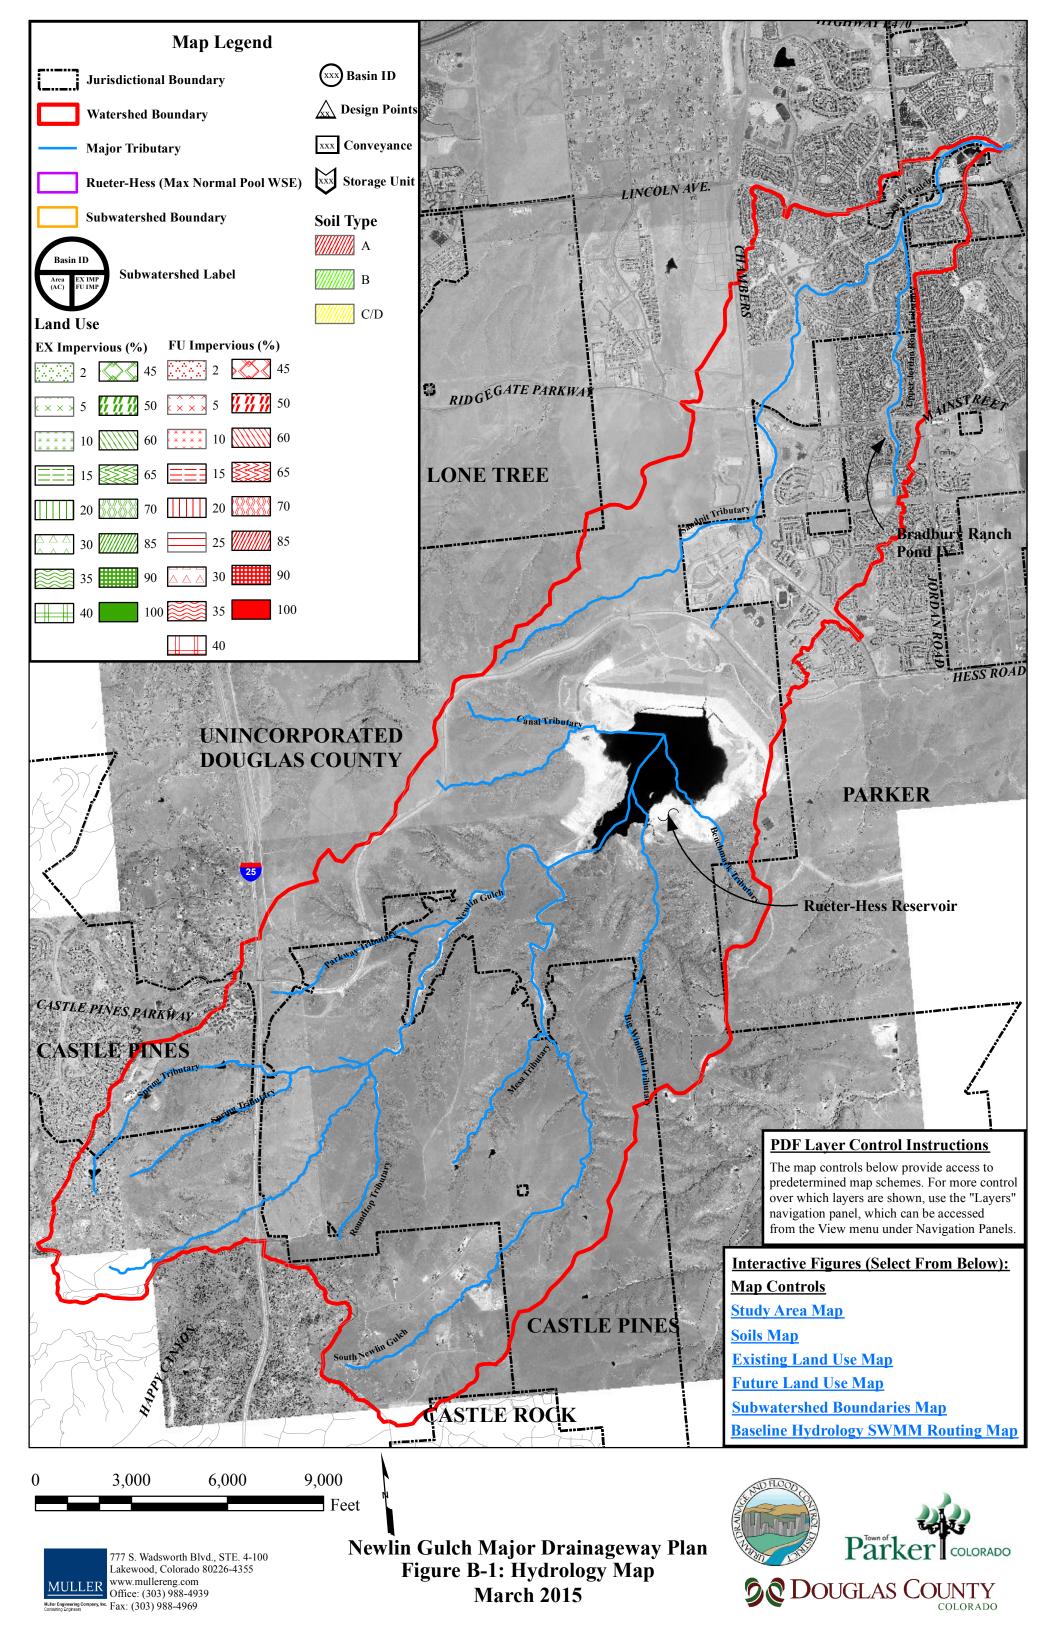


Table B-1 Rainfall Distributions

				2-Hour Desig	n Storm Rainf	all Depth (in)				
	2-у	ear	5-у	ear	10-	year	25-year	50-year	100-year	
	no area	3 mi ² area	no area	3 mi ² area	no area	3 mi ² area	no area	no area	no area	
Time	adjustment	adjustment	adjustment	adjustment	adjustment	adjustment	adjustment	adjustment	adjustment	
0:05	0.019	0.019	0.028	0.028	0.033	0.033	0.026	0.030	0.026	
0:10	0.038	0.038	0.052	0.052	0.061	0.061	0.069	0.080	0.077	
0:15	0.073	0.079	0.112	0.121	0.124	0.135	0.099	0.114	0.118	
0:20	0.103	0.145	0.147	0.206	0.169	0.237	0.158	0.182	0.206	
0:25	0.162	0.226	0.240	0.336	0.282	0.396	0.296	0.342	0.360	
0:30	0.090	0.127	0.125	0.175	0.135	0.190	0.493	0.570	0.643	
0:35	0.054	0.059	0.074	0.081	0.085	0.092	0.236	0.274	0.360	
0:40	0.043	0.047	0.056	0.061	0.065	0.071	0.158	0.182	0.206	
0:45	0.029	0.028	0.052	0.051	0.064	0.063	0.099	0.114	0.159	
0:50	0.029	0.028	0.052	0.051	0.054	0.053	0.099	0.114	0.129	
0:55	0.029	0.028	0.043	0.042	0.054	0.053	0.063	0.073	0.103	
1:00	0.029	0.028	0.043	0.042	0.054	0.053	0.063	0.073	0.103	
1:05	0.029	0.028	0.043	0.042	0.054	0.053	0.063	0.073	0.103	
1:10	0.019	0.019	0.043	0.042	0.054	0.053	0.047	0.055	0.051	
1:15	0.019	0.019	0.036	0.035	0.054	0.053	0.047	0.055	0.051	
1:20	0.019	0.019	0.032	0.031	0.042	0.041	0.035	0.041	0.031	
1:25	0.019	0.019	0.032	0.031	0.032	0.032	0.035	0.041	0.031	
1:30	0.019	0.019	0.032	0.031	0.032	0.032	0.028	0.032	0.031	
1:35	0.019	0.019	0.032	0.031	0.032	0.032	0.028	0.032	0.031	
1:40	0.019	0.019	0.022	0.021	0.032	0.032	0.028	0.032	0.031	
1:45	0.019	0.019	0.022	0.021	0.032	0.032	0.028	0.032	0.031	
1:50	0.019	0.019	0.022	0.021	0.032	0.032	0.028	0.032	0.031	
1:55	0.010	0.009	0.022	0.021	0.029	0.028	0.028	0.032	0.031	
2:00	0.010	0.009	0.019	0.018	0.022	0.022	0.028	0.032	0.031	

Table B-2 CUHP Input

								Weighted %	6 Impervious	Depressio	Depression Storage Infiltration					
							Length-Weighted		, , , , , , , , , , , , , , , , , , ,							
	Aı	rea	Dist to	Centroid	Ler	ngth	Slope	Existing	Future	Pervious	Impervious	Initial Rate	Final Rate	Decay Coeff.		
Subwatershed ID	acres	sq mi	ft	mi	ft	mi	ft/ft	%	%	watershed in	watershed in	in/hr	in/hr	1/second		
Newlin Gulch																
A100	79	0.12334	2568	0.486	4965	0.940	0.0127	46.18	46.40	0.5	0.1	4.36	0.63	0.0016		
A104	22	0.03412	1052	0.199	1595	0.302	0.0044	41.04	41.04	0.5	0.1	4.82	0.86	0.0011		
A108	76	0.11808	2154	0.408	3574	0.677	0.0099	40.62	41.00	0.5	0.1	4.04	0.61	0.0017		
A110	63	0.09787	556	0.105	2748	0.520	0.0109	52.16	52.35	0.5	0.1	4.64	0.71	0.0015		
A115	79	0.12317	1631	0.309	2961	0.561	0.0176	40.39	40.39	0.5	0.1	3.35	0.52	0.0018		
A120	133	0.20788	1735	0.329	4809	0.911	0.0098	37.06	37.15	0.5	0.1	4.43	0.66	0.0016		
A125	61	0.09537	1211	0.229	3559	0.674	0.0088	44.65	44.65	0.5	0.1	3.00	0.50	0.0018		
A130	73	0.11470	1082	0.205	3524	0.667	0.0216	37.76	37.76	0.5	0.1	3.90	0.67	0.0015		
A135	97	0.15218	1820	0.345	4634	0.878	0.0134	9.53	59.99	0.5	0.1	4.00	0.59	0.0017		
A140	77	0.11958	1485	0.281	3696	0.700	0.0177	7.98	37.05	0.5	0.1	4.62	0.71	0.0015		
A145	41	0.06477	1101	0.209	2513	0.476	0.0297	16.52	66.80	0.5	0.1	4.01	0.59	0.0017		
A150	132	0.20642	2025	0.384	4980	0.943	0.0165	20.92	29.24	0.5	0.1	3.72	0.62	0.0016		
A155	51	0.08018	1081	0.205	2357	0.446	0.0349	5.40	61.27	0.5	0.1	4.46	0.60	0.0018		
A160	36	0.05703	1056	0.200	2499	0.473	0.0161	10.16	11.95	0.5	0.1	4.20	0.72	0.0014		
A165	137	0.21432	2262	0.428	4332	0.821	0.0265	2.83	56.38	0.5	0.1	3.64	0.54	0.0018		
A170	91	0.14161	1918	0.363	4845	0.918	0.0285	34.06	40.99	0.5	0.1	3.21	0.53	0.0017		
A175	53	0.08328	1864	0.353	3506	0.664	0.0372	42.84	65.77	0.5	0.1	3.23	0.52	0.0018		
A180	107	0.16724	3092	0.586	4764	0.902	0.0262	42.28	50.98	0.5	0.1	3.38	0.54	0.0018		
A190	67	0.10513	2282	0.432	5385	1.020	0.0236	15.02	28.59	0.5	0.1	3.75	0.58	0.0017		
A200	122	0.19109	2356	0.446	4926	0.933	0.0347	18.12	24.09	0.5	0.1	3.32	0.52	0.0018		
A205	80	0.12535	2541	0.481	4255	0.806	0.0445	6.87	6.87	0.5	0.1	3.96	0.56	0.0018		
A210	177	0.27629	1904	0.361	4598	0.871	0.0326	5.06	5.06	0.5	0.1	3.56	0.54	0.0018		
A220	1150	1.79681	5078	0.962	14239	2.697	0.0010	100.00	100.00	0.0	0.0	0.00	0.00	0.0000		
A221	23	0.03657	307	0.058	456	0.086	0.0216	2.11	2.24	0.5	0.1	4.01	0.57	0.0018		
A222	112	0.17480	836	0.158	2008	0.380	0.0546	2.91	29.20	0.5	0.1	3.20	0.51	0.0018		
A223	48	0.07532	371	0.070	844	0.160	0.0567	2.00	2.00	0.5	0.1	3.28	0.52	0.0018		
A224	37	0.05826	560	0.106	1743	0.330	0.0566	2.00	2.00	0.5	0.1	3.01	0.50	0.0018		
A225	76	0.11903	905	0.171	2459	0.466	0.0474	2.00	2.00	0.5	0.1	3.12	0.51	0.0018		
A226	108	0.16815	1387	0.263	2916	0.552	0.0456	2.15	2.15	0.5	0.1	3.18	0.51	0.0018		
A227	97	0.15157	647	0.123	1571	0.298	0.0490	2.00	18.86	0.5	0.1	3.01	0.50	0.0018		
A228	35	0.05437	504	0.095	1070	0.203	0.0552	2.00	42.18	0.5	0.1	3.00	0.50	0.0018		
A230	116	0.18124	910	0.172	3193	0.605	0.0459	2.00	33.62	0.5	0.1	3.09	0.51	0.0018		
A240	127	0.19807	1373	0.260	3827	0.725	0.0377	2.00	42.72	0.5	0.1	3.07	0.50	0.0018		
A250	68	0.10593	1969	0.373	4102	0.777	0.0278	2.00	25.27	0.5	0.1	3.00	0.50	0.0018		
A260	99	0.15492	1730	0.328	3591	0.680	0.0316	2.00	13.14	0.5	0.1	3.00	0.50	0.0018		
A270	132	0.20610	904	0.171	2977	0.564	0.0439	8.43	9.14	0.5	0.1	3.02	0.50	0.0018		

Table B-2 CUHP Input

								Weighted %	Impervious	Depression	on Storage		Infiltration	
							Length-Weighted		-					
	Aı	rea	Dist to	Centroid	Ler	gth	Slope	Existing	Future	Pervious	Impervious	Initial Rate	Final Rate	Decay Coeff.
Subwatershed ID	acres	sq mi	ft	mi	ft	mi	ft/ft	%	%	watershed in	watershed in	in/hr	in/hr	1/second
Newlin Gulch														
A275	40	0.06230	922	0.175	2808	0.532	0.0370	6.61	61.80	0.5	0.1	3.00	0.50	0.0018
A280	100	0.15627	1232	0.233	3387	0.641	0.0420	7.18	66.26	0.5	0.1	3.00	0.50	0.0018
A290	111	0.17348	2138	0.405	4124	0.781	0.0452	9.88	28.85	0.5	0.1	3.00	0.50	0.0018
A300	123	0.19254	2369	0.449	4642	0.879	0.0406	2.59	3.41	0.5	0.1	3.00	0.50	0.0018
South Jordan Tribu	ıtary													
B100	84	0.13156	2228	0.422	4831	0.915	0.0178	43.67	43.84	0.5	0.1	3.74	0.56	0.0018
B110	115	0.17999	2293	0.434	5041	0.955	0.0147	32.69	44.22	0.5	0.1	3.11	0.51	0.0018
B120	91	0.14226	810	0.153	3186	0.603	0.0189	44.57	44.57	0.5	0.1	3.00	0.50	0.0018
B130	69	0.10807	1293	0.245	3339	0.632	0.0214	42.09	47.86	0.5	0.1	3.45	0.53	0.0018
B135	99	0.15400	1248	0.236	3395	0.643	0.0230	42.00	45.76	0.5	0.1	3.03	0.50	0.0018
B140	65	0.10231	848	0.161	3006	0.569	0.0376	34.72	38.23	0.5	0.1	3.07	0.50	0.0018
Sandpit Tributary														
C100	73	0.11409	1627	0.308	3571	0.676	0.0210	5.68	39.49	0.5	0.1	3.53	0.54	0.0018
C110	134	0.21009	1631	0.309	3241	0.614	0.0291	2.09	21.47	0.5	0.1	3.00	0.50	0.0018
C115	82	0.12791	942	0.178	1917	0.363	0.0541	2.00	16.52	0.5	0.1	3.29	0.52	0.0018
C120	147	0.23006	2253	0.427	6042	1.144	0.0366	12.37	12.40	0.5	0.1	3.00	0.50	0.0018
C125	76	0.11915	2169	0.411	4310	0.816	0.0405	5.35	5.35	0.5	0.1	3.64	0.54	0.0018
Canal Tributary														
D100	58	0.09018	485	0.092	1515	0.287	0.0315	2.00	2.00	0.5	0.1	3.00	0.50	0.0018
D105	23	0.03628	707	0.134	1316	0.249	0.0494	2.00	2.00	0.5	0.1	3.00	0.50	0.0018
D110	118	0.18431	1478	0.280	4687	0.888	0.0160	13.20	13.21	0.5	0.1	3.00	0.50	0.0018
D115	34	0.05294	489	0.093	1747	0.331	0.0545	2.00	2.00	0.5	0.1	3.00	0.50	0.0018
D120	88	0.13720	650	0.123	1747	0.331	0.0556	4.86	4.86	0.5	0.1	3.00	0.50	0.0018
D125	44	0.06920	509	0.096	759	0.144	0.0247	2.70	2.74	0.5	0.1	3.00	0.50	0.0018
Big Windmill Tribu	tary													
E100	86	0.13510	917	0.174	2973	0.563	0.0486	2.00	13.28	0.5	0.1	3.00	0.50	0.0018
E105	52	0.08142	275	0.052	1912	0.362	0.0433	2.00	2.00	0.5	0.1	3.00	0.50	0.0018
E110	26	0.04037	528	0.100	879	0.166	0.0628	4.38	4.63	0.5	0.1	3.00	0.50	0.0018
E115	47	0.07349	515	0.098	907	0.172	0.0602	5.02	5.03	0.5	0.1	3.00	0.50	0.0018
E120	122	0.18987	2043	0.387	3851	0.729	0.0411	2.16	22.64	0.5	0.1	3.00	0.50	0.0018
E124	82	0.12759	1970	0.373	3842	0.728	0.0383	4.57	4.57	0.5	0.1	3.00	0.50	0.0018
E128	133	0.20792	1700	0.322	4095	0.775	0.0401	4.90	6.13	0.5	0.1	3.00	0.50	0.0018

Table B-2 CUHP Input

								Weighted %	Impervious	Depressio	n Storage		Infiltration	
							Length-Weighted		•					
	A	rea	Dist to	Centroid	Ler	ngth	Slope	Existing	Future	Pervious	Impervious	Initial Rate	Final Rate	Decay Coeff.
Subwatershed ID	acres	sq mi	ft	mi	ft	mi	ft/ft	%	%	watershed in	watershed in	in/hr	in/hr	1/second
South Newlin Guld	:h													
F100	120	0.18764	3124	0.592	6498	1.231	0.0283	2.00	20.92	0.5	0.1	3.00	0.50	0.0018
F102	57	0.08830	627	0.119	1847	0.350	0.0496	2.00	7.02	0.5	0.1	3.01	0.50	0.0018
F104	105	0.16419	1101	0.209	3021	0.572	0.0490	2.00	37.92	0.5	0.1	3.00	0.50	0.0018
F106	97	0.15209	822	0.156	1734	0.328	0.0565	2.00	5.68	0.5	0.1	3.00	0.50	0.0018
F110	106	0.16600	1210	0.229	3346	0.634	0.0293	2.00	26.48	0.5	0.1	3.00	0.50	0.0018
F120	120	0.18673	1883	0.357	3939	0.746	0.0287	2.00	28.64	0.5	0.1	3.00	0.50	0.0018
F125	76	0.11910	1779	0.337	3518	0.666	0.0384	2.00	22.58	0.5	0.1	3.00	0.50	0.0018
F130	93	0.14500	1739	0.329	3729	0.706	0.0240	2.91	10.00	0.5	0.1	3.00	0.50	0.0018
F140	125	0.19559	2298	0.435	4151	0.786	0.0311	4.79	9.47	0.5	0.1	3.00	0.50	0.0018
F145	91	0.14255	1879	0.356	4122	0.781	0.0392	5.95	10.99	0.5	0.1	3.00	0.50	0.0018
F150	97	0.15083	1880	0.356	4552	0.862	0.0403	5.07	10.00	0.5	0.1	3.00	0.50	0.0018
F155	118	0.18503	1212	0.229	2798	0.530	0.0467	5.00	10.00	0.5	0.1	3.00	0.50	0.0018
Mesa Tributary														
G100	63	0.09892	1730	0.328	3584	0.679	0.0413	2.00	19.52	0.5	0.1	3.00	0.50	0.0018
G110	87	0.13587	1335	0.253	3530	0.668	0.0324	2.00	17.11	0.5	0.1	3.00	0.50	0.0018
G115	85	0.13319	2000	0.379	3834	0.726	0.0402	2.04	16.25	0.5	0.1	3.00	0.50	0.0018
G120	82	0.12759	1650	0.313	3485	0.660	0.0318	2.00	27.65	0.5	0.1	3.00	0.50	0.0018
G130	112	0.17453	1716	0.325	4081	0.773	0.0383	4.05	10.76	0.5	0.1	3.00	0.50	0.0018
Parkway Tributary														
H100	32	0.05073	479	0.091	1001	0.190	0.0541	2.00	19.02	0.5	0.1	3.00	0.50	0.0018
H110	90	0.14116	1729	0.327	3867	0.732	0.0364	9.43	52.24	0.5	0.1	3.01	0.50	0.0018
H115	108	0.16810	2025	0.384	3886	0.736	0.0417	8.13	9.28	0.5	0.1	3.00	0.50	0.0018
H120	103	0.16166	2052	0.389	4317	0.818	0.0377	32.08	71.30	0.5	0.1	3.02	0.50	0.0018
H125	109	0.17012	1720	0.326	3764	0.713	0.0412	18.42	26.98	0.5	0.1	3.00	0.50	0.0018
Roundtop Tributar	ſy													
1100	77	0.11958	1930	0.365	4134	0.783	0.0332	2.00	32.00	0.5	0.1	3.01	0.50	0.0018
l110	130	0.20300	1783	0.338	4637	0.878	0.0333	2.38	19.69	0.5	0.1	3.00	0.50	0.0018
l115	92	0.14452	1633	0.309	3760	0.712	0.0409	5.33	5.82	0.5	0.1	3.09	0.51	0.0018
l120	70	0.10934	2167	0.410	3979	0.754	0.0436	4.49	7.98	0.5	0.1	3.00	0.50	0.0018
Spring Tributary														
J100	98	0.15269	1484	0.281	3416	0.647	0.0327	2.00	41.01	0.5	0.1	3.56	0.54	0.0018
J110	88	0.13699	986	0.187	2878	0.545	0.0398	11.11	22.12	0.5	0.1	3.32	0.52	0.0018
J120	120	0.18808	1955	0.370	4659	0.882	0.0341	5.39	40.25	0.5	0.1	3.00	0.50	0.0018
J130	121	0.18902	1178	0.223	2519	0.477	0.0386	23.83	57.41	0.5	0.1	3.28	0.52	0.0018
J140	88	0.13737	998	0.189	2976	0.564	0.0357	8.50	31.76	0.5	0.1	3.00	0.50	0.0018
J150	90	0.14075	1606	0.304	3843	0.728	0.0370	14.65	32.56	0.5	0.1	3.00	0.50	0.0018
J155	61	0.09556	1141	0.216	2440	0.462	0.0490	5.82	33.06	0.5	0.1	3.00	0.50	0.0018
J160	91	0.14257	2047	0.388	4398	0.833	0.0403	25.01	25.01	0.5	0.1	3.00	0.50	0.0018

Table B-3 Detention Rating Curves

Rueter-Hess Reservoir (SWMM element NG220)

	Stora	ge Curve	Outle	et Curve
Elevation	Stage	Area	Stage	Discharge
(ft)	(ft)	(sq ft)	(ft)	(cfs)
6216.7	0	50,660,280	0	0
6217.1			0.4	359
6217.6			0.9	1,220
6218.1	1.4	50,965,200	1.4	2,381
6218.6			1.9	3,785
6219.1			2.4	5,403
6219.6			2.9	7,217
6220.1			3.4	9,213
6220.6			3.9	11,380
6221.1			4.4	13,712
6221.6			4.9	16,202
6222.1			5.4	18,846
6222.6			5.9	21,640
6223.1	6.4	53,622,360	6.4	24,579

Reuter-Hess Reservoir storage curve based on a starting WSEL at the Auxiliary Spillway crest (Elev. 6216.7). Outlet curve based on flow through the Auxiliary Spillway only based on the table "Service Spillway and Auxiliary Spillway Rating Curves" taken from record drawings from the Rueter-Hess Dam and Reservoir project (DWG. A-05), dated 10/12.


Bradbury Ranch Pond IV (SWMM element SJ130)

	Storag	e Curve	Outle	et Curve
Elevation	Stage	Area	Stage	Discharge
(ft)	(ft)	(sq ft)	(ft)	(cfs)
5918.7	0	0	0.0	0.00
5921.7			3.0	66.85
5922.2			3.5	94.54
5922.7			4.0	115.79
5923.2			4.5	133.70
5923.7			5.0	149.48
5924.2			5.5	163.75
5924.7			6.0	176.87
5925	6.3	82,308		
5925.2			6.5	189.08
5925.7			7.0	200.55
5926.2			7.5	211.40
5926.7			8.0	221.72
5927.2			8.5	231.58
5927.5	8.8	150,181		
5927.7			9.0	247.00
5928.2			9.5	290.23
5928.7			10.0	351.23
5929.2			10.5	426.96
5929.7			11.0	516.27
5930	11.3	218,054	11.3	576.13

Pond IV storage curve based on 5-ft Douglas County topography. Outlet curve was developed based on supplemental ground survey of outlet structure conducted in April 2013.

OUTLET WORKS RATING CURVE AND RESERVOIR STORAGE VOLUME & AREA VALUES

BAGE HEIGHT CIPT CIPT					
Religion Religion	GAGE	ELEVATION.	OUTLET WORKS	RESERVOIR	RESERVOIR
Check Color Colo					
6 6055 203.0 87 22 11 6060 225.1 232 36 16 6065 245.2 432 44 21 6070 263.8 686 57 26 6075 281.2 1,001 69 31 6080 297.6 1,395 89 36 6085 313.1 1,907 116 41 6090 327.8 2,569 149 46 6095 342.0 3,386 177 51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415	(FEET)	, ,	(CFS)	(ACRE-FEET)	(ACRES)
11 6060 225.1 232 36 16 6065 245.2 432 44 21 6070 263.8 686 57 26 6075 281.2 1,001 69 31 6080 297.6 1,395 89 36 6085 313.1 1,907 116 41 6090 327.8 2,569 149 46 6095 342.0 3,386 177 51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6135 439 16,391 449 91 6140 449.6 18,731 487 <					
16 6065 245.2 432 44 21 6070 263.8 686 57 26 6075 281.2 1,001 69 31 6080 297.6 1,395 89 36 6085 313.1 1,907 116 41 6090 327.8 2,569 149 46 6095 342.0 3,386 177 51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487					
21 6070 263.8 686 57 26 6075 281.2 1,001 69 31 6080 297.6 1,395 89 36 6085 313.1 1,907 116 41 6090 327.8 2,559 149 46 6095 342.0 3,386 177 51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 12,265 526 101 6150 470.2 23,995 566 </td <td>11</td> <td>6060</td> <td>225.1</td> <td>232</td> <td>36</td>	11	6060	225.1	232	36
26 6075 281.2 1,001 69 31 6080 297.6 1,395 89 36 6085 313.1 1,907 116 41 6090 327.8 2,569 149 46 6095 342.0 3,386 177 51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566			245.2		
31 6080 297.6 1,395 89 36 6085 313.1 1,907 116 41 6090 327.8 2,5699 149 46 6095 342.0 3,386 177 51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 615 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601	21	6070	263.8	686	57
36 6085 313.1 1,907 116 41 6090 327.8 2,569 149 46 6095 342.0 3,386 177 51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6135 439 16,391 449 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 <td></td> <td></td> <td></td> <td></td> <td></td>					
41 6090 327.8 2,569 149 46 6095 342.0 3,386 177 51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 121 6170 508.9 36,887 728	31	6080	297.6	1,395	89
46 6095 342.0 3.386 177 51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 121 6170 508.9 36,887 728 126 6175 518.1 40,631 7	36	6085	313.1		116
51 6100 355.6 4,411 233 56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 <td< td=""><td></td><td></td><td>327.8</td><td>2,569</td><td></td></td<>			327.8	2,569	
56 6105 368.6 5,683 276 61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 126 6175 518.1 40,631 770 131 6185 536.1 48,785 <	46	6095	342.0	3,386	177
61 6110 381.3 7,134 304 66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 111 6160 490.0 30,031 646 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 126 6175 518.1 40,631 770 126 6175 518.1 40,631	51	6100	355.6	4,411	233
66 6115 393.5 8,714 328 71 6120 405.3 10,413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 126 6175 518.1 40,631 770 131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199	56	6105	368.6	5,683	276
71 6120 405.3 10.413 352 76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 111 6160 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 126 6175 518.1 40,631 770 126 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857	61	6110	381.3	7,134	304
76 6125 416.9 12,242 380 81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773	66	6115	393.5	8,714	328
81 6130 428.1 14,229 415 86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 126 6175 518.1 40,631 770 131 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959	71	6120	405.3	10,413	352
86 6135 439 16,391 449 91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 126 6175 518.1 40,631 770 131 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 </td <td>76</td> <td>6125</td> <td>416.9</td> <td>12,242</td> <td>380</td>	76	6125	416.9	12,242	380
91 6140 449.6 18,731 487 96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 1116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6215 586.7 79	81	6130	428.1	14,229	415
96 6145 460.1 21,265 526 101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7	86	6135	439	16,391	449
101 6150 470.2 23,995 566 106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	91	6140	449.6	18,731	487
106 6155 480.2 26,912 601 111 6160 490.0 30,031 646 116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	96	6145	460.1	21,265	526
111 6160 490.0 30,031 646 116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	101	6150	470.2	23,995	566
116 6165 499.5 33,356 684 121 6170 508.9 36,887 728 126 6175 518.1 40,631 770 131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	106	6155	480.2	26,912	601
121 6170 508.9 36.887 728 126 6175 518.1 40.631 770 131 6180 527.2 44.597 816 136 6185 536.1 48.785 858 141 6190 544.9 53.199 907 146 6195 553.5 57.857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67.959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	111	6160	490.0	30,031	646
126 6175 518.1 40,631 770 131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	116	6165	499.5	33,356	684
131 6180 527.2 44,597 816 136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	121	6170	508.9	36,887	728
136 6185 536.1 48,785 858 141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	126	6175	518.1	40,631	770
141 6190 544.9 53,199 907 146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	131	6180	527.2	44,597	816
146 6195 553.5 57,857 956 151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	136	6185	536.1	48,785	858
151 6200 562.0 62,773 1,011 156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	141	6190	544.9	53,199	907
156 6205 570.3 67,959 1,064 161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	146	6195	553.5	57,857	956
161 6210 578.6 73,415 1,119 163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	151	6200	562.0	62,773	1,011
163 6212 581.8 75,689 1,155 166 6215 586.7 79,175 1,170	156	6205		67,959	1,064
166 6215 586.7 79,175 1,170	161	6210	578.6	73,415	1,119
166 6215 586.7 79,175 1,170	163	6212	581.8	75,689	1,155
171 6220 594.7 85,176 1,231	166	6215	586.7	79,175	
	171	6220	594.7	85,176	1,231

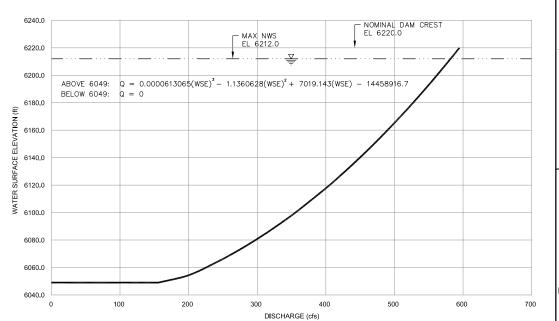

OUTLET WORKS RATING CURVE NOTE 1

 $Q = 378.70762(WSE)^2 - 4704790.695(WSE) + 14612230812.5$

10000

- NOMINAL DAM CREST EL 6220.0

RESERVOIR VOLUME CAPACITY (ACRE-FEET) **RESERVOIR ELEVATION-AREA-VOLUME CURVE**

40000

LOW-LEVEL INTAKE EL 6049.0

RESERVOIR SURFACE AREA (ACRES)

600

50000

750

450

60000

MAX NWS

VOLUME

20000

1050

900

1350

6220.0

6200.0

6180.0

6160.0

6120.0


6100.0

6080.0

6060.0

6040.0 6020.0 1200

10000

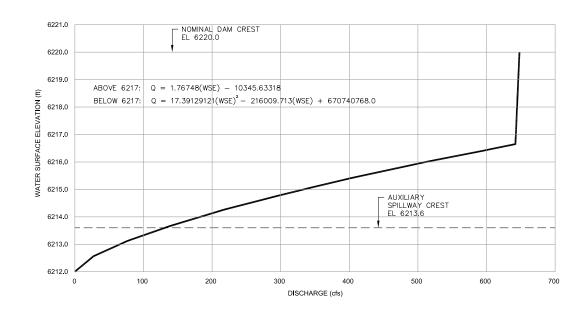

SERVICE SPILLWAY AND

GAGE HEIGHT (FEET)	ELEVATION (FEET)	SERVICE SPILLWAY (CFS)	AUXILIARY SPILLWAY (CFS)
163	6212.0	0.0	
163.5	6212.5	22.6	
164	6213.0	64.0	
164.6	6213.6	117.6	0
165	6214.0	181.0	359
165.5	6214.5	253.0	1,220
166	6215.0	332.6	2,381
166.5	6215.5	419.1	3,785
167	6216.0	512.0	5,403
167.5	6216.5	610.9	7,217
168	6217.0	642.8	9,213
168.5	6217.5	643.7	11,380
169	6218.0	644.6	13,712
169.5	6218.5	645.4	16,202
170	6219.0	646.3	18,846
170.5	6219.5	647.2	21,640
171	6220.0	648.0	24,579

AUXILIARY SPILLWAY RATING CURVES

LWAY (FS)	SPILLWAY (CFS)
0.0	
2.6	
4.0	
17.6	0
31.0	359
53.0	1,220
32.6	2,381
19.1	3,785
12.0	5,403
10.9	7,217
42.8	9,213
43.7	11,380
44.6	13,712
45.4	16,202
46.3	18,846
47.2	21,640
48.0	24,579

AUXILIARY SPILLWAY RATING CURVE

FLOW (cfs)

15000

SERVICE SPILLWAY RATING CURVE

- 1. OUTLET WORKS RATING CURVE ASSUMES THE FOLLOWING: FLOW IS THROUGH THE LOW-LEVEL INTAKE, CONVEYED THROUGH THE UPSTREAM CONDUIT AND LEFT PIPE OF THE DOWNSTREAM CONDUIT TO THE IMPACT BASIN; ALL GATES ALONG THIS REACH ARE FULLY OPEN; THE LOW-LEVEL INTAKE IS HYDRAULICALLY SUBMERGED; AND THE LOW-LEVEL INTAKE TRASHRACK IS FREE OF DEBRIS.
- 2. RATING CURVES BASED ON THEORETICAL VALUES AND ACTUAL FIELD PERFORMANCE COULD VARY.

THIS DOCUMENT, AND THE IDEAS AND DESIGNS INCORPORATED HEREIN, IS THE PROPERTY OF PARKER WATER AND SANITATION DISTRICT AND RJH CONSULTANTS, INC. AND IS NOT TO BE USED, IN WHOLE OR IN PART, FOR ANY OTHER PROJECT WITHOUT THE WRITTEN AUTHORIZATION OF PARKER WATER AND SANITATION DISTRICT AND RJH CONSULTANTS, INC. 10/12 RECORD DRAWINGS NO. DATE ISSUE/REVISION





6221

6220

6218

6215

6214

6213

RUETER-HESS DAM AND RESERVOIR RECORD DRAWINGS DOUGLAS COUNTY, COLORADO

5000

HYDRAULIC INFORMATION

DWG. NO. A-05

SHEET NO. 5 of 167

ZMR ERF RJH APP

DES DRN CHK

NOTES:

NOMINAL DAM

300

RESERVOIR

70000


CREST EL 6220.0

150

80000

90000

20000

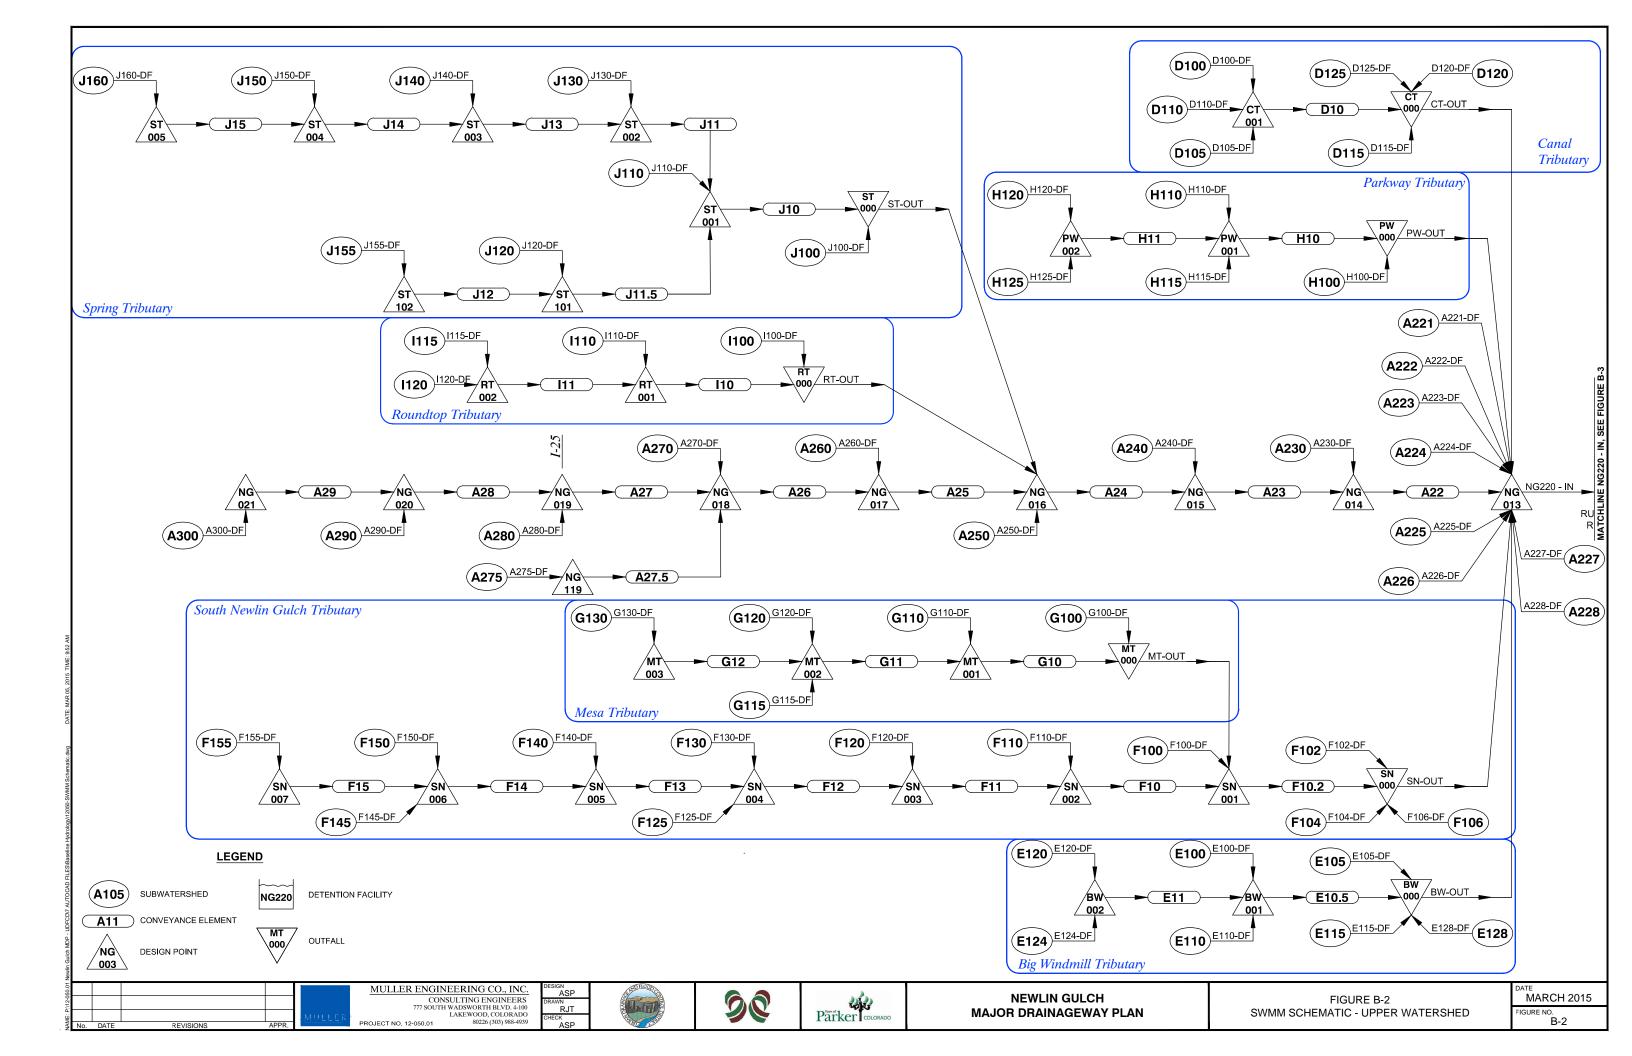

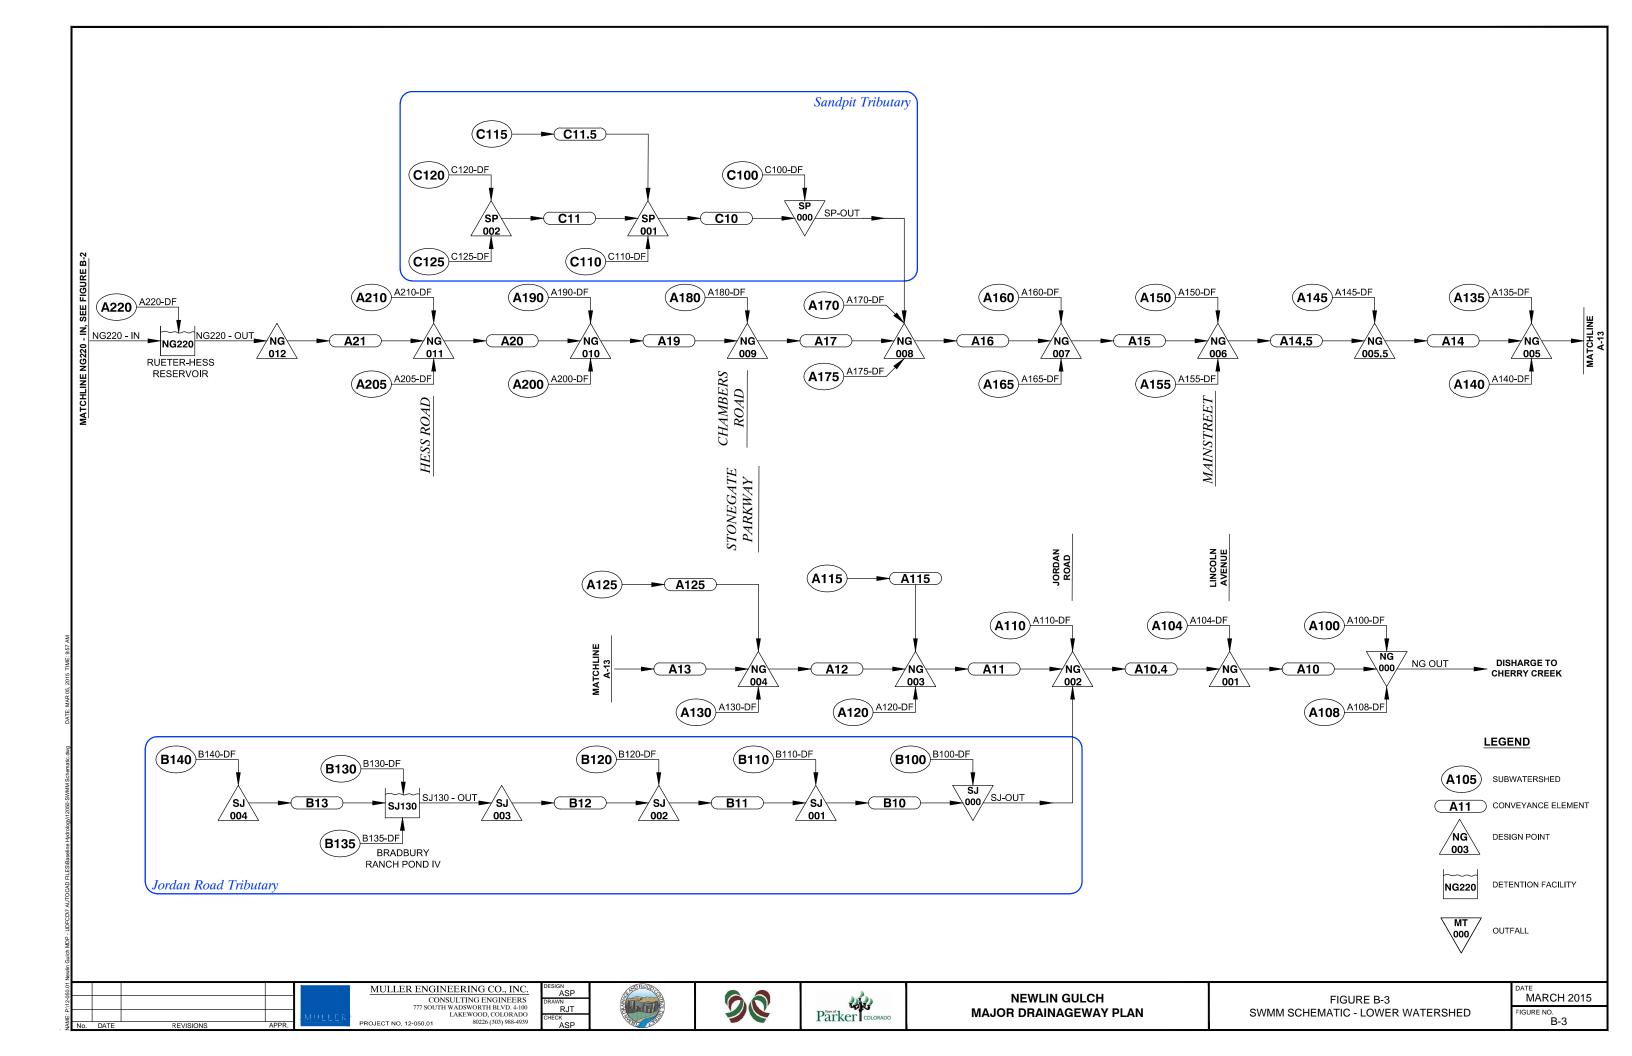
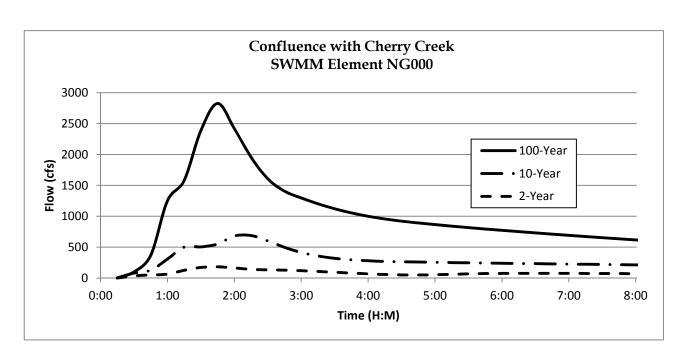
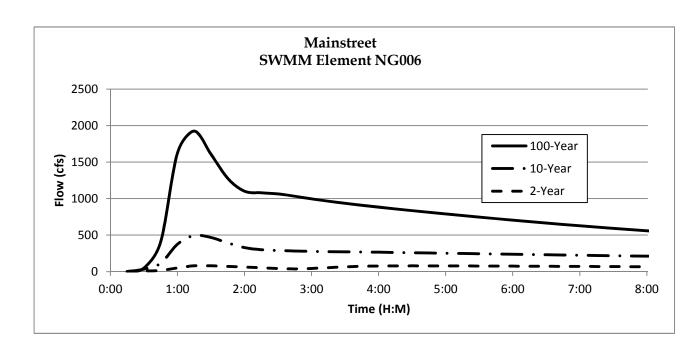
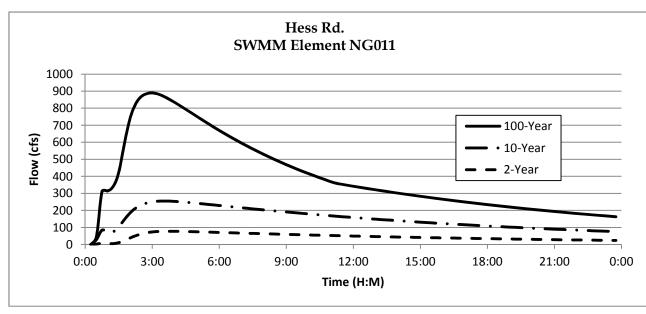


Figure B-4
Existing Development Hydrographs







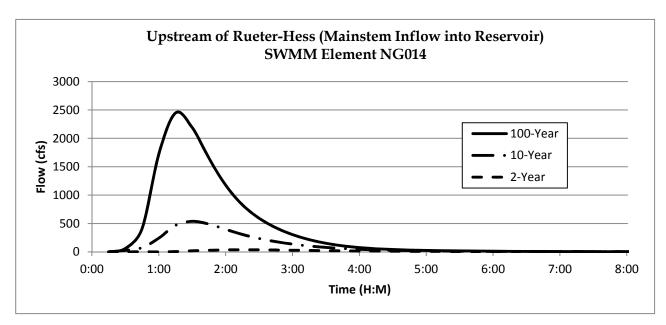
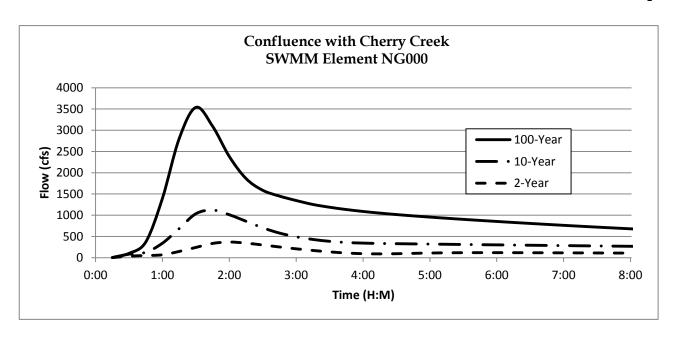
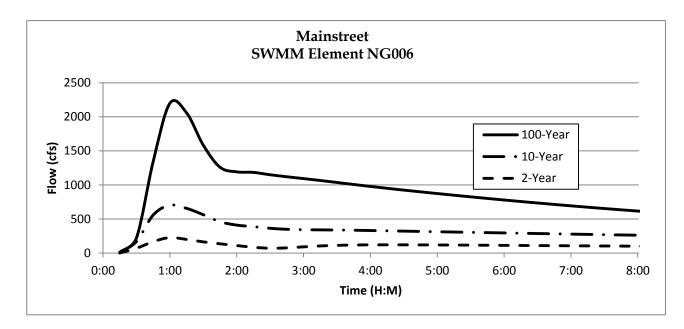
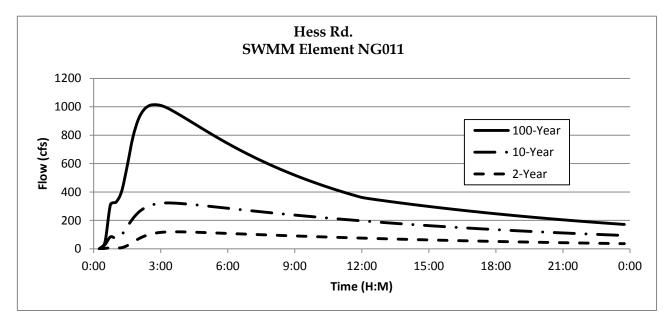
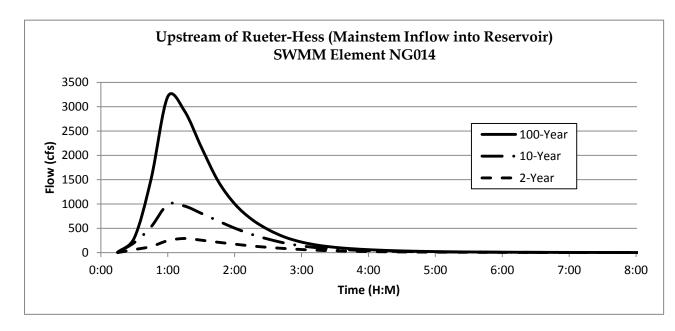



Figure B-5
Future Development Hydrographs









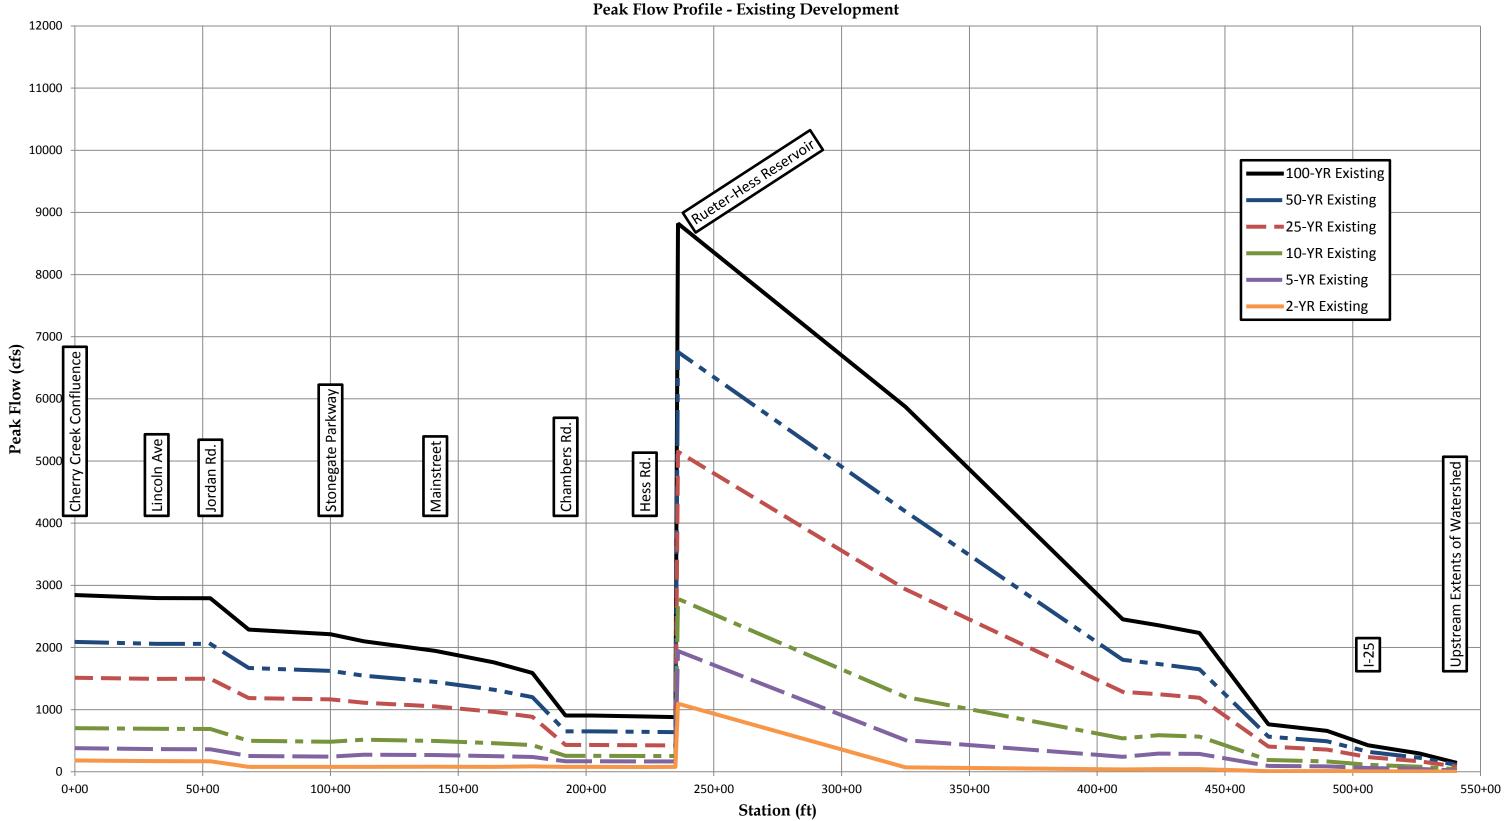

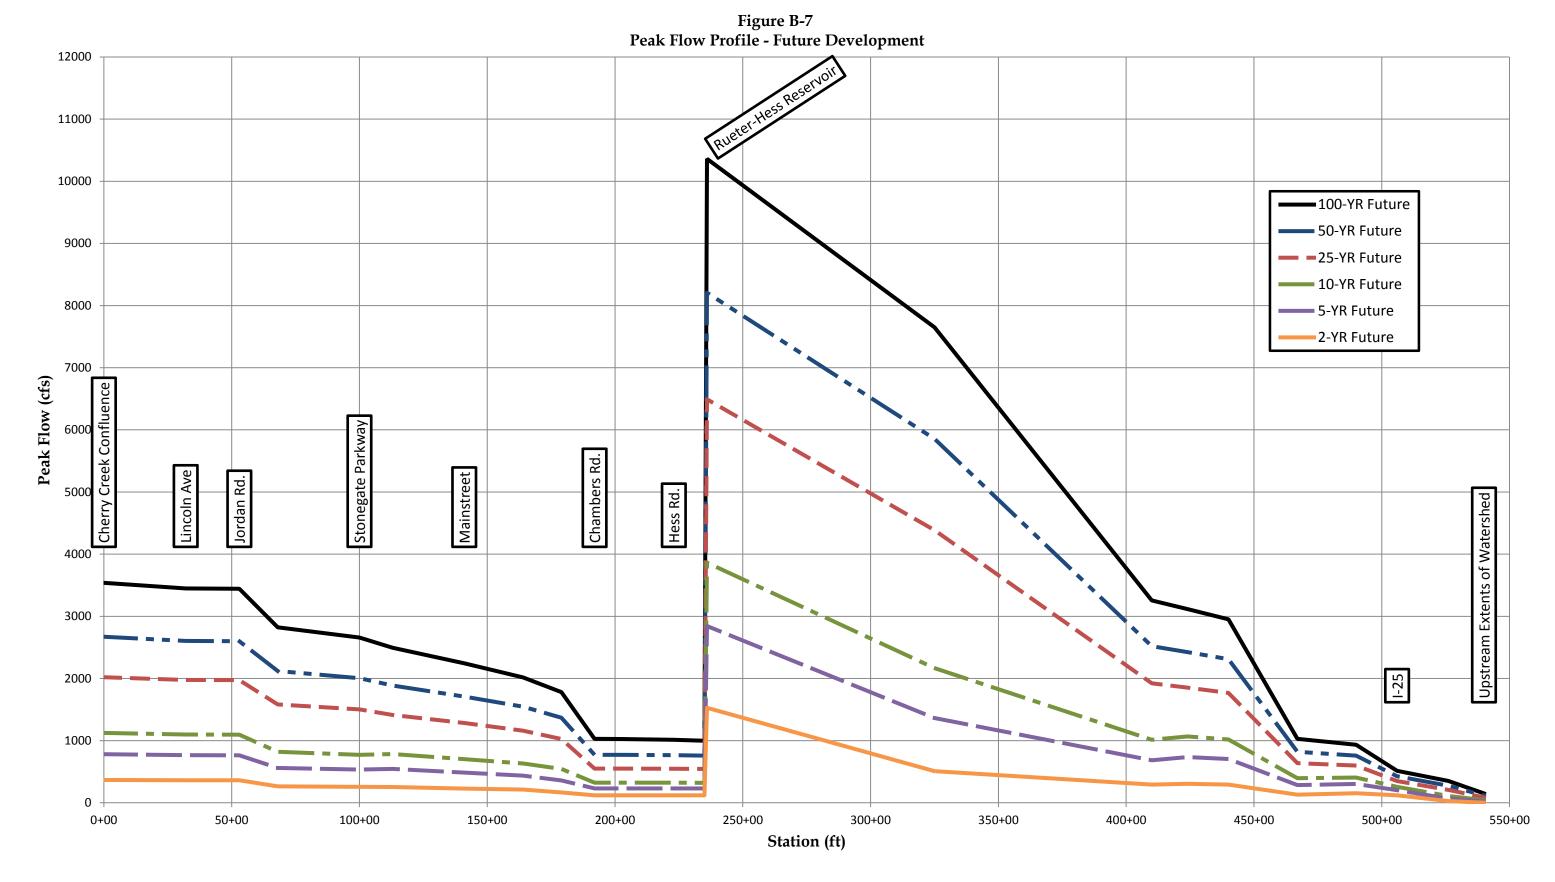


Table B-4 Peak Flow Rates

				3 Square Mile									FUTURE DEV	VELOPMENT		
	Station	Channel		Area Adjustment	100-YR	50-YR	25-YR	10-YR	5-YR	2-YR	100-YR	50-YR	25-YR	10-YR	5-YR	2-YR
SWMM Node	(ft)	Reach	Landmark	2-yr, 5-yr, 10-yr	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)
NEWLIN GULCH MA	AINSTEM															
NG000	0		Cherry Creek	yes	2843	2090	1514	703	380	183	3539	2670	2021	1125	783	368
NG001	3200		Lincoln Ave (U/S)	yes	2795	2059	1496	691	364	171	3450	2604	1976	1099	766	363
NG002	5300		Jordan Rd. (U/S)	yes	2793	2058	1497	690	363	169	3443	2598	1973	1097	765	362
NG003	6800			yes	2288	1670	1186	498	253	79	2825	2121	1583	820	561	264
NG004	10000		Stonegate Parkway (U/S)	yes	2212	1625	1165	483	245	80	2660	2006	1504	771	534	256
NG005	11300				2101	1546	1112	516	276	79	2493	1885	1414	785	544	255
NG006	14100		Mainstreet (U/S)		1945	1447	1051	496	270	82	2244	1710	1284	703	485	228
NG007	16400				1759	1320	965	459	251	80	2019	1547	1161	633	438	212
NG008	17900				1589	1202	884	429	240	86	1780	1369	1027	546	361	168
NG009	19200		Chambers Rd. (U/S)		905	651	432	257	169	78	1029	773	550	324	232	120
NG010	20200				905	651	432	257	169	78	1027	773	550	324	232	120
NG011	22300		Hess Rd. (U/S)		890	642	427	255	168	77	1015	768	548	323	232	120
NG012	23500		Rueter-Hess Reservoir Outflow		880	637	425	255	168	78	999	760	544	322	232	120
NG220	23600		Rueter-Hess Reservoir Total Inflow	yes	8822	6754	5150	2781	1942	1097	10362	8207	6492	3863	2845	1529
NG013	32500			yes	5871	4187	2935	1204	510	72	7649	5855	4387	2167	1364	508
NG014	41000		Rueter-Hess Reservoir Inflow from Mainstem	yes	2454	1801	1288	537	241	37	3256	2521	1922	1014	683	293
NG015	42400				2357	1735	1247	589	294	42	3116	2425	1852	1067	736	306
NG016	44000				2233	1649	1191	565	288	42	2953	2310	1767	1018	704	293
NG017	46700				763	565	407	190	95	11	1028	822	638	395	285	130
NG018	49000				659	492	356	168	86	12	933	758	600	406	304	154
NG019	50600		I-25 (U/S)		426	322	236	113	60	8	514	427	349	258	203	120
NG020	52600				296	227	168	82	45	6	352	274	207	110	69	27
NG021	54000		Upstream Extents of Watershed		151	116	86	42	22	2	152	117	87	42	23	2
JORDAN ROAD TRIE																
SJ000	60000		Confluence w/ Newlin Gulch		690	557	444	282	211	99	758	615	493	314	239	118
SJ001	63300		Stonegate Parkway (U/S)		568	465	377	246	187	89	637	524	420	273	213	106
SJ002	64500				368	312	262	186	146	71	383	324	275	199	159	82
SJ003	66400		Mainstreet		302	232	208	157	126	62	321	240	214	166	137	73
SJ004	69000				197	160	125	82	59	27	214	175	138	93	67	33
SANDPIT TRIBUTAR																
SP000	70000		Confluence w/ Newlin Gulch		654	494	360	165	83	10	763	588	441	230	142	44
SP001	72600				584	444	325	151	78	10	644	498	373	192	116	32
SP002	75700				276	214	161	82	48	11	276	214	161	82	48	12
CANAL TRIBUTARY			51 (0) 11 N 15		604	F27	400	207	110	4.5	604	507	400	207	440	4.0
CT000	80000		Edge of Reuter-Hess Normal Pool		684	537	400	207	118	16	684	537	400	207	118	16
CT001	86500				313	245	183	95	56	10	313	245	183	95	56	10
BIG WINDMILL TRIE			Educat Deuten III N. 10 1		057	650	400	227	126	44	05.0	740	F.C.4	207	470	20
BW000	90000		Edge of Reuter-Hess Normal Pool		857	658	486	237	126	11	956	748	561	297	179	39
BW001	96600				453	348	257	123	65	4	536	422	320	175	111	31
BW002	97400				265	204	151	74	40	3	323	255	194	110	71	23

Table B-4 Peak Flow Rates

				3 Square Mile	Tile EXISTING DEVELOPMENT								FUTURE DEV	/ELOPMENT		
	Station	Channel		Area Adjustment	100-YR	50-YR	25-YR	10-YR	5-YR	2-YR	100-YR	50-YR	25-YR	10-YR	5-YR	2-YR
SWMM Node	(ft)	Reach	Landmark	2-yr, 5-yr, 10-yr	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)	(cfs)
SOUTH NEWLIN GL	JLCH															
SN000	100000		Edge of Reuter-Hess Normal Pool		1522	1083	741	334	134	7	1707	1251	895	482	296	93
SN001	107100				1388	999	694	317	132	7	1564	1154	835	446	252	82
SN002	109800				891	648	456	210	93	6	964	717	519	273	149	43
SN003	111800				816	599	426	198	91	7	882	659	481	251	138	30
SN004	114600				725	538	387	182	89	8	779	586	430	218	122	23
SN005	117400				569	432	316	150	79	8	598	459	341	171	98	18
SN006	119700				442	340	252	123	67	8	465	361	271	140	82	16
SN007	121700				219	172	128	66	37	5	230	182	137	74	45	10
MESA TRIBUTARY																
MT000	130000		Edge of Reuter-Hess Normal Pool		493	363	261	119	55	3	598	457	343	184	114	34
MT001	131900				435	324	234	107	52	3	524	404	304	162	102	31
MT002	133900				338	255	186	86	43	3	406	316	238	128	81	27
MT003	136600				154	119	89	44	24	3	165	129	98	52	32	7
PARKWAY TRIBUTA																
PW000	140000		Edge of Reuter-Hess Normal Pool		730	573	435	239	153	46	1121	918	730	483	364	184
PW001	142000		Hess Rd. (D/S)		674	531	405	226	147	46	1046	860	686	460	349	180
PW002	144500				420	339	263	158	109	44	666	556	450	323	251	143
ROUNDTOP TRIBUT																
RT000	150000		Confluence w/ Newlin Gulch		429	320	232	106	51	3	504	385	288	151	92	27
RT001	152300				360	274	200	94	48	4	399	308	230	118	70	18
RT002	154400				204	158	117	58	32	4	208	161	120	61	35	6
SPRING TRIBUTARY																
ST000	160000		Confluence w/ Newlin Gulch		1009	749	546	267	146	30	1427	1128	870	521	374	175
ST001	162500				906	678	498	249	140	33	1244	983	758	458	332	162
ST002	163800		I-25 (U/S)		566	426	316	166	99	31	659	524	416	294	222	126
ST003	165800				402	309	232	122	75	21	491	387	297	171	118	47
ST004	167300				280	219	166	91	59	19	326	257	198	114	79	31
ST005	169700				161	129	100	60	41	16	161	129	100	60	41	16

Table B-5
Runoff Volumes - Existing Development

		Cumulative		3 Square Mile					E	(ISTING DE	VELOPMENT					
SWMM	Station	Drainage Area		Area Adjustment	100-YF	₹	50-YR	}	25-YR		10-YR		5-YR		2-YR	Į.
Node	(ft)	(ac)	Landmark	2-yr, 5-yr, 10-yr	(cf)	(in)	(cf)	(in)	(cf)	(in)	(cf)	(in)	(cf)	(in)	(cf)	(in)
NEWLIN GULCH	MAINSTEM															
NG000	0	9609	Cherry Creek	yes	60,057,128	1.72	47,512,820	1.36	36,664,400	1.05	22,077,031	0.63	14,400,081	0.41	7,114,818	0.20
NG001	3200	9455	Lincoln Ave (U/S)	yes	58,939,681	1.72	46,596,430	1.36	35,928,347	1.05	21,589,092	0.63	14,026,440	0.41	6,891,168	0.20
NG002	5300	9433	Jordan Rd. (U/S)	yes	58,803,860	1.72	46,488,415	1.36	35,842,390	1.05	21,526,395	0.63	13,973,769	0.41	6,854,539	0.20
NG004	10000	8635	Stonegate Parkway (U/S)	yes	53,179,195	1.70	41,885,881	1.34	32,167,341	1.03	19,049,270	0.61	12,135,910	0.39	5,839,359	0.19
NG006	14100	8285	Mainstreet (U/S)		51,154,448	1.70	40,321,536	1.34	30,987,999	1.03	19,747,624	0.66	12,875,706	0.43	5,821,312	0.19
NG009	19200	7271	Chambers Rd. (U/S)		45,506,656	1.72	36,012,701	1.36	27,795,809	1.05	17,964,174	0.68	11,864,402	0.45	5,472,670	0.21
NG011	22300	6974	Hess Rd. (U/S)		43,634,708	1.72	34,525,222	1.36	26,646,813	1.05	17,224,378	0.68	11,372,587	0.45	5,246,346	0.21
NG012	23500	6717	Rueter-Hess Reservoir Outflow		42,265,404	1.73	33,500,283	1.37	25,903,141	1.06	16,847,395	0.69	11,188,106	0.46	5,193,141	0.21
NG220	23600	6717	Rueter-Hess Reservoir Total Inflow	yes	42,270,618	1.73	33,505,363	1.37	25,908,221	1.06	15,785,025	0.65	10,255,273	0.42	5,036,332	0.21
NG014	41000	2042	Rueter-Hess Reservoir Inflow from Mainstem	yes	11,387,826	1.54	8,661,518	1.17	6,381,172	0.86	3,232,963	0.44	1,597,900	0.22	379,924	0.05
NG019	50600	334	I-25 (U/S)		1,832,244	1.51	1,387,752	1.14	1,016,918	0.84	561,731	0.46	290,223	0.24	49,061	0.04

Table B-6 Runoff Volumes - Future Development

		Cumulative		3 Square Mile					F	UTURE DE	VELOPMENT					
SWMM	Station	Drainage Area		Area Adjustment	100-YF	₹	50-YR		25-YR		10-YR		5-YR		2-YR	
Node	(ft)	(ac)	Landmark	2-yr, 5-yr, 10-yr	(cf)	(in)	(cf)	(in)	(cf)	(in)	(cf)	(in)	(cf)	(in)	(cf)	(in)
NEWLIN GULCH	MAINSTEM															
NG000	0	9609	Cherry Creek	yes	65,834,860	1.89	53,548,424	1.54	42,494,000	1.22	28,230,676	0.81	20,231,285	0.58	10,941,462	0.31
NG001	3200	9455	Lincoln Ave (U/S)	yes	64,715,541	1.89	52,630,029	1.53	41,755,943	1.22	27,740,732	0.81	19,855,639	0.58	10,716,610	0.31
NG002	5300	9433	Jordan Rd. (U/S)	yes	64,579,721	1.89	52,522,014	1.53	41,669,985	1.22	27,677,902	0.81	19,802,968	0.58	10,679,981	0.31
NG004	10000	8635	Stonegate Parkway (U/S)	yes	58,827,389	1.88	47,788,873	1.52	37,866,869	1.21	25,064,554	0.80	17,833,299	0.57	9,565,475	0.31
NG006	14100	8285	Mainstreet (U/S)		56,316,174	1.87	45,718,942	1.52	36,193,171	1.20	25,210,000	0.84	18,055,211	0.60	9,339,953	0.31
NG009	19200	7271	Chambers Rd. (U/S)		49,727,929	1.88	40,429,283	1.53	32,054,647	1.21	22,426,342	0.85	16,100,247	0.61	8,354,985	0.32
NG011	22300	6974	Hess Rd. (U/S)		47,728,315	1.89	38,809,460	1.53	30,777,450	1.22	21,552,330	0.85	15,481,567	0.61	8,042,303	0.32
NG012	23500	6717	Rueter-Hess Reservoir Outflow		46,352,996	1.90	37,778,639	1.55	30,028,430	1.23	21,170,668	0.87	15,293,477	0.63	7,987,092	0.33
NG220	23600	6717	Rueter-Hess Reservoir Total Inflow	yes	46,359,680	1.90	37,783,719	1.55	30,033,510	1.23	20,117,388	0.83	14,376,018	0.59	7,723,739	0.32
NG014	41000	2042	Rueter-Hess Reservoir Inflow from Mainstem	yes	13,512,165	1.82	10,881,306	1.47	8,530,242	1.15	5,505,154	0.74	3,772,637	0.51	1,847,216	0.25
NG019	50600	334	I-25 (U/S)		2,213,238	1.82	1,784,520	1.47	1,401,120	1.15	959,702	0.79	670,548	0.55	321,772	0.27

Table B-7
Sample SWMM Input

[TITLE]							A100	5767	0	0	0	0
Newlin Gulch							NG000	5766	0	0	0	0
Baseline Hydr							A104	5803	0	0	0	0
Future Develo	opment 1	00-yr r	no area ad	justment			A108	5767	0	0	0	0
							A110	5815	0	0	0	0
[OPTIONS]							NG002	5814	0	0	0	0
FLOW_UNITS		CFS					SJ000	5818	0	0	0	0
INFILTRATION		HORTON	1				NG003	5832	0	0	0	0
FLOW ROUTING		KINWAV	/E				A115	5846	0	0	0	0
START DATE		01/01/	/2005				A120	5833	0	0	0	0
START TIME		00:00					A125	5874	0	0	0	0
REPORT START	DATE	01/01/					NG004	5860	0	0	0	0
REPORT START		00:00					A130	5861	0	0	0	0
END_DATE	_	01/10/					NG005	5867.5	0	0	0	0
END TIME		00:00					A135	5868.5	0	0	0	0
SWEEP START		01/01					A140	5868.5	0	0	0	0
SWEEP_END		12/31					NG006	5902	0	0	0	0
DRY_DAYS		0					A145	5903	0	0	0	0
REPORT STEP		00:15:	• ∩ ∩				A155	5903	0	0	0	0
WET STEP		00:15					A150	5903	0	0	0	0
_		01:00:					NG005.5	5901	0	0	0	0
DRY_STEP ROUTING STEP		0:00:3					NG003.3 NG007	5924.5	0	0	0	0
	~		50							-	0	0
ALLOW_PONDING	J	NO	\ T				A165	5925.5	0	0	0	0
INERTIAL_DAME		PARTIA	₹L				NG008	5938	0	0	0	0
VARIABLE_STEE		0.75					A170	5939	0	0	0	0
LENGTHENING_S	STEP	0					NG009	5948	0	0	0	0
MIN_SURFAREA		0					A175	5939	0	0	0	0
NORMAL_FLOW_I	LIMITED	BOTH					A180	5949	0	0	0	0
SKIP_STEADY_S	STATE	NO					NG011	5992	0	0	0	0
FORCE_MAIN_EÇ	NOITAUQ	H-M					NG010	5964	0	0	0	0
LINK_OFFSETS		DEPTH					A200	5965	0	0	0	0
MIN_SLOPE		0					A190	5965	0	0	0	0
							A210	5993	0	0	0	0
[FILES]							A205	5993	0	0	0	0
						GY\Baseline\CUHP 2005	NG012	6216.5	0	0	0	0
- v. 1.3.3\0u	utput Fi	les\Fut	ture\Newli	nGulch_FU_1	00_2hr_CUHP	utput.txt"	A220	6217	0	0	0	0
							NG013	6217	0	0	0	0
[EVAPORATION]]						A221	6218	0	0	0	0
;;Type	Paramet	ers					A222	6218	0	0	0	0
;;							A223	6218	0	0	0	0
CONSTANT	0.0						A224	6218	0	0	0	0
	NO						A225	6218	0	0	0	0
_							A226	6218	0	0	0	0
[JUNCTIONS]							A227	6218	0	0	0	0
;;	Inv	ert	Max.	Init.	Surcharge	Ponded	A228	6218	0	0	0	0
;;Name	Ele		Depth	Depth	Depth	Area	NG014	6218	0	0	0	0
	;;							6219	0	0	0	0
NG001	580	2	0	0	0	0	A230 NG015	6235	0	0	0	0
	000		-	-	-	-			-	· ·	5	•

Table B-7
Sample SWMM Input

A240	6236	0	0	0	0	F120	6295	0	0	0	0
NG016	6250	0	0	0	0	F125	6336	0	0	0	0
NG017	6295	0	0	0	0	F130	6336	0	0	0	0
A250	6251	0	0	0	0	SN005	6377	0	0	0	0
A260	6296	0	0	0	0	F140	6378	0	0	0	0
NG018	6333	0	0	0	0	SN006	6415	0	0	0	0
A270	6334	0	0	0	0	F145	6416	0	0	0	0
NG019	6380	0	0	0	0	F150	6416	0	0	0	0
NG119	6395	0	0	0	0	SN007	6470	0	0	0	0
NG020	6410	0	0	0	0	F155	6471	0	0	0	0
A280	6381	0	0	0	0	MT000	6220	0	0	0	0
NG021	6450	0	0	0	0	G100	6221	0	0	0	0
A290	6411	0	0	0	0	MT001	6248	0	0	0	0
A300	6451	0	0	0	0	G110	6249	0	0	0	0
ST000	6251	0	0	0	0	MT002	6285	0	0	0	0
ST001	6294	0	0	0	0	MT003	6354	0	0	0	0
J100	6252	0	0	0	0	G120	6286	0	0	0	0
J110	6295	0	0	0	0	G115	6286	0	0	0	0
ST002	6325	0	0	0	0	G130	6355	0	0	0	0
ST101	6345	0	0	0	0	PW000	6218	0	0	0	0
J130	6326	0	0	0	0	PW001	6228	0	0	0	0
ST003	6363	0	0	0	0	Н100	6219	0	0	0	0
J120	6346	0	0	0	0	Н115	6229	0	0	0	0
A275	6396	0	0	0	0	PW002	6277	0	0	0	0
J140	6364	0	0	0	0	H125	6278	0	0	0	0
ST004	6397	0	0	0	0	H120	6278	0	0	0	0
ST005	6471	0	0	0	0	Н110	6229	0	0	0	0
J150	6398	0	0	0	0	BW000	6218	0	0	0	0
J160	6472	0	0	0	0	BW001	6219	0	0	0	0
ST102	6428	0	0	0	0	BW002	6235	0	0	0	0
J155	6429	0	0	0	0	E105	6219	0	0	0	0
RT000	6251	0	0	0	0	E115	6219	0	0	0	0
RT001	6297	0	0	0	0	E128	6219	0	0	0	0
I100	6252	0	0	0	0	E100	6220	0	0	0	0
I110	6298	0	0	0	0	E110	6220	0	0	0	0
RT002	6360	0	0	0	0	E120	6236	0	0	0	0
I120	6361	0	0	0	0	E124	6236	0	0	0	0
I115	6361	0	0	0	0	CT001	6219	0	0	0	0
SN000	6218	0	0	0	0	CT000	6218	0	0	0	0
F106	6219	0	0	0	0	D110	6220	0	0	0	0
F102	6219	0	0	0	0	D100	6220	0	0	0	0
F104	6219	0	0	0	0	D105	6220	0	0	0	0
SN001	6219	0	0	0	0	D103	6219	0	0	0	0
SN001 SN002	6264	0	0	0	0	D120	6219	0	0	0	0
F100	6220	0	0	0	0	D125	6219	0	0	0	0
SN003	6294	0	0	0	0	SP000	5948	0	0	0	0
F110	6265	0	0	0	0	SP000 SP001	5978	0	0	0	0
SN004	6335	0	0	0	0	SP001 SP002	6072	0	0	0	0
DIVUUT	0000	U	U	J	V	DEUUZ	0012	J	U	U	U

Table B-7
Sample SWMM Input

NG-OUT	5765	FREE			NO
;;Name	Elev.	Туре	Time S	Series	Gate
;;	Invert	Outfall	Stage/	Table	Tide
[OUTFALLS]					
C125	6073	0	0	0	0
A160	5925.5	0	0	0	0
B140	5971	0	0	0	0
SJ004	5970	0	0	0	0
B130	5921	0	0	0	0
B135	5921	0	0	0	0
SJ003	5903.20	0	0	0	0
B120	5885	0	0	0	0
SJ002	5884	0	0	0	0
B110	5875	0	0	0	0
SJ001	5874	0	0	0	0
B100	5819	0	0	0	0
C100	5949	0	0	0	0
C110	5979	0	0	0	0
C120	6073	0	0	0	0
C115	6012	0	0	0	0

Table B-7
Sample SWMM Input

<pre>[STORAGE] ;; ;;Name</pre>	Invert Elev.	Depth	Init. Depth	Storage Curve	Curve Param			Ponded Area	Frac.	Infiltration Parameters
;; NG220 SJ130	6216.7 5918.7	8	0	TABULAR TABULAR		STORAGE_RH_ STORAGE_PON			0 0)
[CONDUITS] ;; Name	Inlet Node		Outlet Node	Ler	ngth	Manning N	Inlet Offset	Outlet Offset		Max. Flow
;;	NG0.01					0.065				
A10 A10.4	NG001 NG002		NG000 NG001	305 157		0.065 0.065	0	0	0	0
A100-DF	A100		NG001 NG000	10	0	0.003	0	0	0	0
A104-DF	A104		NG000	10		0.01	0	0	0	0
A108-DF	A108		NG001	10		0.01	0	0	0	0
A11	NG003		NG002	193	3.0	0.085	0	0	0	0
A110-DF	A110		NG002	10	, ,	0.01	0	0	0	0
A115	A115		NG003	105	50	0.060	0	0	0	0
A12	NG004		NG003	319		0.085	0	0	0	0
A14	NG005.5		NG005	309	90	0.06	0	0	0	0
A14.5	NG006		NG005.5	100)	0.065	0	0	0	0
A120-DF	A120		NG003	10		0.01	0	0	0	0
A125	A125		NG004	950)	0.065	0	0	0	0
A13	NG005		NG004	120	0 (0.065	0	0	0	0
A130-DF	A130		NG004	10		0.01	0	0	0	0
A135-DF	A135		NG005	10		0.01	0	0	0	0
A140-DF	A140		NG005	10		0.01	0	0	0	0
A145-DF	A145		NG005.5	10		0.01	0	0	0	0
A15	NG007		NG006	215	6	0.06	0	0	0	0
A150-DF	A150		NG006	10		0.01	0	0	0	0
A155-DF	A155		NG006	10		0.01	0	0	0	0
A16	NG008		NG007	155	50	0.06	0	0	0	0
A160-DF	A160		NG007	10		0.01	0	0	0	0
A165-DF	A165		NG007	10		0.01	0	0	0	0
A17	NG009		NG008	780)	0.06	0	0	0	0
A170-DF	A170		NG008	10		0.01	0	0	0	0
A175-DF	A175		NG008	10		0.01	0	0	0	0
A180-DF	A180		NG009	10		0.01	0	0	0	0
A19	NG010		NG009	145	50	0.06	0	0	0	0
A190-DF	A190		NG010	10		0.01	0	0	0	0
A20	NG011		NG010	207	75	0.06	0	0	0	0
A200-DF	A200		NG010	10		0.01	0	0	0	0
A205-DF	A205		NG011	10		0.01	0	0	0	0
A21	NG012		NG011	407	4	0.08	0	0	0	0
A210-DF	A210		NG011	10		0.01	0	0	0	0
A22	NG014		NG013	10		0.01	0	0	0	0
A220-DF	A220		NG220	10		0.01	0	0	0	0

Table B-7
Sample SWMM Input

A221-DF	A221	NG013	10	0.01	0	0	0	0
A222-DF	A222	NG013	10	0.01	0	0	0	0
A223-DF	A223	NG013	10	0.01	0	0	0	0
A224-DF	A224	NG013	10	0.01	0	0	0	0
A225-DF	A225	NG013	10	0.01	0	0	0	0
A226-DF	A226	NG013	10	0.01	0	0	0	0
A227-DF	A227	NG013	10	0.01	0	0	0	0
A228-DF	A228	NG013	10	0.01	0	0	0	0
A23	NG015	NG014	1318	0.06	0	0	0	0
A230-DF	A230	NG014	10	0.01	0	0	0	0
A24	NG016	NG015	1619	0.06	0	0	0	0
A240-DF	A240	NG015	10	0.01	0	0	0	0
A25	NG017	NG016	2673	0.075	0	0	0	0
A250-DF	A250	NG016	10	0.01	0	0	0	0
A26	NG018	NG017	2266	0.075	0	0	0	0
A260-DF	A260	NG017	10	0.01	0	0	0	0
A270 DI	NG019	NG017	1637	0.075	0	0	0	0
A27.5	NG119	NG018	1584	0.065	0	0	0	0
A270-DF	A270	NG018	10	0.003	0	0	0	0
A275-DF	A275	NG119	10	0.01	0	0	0	0
A275-DF A28	NG020	NG019	1818	0.075	0	0	0	0
A280-DF	A280	NG019 NG019	10	0.01	0	0	0	0
A200-DF A29	NG021	NG019 NG020	1474	0.075	0	0	0	0
A290-DF					-	0	0	0
	A290	NG020	10	0.01	0	•	ŭ	0
A300-DF	A300	NG021	10	0.01	0	0	0	0
B10	SJ001	SJ000	3247	0.075	0	0	0	0
B100-DF	B100	SJ000	10	0.01	0	0	0	0
B11	SJ002	SJ001	1261	0.085	0	0	0	0
B110-DF	B110	SJ001	10	0.01	0	0	0	0
B12	SJ003	SJ002	1877	0.085	0	0	0	0
B120-DF	B120	SJ002	10	0.01	0	0	0	0
B13	SJ004	SJ130	3351	0.075	0	0	0	0
B130-DF	B130	SJ130	10	0.01	0	0	0	0
B135-DF	B135	SJ130	10	0.01	0	0	0	0
B140-DF	B140	SJ004	10	0.01	0	0	0	0
BW-OUT	BW000	NG013	10	0.01	0	0	0	0
C10	SP001	SP000	2104	0.075	0	0	0	0
C100-DF	C100	SP000	10	0.01	0	0	0	0
C11	SP002	SP001	3220	0.09	0	0	0	0
C11.5	C115	SP001	1577	0.09	0	0	0	0
C110-DF	C110	SP001	10	0.01	0	0	0	0
C120-DF	C120	SP002	10	0.01	0	0	0	0
C125-DF	C125	SP002	10	0.01	0	0	0	0
CT-OUT	CT000	NG013	10	0.01	0	0	0	0
D10	CT001	CT000	10	0.01	0	0	0	0
D100-DF	D100	CT001	10	0.01	0	0	0	0
D105-DF	D105	CT001	10	0.01	0	0	0	0
D110-DF	D110	CT001	10	0.01	0	0	0	0

Table B-7
Sample SWMM Input

					_			_
D115-DF	D115	CT000	10	0.01	0	0	0	0
D120-DF	D120	CT000	10	0.01	0	0	0	0
D125-DF	D125	CT000	10	0.01	0	0	0	0
E10.5	BW001	BW000	10	0.01	0	0	0	0
E100-DF	E100	BW001	10	0.01	0	0	0	0
E105-DF	E105	BW000	10	0.01	0	0	0	0
E11	BW002	BW001	770	0.085	0	0	0	0
E110-DF	E110	BW001	10	0.01	0	0	0	0
E115-DF	E115	BW000	10	0.01	0	0	0	0
E120-DF	E120	BW002	10	0.01	0	0	0	0
E124-DF	E124	BW002	10	0.01	0	0	0	0
E128-DF	E128	BW000	10	0.01	0	0	0	0
F10	SN002	SN001	2768	0.075	0	0	0	0
F10.2	SN002 SN001	SN001 SN000	10	0.01	0	0	0	0
F100-DF	F100	SN000 SN001	10	0.01	0	0	0	0
F100 DF F102-DF	F100	SN001 SN000	10	0.01	0	0	0	0
F104-DF		SN000 SN000	10		0	0	0	0
	F104			0.01	-	•	-	O
F106-DF	F106	SN000	10	0.01	0	0	0	0
F11	SN003	SN002	1889	0.075	0	0	0	0
F110-DF	F110	SN002	10	0.01	0	0	0	0
F12	SN004	SN003	2764	0.075	0	0	0	0
F120-DF	F120	SN003	10	0.01	0	0	0	0
F125-DF	F125	SN004	10	0.01	0	0	0	0
F13	SN005	SN004	2822	0.075	0	0	0	0
F130-DF	F130	SN004	10	0.01	0	0	0	0
F14	SN006	SN005	2295	0.085	0	0	0	0
F140-DF	F140	SN005	10	0.01	0	0	0	0
F145-DF	F145	SN006	10	0.01	0	0	0	0
F15	SN007	SN006	2047	0.09	0	0	0	0
F150-DF	F150	SN006	10	0.01	0	0	0	0
F155-DF	F155	SN007	10	0.01	0	0	0	0
G10	MT001	MT000	1907	0.075	0	0	0	0
G100-DF	G100	MT000	10	0.01	0	0	0	0
G11	MT002	MT001	1883	0.085	0	0	0	0
G110-DF	G110	MT001	10	0.01	0	0	0	0
G115-DF	G115	MT002	10	0.01	0	0	0	0
G12	MT003	MT002	2682	0.085	0	0	0	0
G120-DF	G120	MT002	10	0.01	0	0	0	0
G130-DF	G130	MT003	10	0.01	0	0	0	0
H10	PW001	PW000	676	0.07	0	0	0	0
H100-DF	Н100	PW000	10	0.01	0	0	0	0
H11	PW002	PW001	1853	0.085	0	0	0	0
H110-DF	H110	PW001	10	0.01	0	0	0	0
H115-DF	H115	PW001	10	0.01	0	0	0	0
H120-DF	H120	PW002	10	0.01	0	0	0	0
H125-DF	H125	PW002	10	0.01	0	0	0	0
I10	RT001	RT000	2491	.08	0	0	0	0
I100-DF	I100	RT000	10	0.01	0	0	0	0
TT00-DE	T T O O	VIOOO	TO	0.01	U	U	U	U

Table B-7
Sample SWMM Input

I11 I110-DF	RT002 I110	RT001 RT001	2223 10	0.085 0.01	0 0	0 0	0 0	0 0	
I115-DF	I115	RT002	10	0.01	0	0	0	0	
I120-DF	I120	RT002	10	0.01	0	0	0	0	
J10	ST001	ST000	2439	0.06	0	0	0	0	
J100-DF	J100	ST000	10	0.01	0	0	0	0	
J11	ST002	ST001	1373	0.08	0	0	0	0	
J11.5	ST101	ST001	1694	0.08	0	0	0	0	
J110-DF	J110	ST001	10	0.01	0	0	0	0	
J12	ST102	ST101	3031	0.09	0	0	0	0	
J120-DF	J120	ST101	10	0.01	0	0	0	0	
J13	ST003	ST002	2060	0.08	0	0	0	0	
J130-DF	J130	ST002	10	0.01	0	0	0	0	
J14	ST004	ST003	1514	0.09	0	0	0	0	
J140-DF	J140	ST003	10	0.01	0	0	0	0	
J15	ST005	ST004	2361	0.09	0	0	0	0	
J150-DF	J150	ST004	10	0.01	0	0	0	0	
J155-DF	J155	ST102	10	0.01	0	0	0	0	
J160-DF	J160	ST005	10	0.01	0	0	0	0	
MT-OUT	MT000	SN001	10	0.01	0	0	0	0	
NG220-IN	NG013	NG220	10	0.01	0	0	0	0	
NG-OUT	NG000	NG-OUT	10	0.01	0	0	0	0	
PW-OUT	PW000	NG013	10	0.01	0	0	0	0	
RT-OUT	RT000	NG016	10	0.01	0	0	0	0	
SJ-OUT	SJ000	NG002	10	0.01	0	0	0	0	
SN-OUT	SN000	NG013	10	0.01	0	0	0	0	
SP-OUT	SP000	NG008	20	0.01	0	0	0	0	
ST-OUT	ST000	NG016	10	0.01	0	0	0	0	
[OUTLETS]									
;;	Inlet	Outlet	Outflow	Outlet		Qcoeff/		Flap	
;;Name	Node	Node	Height	Туре		QTable	Qexpon	Gate	
;; NG220-OUT	NG220	NG012	0	TABULAR/	DEPTH	A220_OUTFLOW	_RH_AUX-ONLY		NO
SJ130-OUT	SJ130	SJ003	0	TABULAR/	DEPTH	B130_OUTFLOW		NO	

Table B-7
Sample SWMM Input

[XSECTIONS]							A227-DF	DUMMY	0	0	0	0	1
;;Link	Shape	Geom1	Geom2	Geom3	Geom4		A228-DF	DUMMY	0	0	0	0	1
Barrels	bilape	CCOMI	GCOMZ	GCOMS	OCOM 1		A23	TRAPEZOIDAL	10	80	10	10	1
							A230-DF	DUMMY	0	0	0	0	1
							A24	TRAPEZOIDAL	10	80	10	10	1
A10	TRAPEZOIDAL	15	130	6	6	1	A240-DF	DUMMY	0	0	0	0	1
A10.4	TRAPEZOIDAL	15	75	6	5	1	A25	TRAPEZOIDAL	10	50	10	10	1
A100-DF	DUMMY	0	0	0	0	1	A250-DF	DUMMY	0	0	0	0	1
A104-DF	DUMMY	0	0	0	0	1	A26	TRAPEZOIDAL	10	60	10	10	1
A108-DF	DUMMY	0	0	0	0	1	A260-DF	DUMMY	0	0	0	0	1
A11	TRAPEZOIDAL	15	60	5	5	1	A27	TRAPEZOIDAL	10	32	10	10	1
A110-DF	DUMMY	0	0	0	0	1	A27.5	TRAPEZOIDAL	10	20	10	10	1
A115	TRAPEZOIDAL	10	10	5	5	1	A270-DF	DUMMY	0	0	0	0	1
A12	TRAPEZOIDAL	10	65	5	5	1	A275-DF	DUMMY	0	0	0	0	1
A14	TRAPEZOIDAL	10	109	5	5	1	A28	TRAPEZOIDAL	10	30	10	10	1
A14.5	TRAPEZOIDAL	10	109	5	5	1	A280-DF	DUMMY	0	0	0	0	1
A120-DF	DUMMY	0	0	0	0	1	A29	TRAPEZOIDAL	10	40	10	10	1
A125	TRAPEZOIDAL	10	20	6	6	1	A290-DF	DUMMY	0	0	0	0	1
A13	TRAPEZOIDAL	10	110	5	5	1	A300-DF	DUMMY	0	0	0	0	1
A130-DF	DUMMY	0	0	0	0	1	B10	TRAPEZOIDAL	10	32	9	5	1
A135-DF	DUMMY	0	0	0	0	1	B100-DF	DUMMY	0	0	0	0	1
A140-DF	DUMMY	0	0	0	0	1	B11	TRAPEZOIDAL	10	35	10	15	1
A145-DF	DUMMY	0	0	0	0	1	B110-DF	DUMMY	0	0	0	0	1
A15	TRAPEZOIDAL	10	111	10	3.5	1	B12	TRAPEZOIDAL	10	35	10	10	1
A150-DF	DUMMY	0	0	0	0	1	B120-DF	DUMMY	0	0	0	0	1
A155-DF	DUMMY	0	0	0	0	1	B13	TRAPEZOIDAL	10	25	5	5	1
A16	TRAPEZOIDAL	10	110	20	10	1	B130-DF	DUMMY	0	0	0	0	1
A160-DF	DUMMY	0	0	0	0	1	B135-DF	DUMMY	0	0	0	0	1
A165-DF	DUMMY	0	0	0	0	1	B140-DF	DUMMY	0	0	0	0	1
A17	TRAPEZOIDAL	10	100	6	6	1	BW-OUT	DUMMY	0	0	0	0	1
A170-DF	DUMMY	0	0	0	0	1	C10	TRAPEZOIDAL	10	30	4	4	1
A175-DF	DUMMY	0	0	0	0	1	C100-DF	DUMMY	0	0	0	0	1
A180-DF	DUMMY	0	0	0	0	1	C11	TRAPEZOIDAL	10	20	4	4	1
A19	TRAPEZOIDAL	10	80	3	5	1	C11.5	TRAPEZOIDAL	10	60	15	15	1
A190-DF	DUMMY	0	0	0	0	1	C110-DF	DUMMY	0	0	0	0	1
A20	TRAPEZOIDAL	10	180	10	10	1	C120-DF	DUMMY	0	0	0	0	1
A200-DF	DUMMY	0	0	0	0	1	C125-DF	DUMMY	0	0	0	0	1
A205-DF	DUMMY	0	0	0	0	1	CT-OUT	DUMMY	0	0	0	0	1
A21	TRAPEZOIDAL	10	330	5	5	1	D10	DUMMY	0	0	0	0	1
A210-DF	DUMMY	0	0	0	0	1	D100-DF	DUMMY	0	0	0	0	1
A22	DUMMY	0	0	0	0	1	D105-DF	DUMMY	0	0	0	0	1
A220-DF	DUMMY	0	0	0	0	1	D110-DF	DUMMY	0	0	0	0	1
A221-DF	DUMMY	0	0	0	0	1	D115-DF	DUMMY	0	0	0	0	1
A222-DF	DUMMY	0	0	0	0	1	D120-DF	DUMMY	0	0	0	0	1
A223-DF	DUMMY	0	0	0	0	1	D125-DF	DUMMY	0	0	0	0	1
A224-DF	DUMMY	0	0	0	0	1	E10.5	DUMMY	0	0	0	0	1
A225-DF	DUMMY	0	0	0	0	1	E100-DF	DUMMY	0	0	0	0	1
A226-DF	DUMMY	0	0	0	0	1	E105-DF	DUMMY	0	0	0	0	1

10

10

Table B-7
Sample SWMM Input

E11	TRAPEZOIDAL	10	30	10	15	1	J11	TRAPEZOIDAI	L 10		30	10
E110-DF	DUMMY	0	0	0	0	1	J11.5	TRAPEZOIDAI			60	10
E115 DF E115-DF	DUMMY	0	0	0	0	1	J110-DF	DUMMY	0		0	0
E120-DF	DUMMY	0	0	0	0	1	J12	TRAPEZOIDAI			60	10
E124-DF	DUMMY	0	0	0	0	1	J120-DF	DUMMY	0		0	0
E124-DF E128-DF		0	0	0	0	1	J13		-		25	6
	DUMMY	ŭ	•	-	-	1	J130-DF	TRAPEZOIDAI				0
F10	TRAPEZOIDAL	10	60	10	10	1		DUMMY	0		0	-
F10.2	DUMMY	0	0	0	0	1	J14	TRAPEZOIDAI			25	10
F100-DF	DUMMY	0	0	0	0	1	J140-DF	DUMMY	0		0	0
F102-DF	DUMMY	0	0	0	0	1	J15	TRAPEZOIDAI			30	10
F104-DF	DUMMY	0	0	0	0	1	J150-DF	DUMMY	0		0	0
F106-DF	DUMMY	0	0	0	0	1	J155-DF	DUMMY	0	(0	0
F11	TRAPEZOIDAL	10	40	9	10	1	J160-DF	DUMMY	0	(0	0
F110-DF	DUMMY	0	0	0	0	1	MT-OUT	DUMMY	0	(0	0
F12	TRAPEZOIDAL	10	60	10	10	1	NG220-IN	DUMMY	0	(0	0
F120-DF	DUMMY	0	0	0	0	1	NG-OUT	DUMMY	0	(0	0
F125-DF	DUMMY	0	0	0	0	1	PW-OUT	DUMMY	0	(0	0
F13	TRAPEZOIDAL	10	25	10	10	1	RT-OUT	DUMMY	0	(0	0
F130-DF	DUMMY	0	0	0	0	1	SJ-OUT	DUMMY	0	(0	0
F14	TRAPEZOIDAL	10	20	10	10	1	SN-OUT	DUMMY	0	(0	0
F140-DF	DUMMY	0	0	0	0	1	SP-OUT	DUMMY	0	(0	0
F145-DF	DUMMY	0	0	0	0	1	ST-OUT	DUMMY	0	(0	0
F15	TRAPEZOIDAL	10	20	10	10	1						
F150-DF	DUMMY	0	0	0	0	1	[LOSSES]					
F155-DF	DUMMY	0	0	0	0	1	;;Link	Inlet	Outlet	Average	Flap Ga	ate
G10	TRAPEZOIDAL	10	35	15	15	1	;;					
G100-DF	DUMMY	0	0	0	0	1						
G11	TRAPEZOIDAL	10	30	15	10	1	[CURVES]					
G110-DF	DUMMY	0	0	0	0	1	;;Name	Type	X-Value	V 770]		
G115-DF			U	U		1	; ; Name	TAbe	A value	Y-Value		
	DUMMY	0	0	0	0	1	;;			r-varue 		
G12	DUMMY TRAPEZOIDAL	0 10	•	-	-	1 1	;;				 low only	
	TRAPEZOIDAL	· ·	0	0	0	1 1 1	;;;A rating curve	based on the	aux. spi	 llway outfi		
G120-DF	TRAPEZOIDAL DUMMY	10	0 20	0 15	0 11	1 1 1 1	;;;A rating curve A220_OUTFLOW_RH_	based on the	aux. spii	llway outfi	0.0	
	TRAPEZOIDAL DUMMY DUMMY	10 0 0	0 20 0	0 15 0	0 11 0 0	1 1 1 1 1	;;;A rating curve A220_OUTFLOW_RH_ A220_OUTFLOW_RH_	based on the AUX-ONLY Rat	e aux. sping 0	llway outfi .0 (0.0 359.0	
G120-DF G130-DF H10	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL	10 0	0 20 0	0 15 0 0	0 11 0	1 1 1 1 1	;;;A rating curve A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_	based on the AUX-ONLY Rat AUX-ONLY	e aux. spi	llway outfi .0 (.4	0.0 359.0 1220.0	
G120-DF G130-DF H10 H100-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY	10 0 0 10 0	0 20 0 0 70	0 15 0 0 10	0 11 0 0 10	1 1 1 1 1 1	;;;A rating curve A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH	based on the AUX-ONLY Rat AUX-ONLY AUX-ONLY AUX-ONLY	e aux. sping 0 0 0 0 1	llway outfi .0 (.4 .9 .4	0.0 359.0 1220.0 2381.0	
G120-DF G130-DF H10 H100-DF H11	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL	10 0 0 10	0 20 0 0 70 0 30	0 15 0 0 10 0	0 11 0 0 10 0 15	1 1 1 1 1 1 1	;;; A rating curve A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_	based on the AUX-ONLY Rat AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY	e aux. sping 0 0 0 0 1 1	llway outfi .0 .4 .9 .4	0.0 359.0 1220.0 2381.0 3785.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL	10 0 0 10 0	0 20 0 0 70	0 15 0 0 10 0 15	0 11 0 0 10 0 15 0	1 1 1 1 1 1 1	;;; A rating curve A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_	based on the AUX-ONLY Rat AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY	e aux. spicing 0 0 0 1 1 2	llway outfi .0 .4 .9 .4 .9 .4	0.0 359.0 1220.0 2381.0 3785.0 5403.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H115-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY	10 0 0 10 0	0 20 0 0 70 0 30 0	0 15 0 0 10 0 15 0	0 11 0 0 10 0 15 0	1 1 1 1 1 1 1 1	;;; A rating curve A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_ A220_OUTFLOW_RH_	based on the AUX-ONLY Rat AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY	e aux. sping 0 0 0 0 1 1 2 2 2	llway outfi .0 .4 .9 .4 .9 .4 .9 .5	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H115-DF H120-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY DUMMY	10 0 0 10 0 10 0 0	0 20 0 0 70 0 30 0	0 15 0 0 10 0 15 0	0 11 0 0 10 0 15 0 0	1 1 1 1 1 1 1 1 1	;; A rating curve A220 OUTFLOW RH	based on the AUX-ONLY Rat AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY AUX-ONLY	e aux. spi ting 0 0 0 1 1 2 2	llway outfi .0 .4 .9 .4 .9 .4 .9 .4 .9 .4 .9 .4 .9 .4	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0 9213.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H115-DF H120-DF H125-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY DUMMY DUMMY	10 0 0 10 0 10 0 0 0	0 20 0 0 70 0 30 0 0	0 15 0 0 10 0 15 0 0	0 11 0 0 10 0 15 0 0	1 1 1	;; ;A rating curve A220 OUTFLOW RH	based on the AUX-ONLY Rat AUX-ONLY	e aux. spi zing 0 0 0 1 1 2 2 3 3	llway outfi .0	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0 9213.0 11380.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H115-DF H120-DF H125-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY DUMMY DUMMY DUMMY DUMMY TRAPEZOIDAL	10 0 0 10 0 10 0 0 0 0	0 20 0 0 70 0 30 0 0 0	0 15 0 0 10 0 15 0 0 0	0 11 0 0 10 0 15 0 0 0	1 1 1 1	;; ;A rating curve A220 OUTFLOW RH	based on the AUX-ONLY Rat AUX-ONLY	e aux. spi eing 0 0 0 1 1 2 2 3 3	llway outfi .0 () .4 () .9 () .4 () .9 () .4 () .9 () .4 () .9 ()	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0 9213.0 11380.0 13712.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H115-DF H120-DF H125-DF I10	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY DUMMY DUMMY DUMMY DUMMY DUMMY DUMMY	10 0 0 10 0 10 0 0 0 0 0	0 20 0 0 70 0 30 0 0 0 0 0 35 0	0 15 0 0 10 0 15 0 0 0	0 11 0 0 10 0 15 0 0 0 0	1 1 1 1 1	;; ;A rating curve A220_OUTFLOW_RH	based on the AUX-ONLY Rat AUX-ONLY	e aux. spi eing 0 0 0 1 1 2 2 3 3 4	llway outfi .0	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0 9213.0 11380.0 13712.0 16202.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H115-DF H120-DF H125-DF I10 I100-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY DUMMY DUMMY DUMMY TRAPEZOIDAL DUMMY	10 0 0 10 0 10 0 0 0 0 0 10 0	0 20 0 0 70 0 30 0 0 0 0 0 35 0 30	0 15 0 0 10 0 15 0 0 0 0 10 0	0 11 0 0 10 0 15 0 0 0 0 10 0	1 1 1 1	;; A rating curve A220 OUTFLOW RH	based on the AUX-ONLY Rat AUX-ONLY	e aux. sping 0 0 0 0 1 1 1 2 2 2 3 3 3 4 4 4 5 5	llway outfi .0	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0 9213.0 11380.0 13712.0 16202.0 18846.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H115-DF H120-DF H125-DF I10 I100-DF I11	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY DUMMY DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY	10 0 0 10 0 10 0 0 0 0 0 0 10 0 0	0 20 0 0 70 0 30 0 0 0 0 0 35 0	0 15 0 0 10 0 15 0 0 0	0 11 0 0 10 0 15 0 0 0 0 10 0 0	1 1 1 1 1	;; A rating curve A220 OUTFLOW RH	based on the AUX-ONLY Rat AUX-ONLY	e aux. sping 0 0 0 0 1 1 2 2 2 3 3 3 4 4 5 5 5	llway outfi .0	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0 9213.0 11380.0 13712.0 16202.0 18846.0 21640.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H125-DF H120-DF I10 I100-DF I11 I110-DF I115-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY DUMMY DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY	10 0 0 10 0 10 0 0 0 0 0 0 10 0 0	0 20 0 0 70 0 30 0 0 0 0 0 35 0 0 35 0	0 15 0 0 10 0 15 0 0 0 0 10 0	0 11 0 0 10 0 15 0 0 0 0 0 10 0 0	1 1 1 1 1	;; ;A rating curve A220 OUTFLOW RH	based on the AUX-ONLY Rat AUX-ONLY	e aux. sping 0 0 0 0 1 1 2 2 2 3 3 3 4 4 5 5 5	llway outfi .0	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0 9213.0 11380.0 13712.0 16202.0 18846.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H125-DF H120-DF H125-DF I10 I100-DF I11 I110-DF I115-DF I120-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY DUMMY	10 0 0 10 0 10 0 0 0 0 0 0 10 0 0	0 20 0 0 70 0 30 0 0 0 0 0 35 0 0 35 0	0 15 0 0 10 0 15 0 0 0 0 10 0	0 11 0 0 10 0 15 0 0 0 0 0 10 0 0	1 1 1 1 1	;; ;A rating curve A220 OUTFLOW RH	based on the AUX-ONLY Rat AUX-ONLY Pond IV	e aux. spi zing 0 0 0 1 1 2 2 3 3 4 4 4 5 5	llway outfi .0	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0 9213.0 11380.0 13712.0 16202.0 18846.0 21640.0	
G120-DF G130-DF H10 H100-DF H11 H110-DF H125-DF H120-DF I10 I100-DF I11 I110-DF I115-DF	TRAPEZOIDAL DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY DUMMY DUMMY DUMMY DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY TRAPEZOIDAL DUMMY	10 0 0 10 0 10 0 0 0 0 0 0 10 0 0	0 20 0 0 70 0 30 0 0 0 0 0 35 0 0 35 0	0 15 0 0 10 0 15 0 0 0 0 10 0	0 11 0 0 10 0 15 0 0 0 0 0 10 0 0	1 1 1 1 1	;; ;A rating curve A220 OUTFLOW RH	based on the AUX-ONLY Rat AUX-ONLY Pond IV	e aux. spi zing 0 0 0 1 1 2 2 3 3 4 4 4 5 5	llway outfi .0	0.0 359.0 1220.0 2381.0 3785.0 5403.0 7217.0 9213.0 11380.0 13712.0 16202.0 18846.0 21640.0	

Table B-7
Sample SWMM Input

B130_OUTFLOW_PONDIV Rating B130_OUTFLOW_PONDIV	0 00	0 00	NG001	3200434.454	1620248.042
D130_OUTELOW_FONDIV RACING	3.00	66 05	A100	2100070 010	1620764 001
D130_OUTELOW_FONDIV	3.00	00.03	NG000	2202451 702	1621343.740
B130_OUTFLOW_PONDIV	3.30	94.J4 115.70	A104	3199970.010 3202451.782 3199678.939 3201271.874 3198372.235	1619983.260
B130_OUTFLOW_PONDIV	4.00	133.70		3199070.939	1620001 201
B130_OUTFLOW_PONDIV	4.30	133.70	A108	32012/1.0/4	1620001.381
B130_OUTFLOW_PONDIV	5.00	149.48	A110	3198372.235	1619389.734
B130_OUTFLOW_PONDIV	5.50	103.75	NG002		1619471.773
B130_OUTFLOW_PONDIV	6.00	1/6.8/	SJ000	3199156.882	1619020.601
B130_OUTFLOW_PONDIV	6.50	189.08	NG003	3198094.255	1618124.588
B130_OUTFLOW_PONDIV	7.00	200.55	A115	3197290.806	1618920.633
B130_OUTFLOW_PONDIV	7.50	211.40	A120	3197057.927	1616791.729
B130_OUTFLOW_PONDIV	8.00	221.72	A125	3195098.188	1617980.024
B130_OUTFLOW_PONDIV	8.50	231.58	NG004		1617209.123
B130_OUTFLOW_PONDIV	9.00	247.00	A130	3194762.473	
B130_OUTFLOW_PONDIV	9.50	290.23	NG005	3195641.134	1616077.641
B130_OUTFLOW_PONDIV	10.00	351.23	A135		
B130_OUTFLOW_PONDIV	10.50	426.96	A140		
B130_OUTFLOW_PONDIV	11.00	516.27	NG006		
B130_OUTFLOW_PONDIV	11.30	576.13	A145		
;Storage curve for RH res. usi	ng only the	volume above the aux. spillway	A155		1613449.948
			A150	3195011.151	1612732.928
A220_STORAGE_RH_AUX-ONLY Stora A220_STORAGE_RH_AUX-ONLY A220_STORAGE_RH_AUX-ONLY	.ge 0	50660280	NG005.5	3194365.598	1614031.019
A220 STORAGE RH AUX-ONLY	1.4	50965200	NG007	3194447.957	1611819.688
A220 STORAGE RH AUX-ONLY	6.4	53622360	A165	3193686.138	1612676.218
;Bradbury Ranch Pond IV			NG008	3193817.912	1610563.717
;Based on Douglas County 5-Foo	t Contours		A170		
-			NG009		
B130_STORAGE_PONDIV Storage B130_STORAGE_PONDIV B130_STORAGE_PONDIV B130_STORAGE_PONDIV	0	0	A175		
B130 STORAGE PONDIV	6.3	82308	A180	3193937.332	
B130 STORAGE PONDIV	8.8	150181	NG011	3192067.790	
B130 STORAGE PONDIV	11.3	218054	NG010	3192969.618	
			A200	3193344.350	
[REPORT]			A190	3192269.569	
INPUT NO			A210	3190737.697	
CONTROLS NO			A205	3192920.202	
SUBCATCHMENTS ALL			NG012	3187913.217	1605737.905
NODES ALL			A220	3189079.770	1604635.080
LINKS ALL			NG013	3187199.223	1600654.683
TIME TIME			A221	3192630.208	1601386.761
[TAGS]			A222	3191847.800	1599039.537
[IAGD]			A223	3186560.371	1601880.913
[MAD]			A223 A224	3184451.988	1601263.223
[MAP] DIMENSIONS 3159265.825 1580659	0/10 201220	0 225 1624721 740	A224 A225	3183611.929	
	.249 321332	0.323 1024/21./43		3183611.929	1600489.051 1599311.321
Units None			A226		
			A227	3184050.826	1597685.449
[COORDINATES]	V 0	and a	A228	3181973.792	1597703.176
;;Node X-Coord	Y-Coo	ora	NG014	3181801.525	1596233.164
;;			A230	3182054.183	1595429.252

Table B-7
Sample SWMM Input

Model Miles Mile	NG015	3181342.146	1595234.016	SN004	3185534.206	1589470.507
NGO16 318(193,700 199401,495 F125 318447,572 158318,950 NGO17 3178792,595 1597707,434 F130 3184229,646 1589365,820 A250 3178781,111 191558,987 F140 3182329,143 1586716,432 NGO18 3177667,117 1591042,186 NGO19 1174231,559 1190376,097 F150 3109392,189 1566633,594 NGO19 1174231,559 1190376,097 F150 3109392,189 1566633,594 NGO19 1174231,559 1190376,097 F150 3109392,187 1566772,862 NGO19 1174331,855 1183664,090 NGO19 1174331,855 1183681,772 NGO10 1174331,855 NGO10 NGO19						
Model						
A250 3179481.663 159286.732 NN005 3183601.521 1587869.937 A260 3176767.117 1591058.9367 P140 3183259.143 158716.932 N0018 3177667.117 1591058.9367 P140 3183259.268 159635.904 A270 3177289.130 1588081.804 P145 1582039.288 159635.904 A270 3177289.130 1588081.804 P145 1582039.237 1586777.2802 N0019 3176231.555 1590376.087 P150 180932.397 1586772.802 N0019 3176231.555 1590376.087 P150 180932.397 1586772.802 N0019 3176231.555 1590376.087 P150 180932.397 1586772.802 N0019 3174518.089 1589064.050 P155 1798044.998 1595081.703 N0022 3174518.089 1589049.354 P150 1798044.998 1595081.703 N0022 3174518.089 1589064.072 P150 1798044.998 1595081.073 N0022 317408.088 1589084.072 P150 1798048.998 1595081.074 N002 3183338.420 1593081.074 N002 3174081.074 N002 3174081						
AZEG 3.79781.111 1.59158.987 F140 318229.144 1.58616.432 MOD18 3.777298.130 1.591042.186 \$1006 318209.268 1.59247.976 AZYU 3.777298.130 1.599301.864 F145 3182039.268 1.59247.976 MG19 3.176346.404 1.591616.409 81007 3160509.226 1.585081.703 MG20 3.774511.859 1.59064.050 F155 3173646.998 1.585081.703 AZEG 3.175140.533 1.590648.354 MIODO 3165501.994 1.59488.763 MOZ1 3.173119.269 1.59204.672 G100 3165501.994 1.59488.90 1.59381.306 ASDO 3.17408.384 1.59386.138 G110 316475.026 1.59381.307 STODI 3.17408.384 1.59489.9010 MT002 3183794.420 1.59262.476 STODI 3.17408.607 1.594489.010 MT002 3183794.420 1.59268.476 STODI 3.17408.796 1.594489.010 MT003 3182371.18 1.59468.330 STODI						
MAG18 3177687, 117 1591042,186 80006 3182055,628 1586635,994 MAZ70 3177238,130 169801,666 P145 3182039,268 1585027,976 MO19 3176231,559 1590746,097 F150 3190992,297 1586772,802 MAC19 317431,859 158664,059 F155 3179864,998 1585081,703 MAC20 317319,269 1590546,354 M0001 3185661,994 15985081,703 MAC21 317319,269 159024,699 1599383,204 1599383,204 1599383,204 A200 317281,456 1590123,429 M001 3187446,026 1599883,206 A300 317408,687 159499,010 M003 312333,422 1590383,206 A300 3177486,697 1595268,469 6110 318753,442 1590383,306 ST001 3177386,697 159498,007 1900 3187567,598 6115 318381,160 1591411,245 ST002 3176687,989 159475,1668 6120 3187677,945 1595387,797 1595387,797						
A270 \$177281.159 \$1589801.864 F145 \$182039.268 \$185427.976 M0019 \$176345.159 \$1590376.087 \$150 \$180592.26 \$185540.769 M0119 \$176346.404 \$1591616.409 \$8007 \$180599.226 \$185540.769 M0202 \$173131.859 \$18966.6050 \$155 \$179864.998 \$185001.994 \$158487.769 A280 \$175140.555 \$159084.356 \$1000 \$18349.990 \$159488.5.918 M021 \$17319.269 \$1001 \$18349.990 \$159384.990 \$159						
NC019 3176231,559 1593376,087 F150 3180992,397 1586772,802 NC019 3176364,040 1591618,409 SNOOT 3180509,226 15855648,769 NC020 3174511,859 158664,050 F155 3179664,998 1585681,769 NC020 3174511,859 1589664,050 F150 3185001,994 1594665,918 NC021 3173119,269 1589204,672 G100 3185501,994 1594665,918 NC021 3173119,269 1589204,672 G100 3185348,990 1593819,047 A290 317498,084 1588860,138 G110 3184745,705 1593828,387 R7000 317982,526 1594499,010 MT002 3183738,420 1592528,357 R7001 317896,807 159489,010 MT003 3182337,224 1590380,480 NC021 317896,807 1594899,010 MT003 3182321,118 1591688,996 NC021 3178967,996 1594991,356 G120 3183991,004 1588915,918 NC021 317896,996 1594991,356 G115 318361,160 1591411,265 NC021 3178967,996 1594991,356 G115 3183999,004 1588915,918 NC021 317896,996 1599591,596 H100 3181924,899 1598902,441 NC021 317896,996 1599591,596 H100 3181924,899 1598905,594 NC021 317896,897 159589,620 H100 3181924,899 1598905,594 NC021 317896,897 159589,620 H100 3181924,899 1598905,594 NC021 317897,998 1592589,620 H100 318904,699 1598965,779 NC021 317898,999 159908,757 H100 318904,099 15989879,330 NC021 317997,998 159259,799 H100 318904,099 15989879,330 NC021 317997,998 159259,799 H100 318904,099 159908,797 H100 31890						
NC119 3176346, 404 1591616, 409 SN007 3180509, 226 1585548, 769 NC020 3174513, 899 1589644, 1050 F155 317964, 1981 1585681, 703 A280 3175140, 535 1590548, 334 MT000 3185501, 994 1594665, 918 NC021 3173119, 269 1589244, 672 G100 3185301, 994 15934919, 047 A290 3172891, 466 1590123, 429 MT001 3184745, 026 1533643, 206 A300 317406, 084 1588660, 138 G110 3184543, 705 159228, 547 ST000 317952, 526 159499, 010 MT002 3183738, 420 1592554, 750 ST001 3177866, 807 159499, 010 MT002 3183738, 420 1592554, 750 J100 3178746, 657 159499, 010 MT002 3183738, 420 1592554, 750 J100 3178746, 657 159499, 010 MT003 318237, 224 1590380, 480 J100 3178746, 657 159499, 010 MT003 318237, 224 1590380, 480 J100 3176786, 807 159494, 1568 G10 318699, 004 1589075, 918 ST001 317646, 657 159568, 469 G110 317646, 657 159568, 469 G110 317646, 657 159568, 469 G110 317648, 218 1593543, 800 G110 317648, 218 1593543, 800 H100 318529, 894 1598662, 441 J130 317667, 969 1594751, 668 G130 3181999, 004 1589075, 918 ST001 317648, 218 1593543, 314 PW001 318122, 489 1598602, 441 J130 3175576, 945 1593583, 314 PW001 3181024, 609 159425, 279 ST003 317491, 567 159465, 169 159465						
NOCOCO 317451.659 159664.050 P.155 3179864.998 1595081.703 A280 3175140.535 1590548.354 MYTOO 318551.994 159368.1703 NCOCO 317391.456 1590548.722 MYTOO 318554.990 1593819.047 A290 317291.456 159054.702 MYTOO 318554.990 1593819.047 A290 317408.084 158860.138 MYTOO 318736.205 159368.205 A300 317408.084 158860.138 MYTOO 3183736.20 159262.547 BYTOO 317936.807 1594499.010 MYTOO 318337.224 1590380.480 BYTOO 317936.807 1594499.010 MYTOO 318237.224 1590380.480 BYTOO 317936.807 1594499.010 MYTOO 318237.224 1590380.480 BYTOO 3177380.006 159499.100 MYTOO 3182321.118 159168.936 BYTOO 3177380.006 159499.100 MYTOO 3182321.118 159168.936 BYTOO 317667.969 1594751.668 G130 318199.00 1591611.245 BYTOO 317684.218 1595381.580 PROO 3181829.894 1598075.918 BYTOO 317684.218 1595381.314 PROO 3181829.894 1598075.918 BYTOO 317684.218 1595381.314 PROO 3181829.894 1598075.918 BYTOO 317684.218 159548.300 PROO 3181829.894 1598075.75 159806.579 BYTOO 317686.300 PROO 318360.300 1598075.75 159806.579 BYTOO 317686.300 PROO 318360.300 1598075.741 BYTOO 318360.300 1598075.741 BYTOO 318074.900 1598075.75 159806.579 BYTOO 318074.975 159809.777 BYTOO 3180845.22 1598716.279 BYTOO 318074.900 1598075.888 BYTOO 318074.900 1598075.918 1598075.771 BYTOO 318074.900 1598075.918 BYTOO 318074.900 1598075.918 BYTOO 318074.900 1598075.918 BYTOO 318074.900 1598075.751 BYTOO 318074.900 1598075.918 BYTOO 318074.900 15						
A280 3175140.535 1590548.354 MC000 3185501.994 1594665.918 N8021 3172981.456 1590123.429 MC001 3184745.026 1593819.437 A300 3174981.656 1590123.429 MC001 3184747.05 1593481.206 SCOO 3174982.826 1594099.010 MC002 318337.824 159285.4750 BY001 317898.807 1594099.010 MC003 3182337.224 159280.4750 BY010 317898.807 1594099.010 MC003 3182337.224 159280.4750 J100 317898.807 159499.010 MC003 3182321.118 159168.336 J110 3177804.657 159528.469 G130 318399.004 159407.124 J110 31776667.969 1594751.668 G130 318199.004 159407.34 BY101 3176667.969 1595383.314 PM001 318122.894 159807.34 BY103 3175491.6667.969 1595383.314 PM001 318122.894 159808.74 BY103 3175491.6667.969 1594583.314 PM001 318107.56 159407.57 BY103 </td <td></td> <td>3174531.859</td> <td></td> <td></td> <td></td> <td></td>		3174531.859				
NGO21 3173119.269 1589204.672					3185501.994	
A290 317281.456 1590123.429 MP001 3184745.026 1593843.206 A200 317108.084 1588860.138 G110 3184745.026 1592825.4750 S7000 3179952.526 1594499.010 MP002 3183738.420 1592825.4750 S7001 317896.807 159489.010 MP003 318237.224 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.5901 1590380.4801 15903800.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 1590380.4801 159						
A300 317408, 084 158880, 138 G110 3184543,705 159222,525,750 ST000 317992, 1526 1594499, 010 MT003 3182337,224 1590380,480 ST001 317896,807 159429,010 MT003 3182337,224 1590380,480 J110 3177830,006 1594891,338 G115 3183851,160 159411,245 ST002 317667,969 1594751,668 G120 3181999,004 1589075,311 ST011 3176844,218 1593505,800 PM000 3181829,894 1598602,441 J130 3175576,945 1595383,314 PM001 3181024,609 1594825,279 ST003 3174910,846 1594822,060 H115 317890,575 159874,792 J120 3175465,069 1592669,620 H115 3179800,575 159874,792 J140 317462,952 1594085,569 H25 3178326,903 159874,792 J140 317462,952 1594085,569 H25 317826,903 1598752,331 ST0004 3178501,617						
STOOD 3179952,526						
STOOL 3177896.807						
1710						
J110 3177380.006 1594981.358 G115 3183851.160 1591411.245 ST002 317667.969 1594751.668 G130 318199.904 1589075.918 ST101 3176484.218 1593545.800 PW000 3181829.894 1598075.918 ST003 3174910.846 1594832.060 H100 3181624.609 1598455.279 J120 3175485.069 1592569.620 H115 317990.575 1599874.792 J140 317462.952 1594085.569 H25 3178393.193 1591581.956 PW002 3179494.567 1597861.572 J140 317462.952 1594085.569 H25 3178326.903 159669.757 J140 3172051.214 1592822.278 H110 318040.909 159755.571 ST004 3172051.214 1592822.278 H110 318040.909 159755.55.71 J150 3172077.704 1593017.514 BW001 3188933.065 159577.241 ST102 3174083.964 159258.136 BW01 3188933.065 159577.241						
\$\begin{array}{cccccccccccccccccccccccccccccccccccc						
ST101						
J130 3175576,945 1595383,314 PW001 3181024,609 1598425,279 ST003 3174910,846 1594832,060 H100 3181523,886 1599005,084 J120 3175485,069 1592569,620 H115 3179800,575 1599874,792 A275 3175393,193 1591581,956 PW002 3179494,567 1597861,579 J140 317462,952 1594085,569 H125 3178326,903 1598723,234 ST004 3172051,214 1592282,278 H10 318040,903 159669,757 ST005 3172051,214 1592282,278 H110 3180400,903 1597655,571 J150 3172797,704 1593017,514 BW000 318893,065 1596577,241 ST102 3174083,964 1592275,2536 BW001 318893,065 1596577,241 ST102 3174083,964 159258,136 BW002 3188671,911 1599500,527 J155 3173348,959 159208,757 E105 3188345,222 1598716,279 RT000 3180342,205 <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td></td<>						
STOO3						
J120 3175485.069 1592569.620 H115 3179800.575 1599874.792 J275 3175393.193 1591581.956 PW002 3179494.567 1597861.579 J140 3173462.952 1594085.569 H125 3178326.903 1598623.234 ST004 3173601.617 1594453.072 H120 3178326.903 1596669.757 J150 3172797.704 1593017.514 BW000 3189200.837 1599595.230 J160 3171511.444 1592271.024 BW001 3188930.655 1596577.241 J150 31734083.964 1592578.136 BW002 3188071.911 159505.571 J155 3173348.959 1592098.757 E105 3188345.222 1598716.279 RT000 3180342.905 1594247.620 E115 3190422.034 1596467.373 RT001 3180294.275 1592294.463 E128 3190448.261 1596701.694 RT002 3180342.905 1593019.705 E10 3188345.222 1598716.279 RT003 3180650.184						
AZ75 3175393.193 1591581.956 PW002 3179494.567 1597861.579 179404 317462.952 1594085.569 H125 3178326.903 1598723.234 ST004 3173601.617 1594453.072 H120 3178326.903 1598723.234 ST005 3172051.214 1592822.278 H110 3180460.909 1597555.571 J150 3172797.704 1593017.514 BW000 3189200.837 1599595.230 J160 3171511.444 1592271.024 BW001 3188983.065 1596577.241 ST102 3174083.964 1592558.136 BW002 3188671.911 1595500.527 J155 3173348.959 1592098.757 E105 3180342.905 1594247.620 E115 3190422.034 1598467.373 RT001 3180294.275 1594247.620 E115 3190422.034 1598467.373 RT001 3180294.275 1592229.463 E128 3190484.261 1596445.009 I110 3180294.208 1593019.705 E100 3188345.222 1598701.694 I110 3180750.184 1590728.003 E110 3180494.208 1590728.003 E110 3180494.208 1590728.003 E110 3180494.208 1590728.003 E110 3180750.184 1590728.003 E110 3189200.837 1596351.669 RT002 3179686.397 1596253.858 E120 3188104.094 1594834.896 I110 3189408.391 1590728.003 E110 3180750.184 1590728.003 E110 3180750.184 1590728.003 E110 3189404.094 1594834.896 I110 3189408.391 1590918						
J140 3174462.952 1594085.569 H125 3178326.903 159823.234 ST004 3173601.617 1594453.072 H120 3178326.903 159669.757 ST005 3172051.214 1592822.278 H110 3180460.909 1597555.757 J150 3172797.704 1593017.514 BW000 31889200.837 1599595.230 J160 3171511.444 1592271.024 BW001 3188983.065 159677.241 ST102 3174083.964 1592558.136 BW002 3188971.911 1595900.527 J155 3173348.959 1592098.757 E105 3188345.222 1598716.279 RT001 3180294.275 1594247.620 E115 3190422.034 159645.009 RT001 3180294.275 1592294.633 E128 3190484.261 159645.009 I100 3180750.184 15907028.003 E110 3188345.222 1596701.694 I110 3180750.184 1590253.858 E120 3188104.094 1594834.896 I120 318011.912 1589111.047 E124 3189104.094 1594834.896 I155 3186307.280 1599343.304 CT000 3187390.478 1603365.758 F106 3186307.280 1599343.304						
STO04 3173601.617 1594453.072 H120 3178326.903 1596669.757 STO05 3172051.214 1592822.278 H110 3180460.909 1597555.571 J150 3172797.704 1593017.514 BW000 3189200.837 1599559.230 J160 3171511.444 1592271.024 BW001 3188671.911 159559.577.241 ST102 3174083.964 1592558.136 BW002 3188671.911 1595900.527 RT000 3180342.905 1594247.620 E105 3188345.222 1598716.279 RT001 3180294.275 159229.463 E128 3190482.034 1598647.039 RT001 3180829.208 1593019.705 E100 3188345.222 159677.664 I110 3180750.184 1590728.003 E110 3189200.837 1596351.669 RT002 3179686.397 1590253.858 E120 3188104.094 1594834.896 I120 3180111.912 1589111.047 E124 3189410.852 1594551.571 I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 F102 3184596.514 1597121.723 D100 3183464.713 1602465.568 SN001 3184914.981 1595721.62						
ST005 3172051.214 1592822.278 H110 3180460.909 1597555.571 J150 3172797.704 1593017.514 BW000 3189200.837 1599595.230 J160 3171511.444 1592271.024 BW001 3188933.065 1596577.241 ST102 3174083.964 1592558.136 BW002 3188671.911 1595900.527 J155 3173348.959 1592098.757 E105 3188345.222 1598716.279 RT000 3180342.905 1594247.620 E115 3190422.034 1596445.009 RT001 3180294.275 1592229.463 E128 3190484.261 1596445.009 I100 3180829.208 1593019.705 E100 3188345.222 1596701.694 RT002 3179686.397 1590728.003 E110 3189200.837 1596351.669 RT002 3179686.397 1590728.003 E120 3188104.094 159434.896 I120 3180111.912 1589111.047 E124 3189410.852 1594951.571 SN000 3186307.280 15993343.304 CT000 3187300.478 160334.896 F106 3187030.685 1597199.506 D110 3183464.713 1602910.488 F102 3184914.981 1595721.625 </td <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
J150 3172797.704 1593017.514 BW000 3189200.837 1599595.230 J160 3171511.444 1592271.024 BW001 3188983.065 159677.241 ST102 3174083.964 1592558.136 BW002 3188671.911 1595900.527 J155 3173348.959 1592098.757 E105 3188345.222 1598716.279 RT000 3180342.905 1594247.620 E115 3190422.034 1598467.373 RT001 318029.208 1593019.705 E100 3188345.222 1596445.009 I100 3180750.184 1590728.003 E110 3189200.837 1596351.669 RT002 3179686.397 1590253.858 E120 3188104.094 1594834.896 RT002 318011.912 1589111.047 E124 3189410.852 159451.571 I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 SN000 3186307.280 1599343.304 CT000 3187390.478 1603865.758 F106 318790.365 <						
J160 3171511.444 1592271.024 BW001 3188983.065 1596577.241 ST102 3174083.964 1592558.136 BW002 3188671.911 1595900.527 RT000 3180342.905 1592298.757 E105 318345.222 1598716.279 RT001 3180294.275 159229.463 E115 3190422.034 1598467.373 RT001 3180829.208 1593019.705 E100 3188345.222 1596701.694 I110 3180750.184 1590728.003 E110 3188345.222 1596701.694 RT002 3179686.397 1590253.858 E120 3188104.094 1594834.896 I120 3180111.912 1589111.047 E124 3189410.852 1594951.571 I115 3178926.549 1589141.441 CT001 3187390.478 1603865.758 F106 3187030.685 1599343.304 CT000 3187390.478 1603865.758 F106 3187030.685 1597121.723 D100 3183464.713 1602465.568 F102 3184914.981 1595721.625 D105 318477.501 1603466.638 SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592274.346 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
ST102 3174083.964 1592558.136 BW002 3188671.911 1595900.527 J155 3173348.959 1592098.757 E105 3188345.222 1598716.279 RT000 3180342.905 1594247.620 E115 3190422.034 1598467.373 RT001 3180294.275 159229.463 E128 3190484.261 1596445.009 I100 3180829.208 1593019.705 E100 3188345.222 1596701.694 I110 3180750.184 1590728.003 E110 3189200.837 1596351.669 RT002 3179686.397 1590253.858 E120 3188104.094 1594834.896 I120 3180111.912 1589111.047 E124 3189410.852 1594951.571 I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 SN000 3186307.280 1599343.304 CT000 3187390.478 1603865.758 F106 3187030.685 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN00						
J155 3173348.959 1592098.757 E105 3188345.222 1598716.279 RT000 3180342.905 1594247.620 E115 3190422.034 1598467.373 RT001 3180294.275 1592229.463 E128 3190484.261 1596445.009 I100 3180829.208 1593019.705 E100 3188345.222 1596701.694 I110 3180750.184 1590728.003 E110 3189200.837 1596351.669 RT002 3179686.397 1590253.858 E120 3188104.094 1594834.896 I120 3180111.912 1589111.047 E124 3189410.852 1594951.571 I115 3178926.549 1589141.441 CT001 3184771.446 1603034.804 SN000 3186307.280 1599343.304 CT000 3187390.478 1603865.758 F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3186967.613 1592981.551 D120 3184433.069 1607102.374 F100			1592558.136			
RT000 3180342.905 1594247.620 E115 3190422.034 1598467.373 RT001 3180294.275 1592229.463 E128 3190484.261 1596445.009 I100 3180829.208 1593019.705 E100 3188345.222 1596701.694 I110 3180750.184 1590728.003 E110 318920.837 1596351.669 RT002 3179686.397 1590253.858 E120 3188104.094 1594834.896 I120 3180111.912 1589111.047 E124 3189410.852 1594951.571 I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 SN000 3186307.280 1599343.304 CT0000 3187390.478 1603036.575 F106 3187030.685 1597199.506 D110 3183464.713 1602405.568 F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3184727.501 1604238.706 SN00		3173348.959	1592098.757	E105	3188345.222	1598716.279
RT001 3180294.275 1592229.463 E128 3190484.261 1596445.009 I100 3180829.208 1593019.705 E100 3188345.222 1596701.694 I110 3180750.184 1590728.003 E110 3189200.837 1596351.669 RT002 3179686.397 1590253.858 E120 3188104.094 1594834.896 I120 318011.912 1589111.047 E124 3189410.852 1594951.571 I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 SN000 3186307.280 1599343.304 CT000 3187390.478 1603865.758 F106 3187030.685 1597199.506 D110 3183464.713 1602910.488 F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3185555.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100<	RT000	3180342.905	1594247.620		3190422.034	1598467.373
I100 3180829.208 1593019.705 E100 3188345.222 1596701.694 I110 3180750.184 1590728.003 E110 3189200.837 1596351.669 RT002 3179686.397 1590253.858 E120 3188104.094 1594834.896 I120 3180111.912 1589111.047 E124 3189410.852 1594951.571 I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 SN000 3186307.280 1599343.304 CT000 3187390.478 1603910.488 F106 3187030.685 1597199.506 D110 3183464.713 1602910.488 F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3184727.501 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186927.349 1591274.346 SP000 3193378.721 1610469.741		3180294.275	1592229.463		3190484.261	1596445.009
I110 3180750.184 1590728.003 E110 3189200.837 1596351.669 RT002 3179686.397 1590253.858 E120 3188104.094 1594834.896 I120 3180111.912 1589111.047 E124 3189410.852 1594951.571 I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 SN000 3186307.280 1599343.304 CT000 3187390.478 1603865.758 F106 3187030.685 1597199.506 D110 3183464.713 1602910.488 F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1604238.706 SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	I100		1593019.705			
I120 3180111.912 1589111.047 E124 3189410.852 1594951.571 I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 SN000 3186307.280 1599343.304 CT000 3187390.478 1603865.758 F106 3187030.685 1597199.506 D110 3183464.713 1602910.488 F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	I110	3180750.184	1590728.003	E110	3189200.837	1596351.669
I120 3180111.912 1589111.047 E124 3189410.852 1594951.571 I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 SN000 3186307.280 1599343.304 CT000 3187390.478 1603865.758 F106 3187030.685 1597199.506 D110 3183464.713 1602910.488 F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	RT002	3179686.397	1590253.858	E120	3188104.094	1594834.896
I115 3178926.549 1589141.441 CT001 3184871.446 1603034.804 SN000 3186307.280 1599343.304 CT000 3187390.478 1603865.758 F106 3187030.685 1597199.506 D110 3183464.713 1602910.488 F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	I120	3180111.912	1589111.047	E124	3189410.852	1594951.571
SN000 3186307.280 1599343.304 CT000 3187390.478 1603865.758 F106 3187030.685 1597199.506 D110 3183464.713 1602910.488 F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	I115	3178926.549	1589141.441		3184871.446	
F102 3184580.514 1597121.723 D100 3185048.105 1602465.568 F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	SN000	3186307.280	1599343.304	CT000	3187390.478	
F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	F106	3187030.685	1597199.506	D110	3183464.713	1602910.488
F104 3184914.981 1595721.625 D105 3184727.501 1603466.638 SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	F102					
SN001 3185816.056 1595035.028 D115 3185525.740 1604238.706 SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	F104					
SN002 3186967.613 1592981.551 D120 3184433.069 1605102.374 F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	SN001					
F100 3186105.958 1593770.730 D125 3187161.475 1605351.006 SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	SN002					
SN003 3186927.349 1591274.346 SP000 3193378.721 1610469.741	F100					
	SN003					
	F110	3186548.865	1592039.367	SP001	3191378.524	1609929.337

Table B-7 Sample SWMM Input

;; A100-DF	3199916.049	1620821.678	- -
[VERTICES] ;;Link	X-Coord	Y-Coord	
SJ130	3198194.942	1613052.542	
NG220	3188520.098	1604504.431	
NG-OUT	3202809.768		
C125	3188689.458		
	3194441.016		
B140	3197418.101	1609872.638	
SJ004	3197985.086	1610464.822	
B130	3197985.086	1612134.278	
B135	3197229.106	1612468.169	
SJ003	3198158.692	1613331.669	
B120	3197449.600	1614068.326	
SJ002	3198577.270	1614855.805	
B110	3197922.087	1615384.991	
SJ001	3198772.565		
B100	3198457.573		
C100	3192038.238		
C110	3190515.282		
C120	3188269.447		
C115		1610083.738	
SP002	3189160.763	1608399.362	

[BACKDROP]

"P:\12-050.01 Newlin Gulch MDP - UDFCD\1 HYDROLOGY\Baseline\EPA SWMM -

v. 5.0\Input Files\SWMM_Background.jpg"
DIMENSIONS 3159262.493 1580662.582 3213324.993 1624725.082

Table B-8 Sample SWMM Output

EPA STORM WATER MANAGEMENT MODEL - VERSION 5.0 (Build 5.0.021) Newlin Gulch MDP Baseline Hydrology Model Future Development 100-yr no area adjustment *********** NOTE: The summary statistics displayed in this report are based on results found at every computational time step, not just on results from each reporting time step. ************** *********** Analysis Options **** Flow Units CFS Process Models: Rainfall/Runoff NO Snowmelt NO Groundwater NO Flow Routing YES Ponding Allowed NO Water Quality NO Flow Routing Method KINWAVE Starting Date JAN-01-2005 00:00:00 Ending Date JAN-10-2005 00:00:00 Antecedent Dry Days 0.0 Report Time Step 00:15:00 Routing Time Step 30.00 sec **** Volume Volume Flow Routing Continuity acre-feet 10^6 gal ****** 0.000 0.000 Dry Weather Inflow Wet Weather Inflow 0.000 0.000 Groundwater Inflow 0.000 0.000 RDII Inflow 0.000 0.000 External Inflow 1487.422 484.699 External Outflow 1511.396 492.511 0.000 0.000 Internal Outflow 0.000 Storage Losses 0.000 Initial Stored Volume 0.000 0.000 0.038 Final Stored Volume 0.116 Continuity Error (%) -1.620

******** Highest Flow Instability Indexes ******* Link SJ130-OUT (3) Link B12 (3) Link B11 (3) Link SJ-OUT (3) Link B10 (3) ****** Routing Time Step Summary ****** Minimum Time Step 30.00 sec 30.00 sec Average Time Step Maximum Time Step 30.00 sec Percent in Steady State 0.00 Average Iterations per Step: 1.00 ***** Node Depth Summary

Node	Туре	Average Depth Feet	Maximum Depth Feet		Occu	of Max rrence hr:min
NG001	JUNCTION	0.38	5.89	5807.89	0	01:25
A100	JUNCTION	0.00	0.00	5767.00	0	00:00
NG000	JUNCTION	0.25	3.95	5769.95	0	01:31
A104	JUNCTION	0.00	0.00	5803.00	0	00:00
A108	JUNCTION	0.00	0.00	5767.00	0	00:00
A110	JUNCTION	0.00	0.00	5815.00	0	00:00
NG002	JUNCTION	0.47	6.42	5820.42	0	01:23
SJ000	JUNCTION	0.03	2.81	5820.81	0	01:00
NG003	JUNCTION	0.46	6.44	5838.44	0	01:18
A115	JUNCTION	0.01	2.48	5848.48	0	00:39
A120	JUNCTION	0.00	0.00	5833.00	0	00:00
A125	JUNCTION	0.01	1.67	5875.67	0	00:41
NG004	JUNCTION	0.44	6.13	5866.13	0	01:11
A130	JUNCTION	0.00	0.00	5861.00	0	00:00
NG005	JUNCTION	0.31	4.36	5871.86	0	01:09
A135	JUNCTION	0.00	0.00	5868.50	0	00:00
A140	JUNCTION	0.00	0.00	5868.50	0	00:00

Table B-8 Sample SWMM Output

NG006	JUNCTION	0.27	3.60	5905.60	0	01:05	ST001	JUNCTION	0.02	3.23	6297.23	0	00:49
A145	JUNCTION	0.00	0.00	5903.00	0		J100	JUNCTION	0.00	0.00	6252.00	0	00:00
A155	JUNCTION	0.00	0.00	5903.00	0		J110	JUNCTION	0.00	0.00	6295.00	0	00:00
A150	JUNCTION	0.00	0.00	5903.00	0		ST002		0.02	2.85	6327.85	0	00:58
NG005.5	JUNCTION	0.27	3.60	5904.60	0		ST1012		0.01	1.50	6346.50	0	00:45
NG007	JUNCTION	0.25	3.13	5927.63	0		J130	JUNCTION	0.00	0.00	6326.00	0	00:00
A165	JUNCTION	0.00	0.00	5925.50	0		ST003		0.02	2.88	6365.88	0	00:51
NG008	JUNCTION	0.25	2.91	5940.91	0		J120	JUNCTION	0.00	0.00	6346.00	0	00:00
A170	JUNCTION	0.00	0.00	5939.00	0		A275	JUNCTION	0.00	0.00	6396.00	0	00:00
NG009	JUNCTION	0.28	2.54	5950.54	0		J140	JUNCTION	0.00	0.00	6364.00	0	00:00
A175	JUNCTION	0.00	0.00	5939.00	0		ST004		0.02	2.17	6399.17	0	00:51
A180	JUNCTION	0.00	0.00	5949.00	0		ST005		0.01	1.29	6472.29	0	00:45
NG011	JUNCTION	0.16	1.47	5993.47	0		J150	JUNCTION	0.00	0.00	6398.00	0	00:00
NG010	JUNCTION	0.28	2.54	5966.54	0		J160	JUNCTION	0.00	0.00	6472.00	0	00:00
A200	JUNCTION	0.00	0.00	5965.00	0		ST102		0.00	1.00	6429.00	0	00:38
A190	JUNCTION	0.00	0.00	5965.00	0		J155	JUNCTION	0.00	0.00	6429.00	0	00:00
A210	JUNCTION	0.00	0.00	5993.00	0		RT000		0.02	2.08	6253.08	0	01:07
A205	JUNCTION	0.00	0.00	5993.00	0		RT001		0.02	2.12	6299.12	0	00:56
NG012	JUNCTION	0.08	0.80	6217.30	0		I100	JUNCTION	0.00	0.00	6252.00	0	00:00
A220	JUNCTION	0.00	0.00	6217.00	0		I110	JUNCTION	0.00	0.00	6298.00	0	00:00
NG013	JUNCTION	0.00	0.00	6217.00	0		RT002		0.01	1.48	6361.48	0	00:51
A221	JUNCTION	0.00	0.00	6218.00	0		I120	JUNCTION	0.00	0.00	6361.00	0	00:00
A222	JUNCTION	0.00	0.00	6218.00	0		I115	JUNCTION	0.00	0.00	6361.00	0	00:00
A223	JUNCTION	0.00	0.00	6218.00	0		SNOO		0.00	0.00	6218.00	0	00:00
A224	JUNCTION	0.00	0.00	6218.00	0		F106	JUNCTION	0.00	0.00	6219.00	0	00:00
A225	JUNCTION	0.00	0.00	6218.00	0		F102	JUNCTION	0.00	0.00	6219.00	0	00:00
A226	JUNCTION	0.00	0.00	6218.00	0		F104	JUNCTION	0.00	0.00	6219.00	0	00:00
A227	JUNCTION	0.00	0.00	6218.00	0		SN001		0.03	2.68	6221.68	0	01:28
A228	JUNCTION	0.00	0.00	6218.00	0		SN002		0.03	3.06	6267.06	0	01:22
NG014	JUNCTION	0.04	4.22	6222.22	0		F100	JUNCTION	0.00	0.00	6220.00	0	00:00
A230	JUNCTION	0.00	0.00	6219.00	0		SN003		0.03	3.07	6297.07	0	01:16
NG015	JUNCTION	0.04	4.47	6239.47	0	01:02	F110	JUNCTION	0.00	0.00	6265.00	0	00:00
A240	JUNCTION	0.00	0.00	6236.00	0	00:00	SN004	JUNCTION	0.03	2.90	6337.90	0	01:13
NG016	JUNCTION	0.04	4.48	6254.48	0	00:58	F120	JUNCTION	0.00	0.00	6295.00	0	00:00
NG017	JUNCTION	0.02	2.99	6297.99	0	00:51	F125	JUNCTION	0.00	0.00	6336.00	0	00:00
A250	JUNCTION	0.00	0.00	6251.00	0	00:00	F130	JUNCTION	0.00	0.00	6336.00	0	00:00
A260	JUNCTION	0.00	0.00	6296.00	0	00:00	SN005	JUNCTION	0.02	2.95	6379.95	0	01:01
NG018	JUNCTION	0.02	2.64	6335.64	0	00:41	F140	JUNCTION	0.00	0.00	6378.00	0	00:00
A270	JUNCTION	0.00	0.00	6334.00	0	00:00	SN006	JUNCTION	0.02	2.87	6417.87	0	00:51
NG019	JUNCTION	0.02	2.15	6382.15	0	00:38	F145	JUNCTION	0.00	0.00	6416.00	0	00:00
NG119	JUNCTION	0.00	1.23	6396.23	0	00:35	F150	JUNCTION	0.00	0.00	6416.00	0	00:00
NG020	JUNCTION	0.02	2.09	6412.09	0	00:52	SN007	JUNCTION	0.01	1.88	6471.88	0	00:42
A280	JUNCTION	0.00	0.00	6381.00	0	00:00	F155	JUNCTION	0.00	0.00	6471.00	0	00:00
NG021	JUNCTION	0.01	1.03	6451.03	0	00:53	MTOOC) JUNCTION	0.02	2.31	6222.31	0	01:09
A290	JUNCTION	0.00	0.00	6411.00	0	00:00	G100	JUNCTION	0.00	0.00	6221.00	0	00:00
A300	JUNCTION	0.00	0.00	6451.00	0	00:00	MT001	JUNCTION	0.02	2.33	6250.33	0	01:01
ST000	JUNCTION	0.02	3.21	6254.21	0	00:55	G110	JUNCTION	0.00	0.00	6249.00	0	00:00

Table B-8 Sample SWMM Output

MT002	JUNCTION	0.02	2.21	6287.21	0	00:55
MT003	JUNCTION	0.01	1.49	6355.49	0	00:48
G120	JUNCTION	0.00	0.00	6286.00	0	00:00
G115	JUNCTION	0.00	0.00	6286.00	0	00:00
G130	JUNCTION	0.00	0.00	6355.00	0	00:00
PW000	JUNCTION	0.01	2.61	6220.61	0	00:45
PW001	JUNCTION	0.01	2.61	6230.61	0	00:43
Н100	JUNCTION	0.00	0.00	6219.00	0	00:00
Н115	JUNCTION	0.00	0.00	6229.00	0	00:00
PW002	JUNCTION	0.01	2.51	6279.51	0	00:38
H125	JUNCTION	0.00	0.00	6278.00	0	00:00
H120	JUNCTION	0.00	0.00	6278.00	0	00:00
H110	JUNCTION	0.00	0.00	6229.00	0	00:00
BW000	JUNCTION	0.00	0.00	6218.00	0	00:00
BW000	JUNCTION	0.00	1.94	6220.94	0	00:50
BW001	JUNCTION	0.01	1.94	6236.94	0	00:30
E105	JUNCTION	0.00	0.00	6219.00	0	00:47
E105	JUNCTION	0.00	0.00	6219.00	0	00:00
E113	JUNCTION	0.00	0.00	6219.00	0	00:00
				6220.00		00:00
E100	JUNCTION	0.00	0.00		0	
E110	JUNCTION	0.00	0.00	6220.00	0	00:00
E120	JUNCTION	0.00	0.00	6236.00	0	00:00
E124	JUNCTION	0.00	0.00	6236.00	0	00:00
CT001	JUNCTION	0.00	0.00	6219.00	0	00:00
CT000	JUNCTION	0.00	0.00	6218.00	0	00:00
D110	JUNCTION	0.00	0.00	6220.00	0	00:00
D100	JUNCTION	0.00	0.00	6220.00	0	00:00
D105	JUNCTION	0.00	0.00	6220.00	0	00:00
D115	JUNCTION	0.00	0.00	6219.00	0	00:00
D120	JUNCTION	0.00	0.00	6219.00	0	00:00
D125	JUNCTION	0.00	0.00	6219.00	0	00:00
SP000	JUNCTION	0.03	3.35	5951.35	0	01:01
SP001	JUNCTION	0.03	3.37	5981.37	0	00:55
SP002	JUNCTION	0.02	2.32	6074.32	0	00:52
C115	JUNCTION	0.00	1.11	6013.11	0	00:38
C120	JUNCTION	0.00	0.00	6073.00	0	00:00
C110	JUNCTION	0.00	0.00	5979.00	0	00:00
C100	JUNCTION	0.00	0.00	5949.00	0	00:00
B100	JUNCTION	0.00	0.00	5819.00	0	00:00
SJ001	JUNCTION	0.03	2.89	5876.89	0	00:48
B110	JUNCTION	0.00	0.00	5875.00	0	00:00
SJ002	JUNCTION	0.03	2.55	5886.55	0	01:07
B120	JUNCTION	0.00	0.00	5885.00	0	00:00
SJ003	JUNCTION	0.02	2.27	5905.47	0	01:09
B135	JUNCTION	0.00	0.00	5921.00	0	00:00
B130	JUNCTION	0.00	0.00	5921.00	0	00:00
SJ004	JUNCTION	0.01	1.93	5971.93	0	00:37

B140	JUNCTION	0.00	0.00	5971.00	0	00:00
A160	JUNCTION	0.00	0.00	5925.50	0	00:00
C125	JUNCTION	0.00	0.00	6073.00	0	00:00
NG-OUT	OUTFALL	0.00	0.00	5765.00	0	00:00
NG220	STORAGE	0.06	0.77	6217.47	0	02:43
SJ130	STORAGE	0.08	9.76	5928.46	0	01:09

Table B-8 Sample SWMM Output

		Maximum	Maximum			Lateral	Total
		Lateral	Total	Time	of Max	Inflow	Inflow
		Inflow	Inflow	Occu	ırrence	Volume	Volume
Node	Type	CFS	CFS	days	hr:min	10^6 gal	10^6 gal
NG001	JUNCTION	0.00	3450.18	0	01:24	0.000	484.101
A100	JUNCTION	168.16	168.16	0	00:45	4.037	4.037
NG000	JUNCTION	0.00	3538.53	0	01:30	0.000	492.474
A104	JUNCTION	38.27	38.27	0	00:44	0.920	0.920
A108	JUNCTION	159.51	159.51	0	00:44	3.751	3.751
A110	JUNCTION	236.01	236.01	0	00:35	3.269	3.269
NG002	JUNCTION	0.00	3442.67	0	01:21	0.000	483.085
SJ000	JUNCTION	0.00	757.65	0	00:58	0.000	28.595
NG003	JUNCTION	0.00	2824.63	0	01:18	0.000	451.039
A115	JUNCTION	214.82	214.82	0	00:39	4.083	4.083
A120	JUNCTION	281.77	281.77	0	00:43	6.184	6.184
A125	JUNCTION	160.69	160.69	0	00:41	3.299	3.299
NG004	JUNCTION	0.00	2659.53	0	01:11	0.000	440.055
A130	JUNCTION	188.29	188.29	0	00:39	3.423	3.423
NG005	JUNCTION	0.00	2493.25	0	01:09	0.000	433.233
A135	JUNCTION	319.78	319.78	0	00:40	5.618	5.618
A140	JUNCTION	165.99	165.99	0	00:41	3.459	3.459
NG006	JUNCTION	0.00	2243.61	0	01:05	0.000	421.270
A145	JUNCTION	172.39	172.39	0	00:35	2.503	2.503
A155	JUNCTION	217.92	217.92	0	00:35	2.980	2.980
A150	JUNCTION	230.85	230.85	0	00:46	5.896	5.896
NG005.5	JUNCTION	0.00	2291.41	0	01:04	0.000	423.774
NG007	JUNCTION	0.00	2018.62	0	01:00	0.000	412.210
A165	JUNCTION	498.01	498.01	0	00:38	7.852	7.852
NG008	JUNCTION	0.00	1780.36	0	00:58	0.000	403.010
A170	JUNCTION	230.01	230.01	0	00:41	4.693	4.693
NG009	JUNCTION	0.00	1028.95	0	02:39	0.000	371.987
A175	JUNCTION	199.40	199.40	0	00:38	3.269	3.269
A180	JUNCTION	301.77	301.77	0	00:41	5.918	5.918
NG011	JUNCTION	0.00	1014.56	0	02:45	0.000	357.029
NG010	JUNCTION	0.00	1027.45	0	02:37	0.000	365.999
A200	JUNCTION	204.52	204.52	0	00:46	5.601	5.601
A190	JUNCTION	93.98	93.98	0	00:51	3.060	3.060
A210	JUNCTION	243.70	243.70	0	00:49	6.792	6.792
A205	JUNCTION	84.60	84.60	0	00:55	3.040	3.040
NG012	JUNCTION	0.00	999.29	0	02:43	0.000	346.741
A220	JUNCTION	2957.75	2957.75	0	01:07	88.127	88.127

Table B-8 Sample SWMM Output

NG013	JUNCTION	0.00	7648.84	0	00:57	0.000	258.664
A221	JUNCTION	58.31	58.31	0	00:37	0.846	0.846
A222	JUNCTION	393.32	393.32	0	00:36	5.378	5.378
A223	JUNCTION	140.08	140.08	0	00:36	1.843	1.843
A224	JUNCTION	72.34	72.34	0	00:30	1.459	1.459
A225	JUNCTION	137.18	137.18	0	00:41	2.954	2.954
A226	JUNCTION	176.66	176.66	0	00:45	4.157	4.157
A227	JUNCTION	300.10	300.10	0	00:45	4.355	4.355
A228		159.69	159.69	0	00:30	1.847	1.847
	JUNCTION			-	00:32		
NG014	JUNCTION	0.00	3255.89	0		0.000	101.077
A230	JUNCTION	390.42	390.42	0	00:36	5.788	5.788
NG015	JUNCTION	0.00	3115.67	0	01:01	0.000	95.234
A240	JUNCTION	451.78	451.78	0	00:36	6.747	6.747
NG016	JUNCTION	0.00	2952.78	0	00:58	0.000	88.405
NG017	JUNCTION	0.00	1028.47	0	00:51	0.000	29.020
A250	JUNCTION	107.06	107.06	0	00:48	3.198	3.198
A260	JUNCTION	147.85	147.85	0	00:48	4.255	4.255
NG018	JUNCTION	0.00	932.83	0	00:41	0.000	24.495
A270	JUNCTION	278.64	278.64	0	00:40	5.467	5.467
NG019	JUNCTION	0.00	514.44	0	00:38	0.000	16.556
NG119	JUNCTION	0.00	166.58	0	00:35	0.000	2.400
NG020	JUNCTION	0.00	351.54	0	00:52	0.000	10.307
A280	JUNCTION	484.76	484.76	0	00:34	6.181	6.181
NG021	JUNCTION	0.00	152.09	0	00:53	0.000	4.882
A290	JUNCTION	237.25	237.25	0	00:42	5.377	5.377
A300	JUNCTION	152.09	152.09	0	00:53	4.882	4.882
ST000	JUNCTION	0.00	1427.27	0	00:52	0.000	39.219
ST001	JUNCTION	0.00	1244.02	0	00:49	0.000	34.052
J100	JUNCTION	304.93	304.93	0	00:37	5.040	5.040
J110	JUNCTION	200.11	200.11	0	00:40	3.962	3.962
ST002	JUNCTION	0.00	659.36	0	00:45	0.000	20.359
ST101	JUNCTION	0.00	418.87	0	00:45	0.000	9.630
J130	JUNCTION	590.31	590.31	0	00:33	7.039	7.039
ST003	JUNCTION	0.00	491.30	0	00:51	0.000	13.251
J120	JUNCTION	340.70	340.70	0	00:39	6.317	6.317
A275	JUNCTION	166.58	166.58	0	00:35	2.400	2.400
J140	JUNCTION	252.76	252.76	0	00:38	4.348	4.348
ST004	JUNCTION	0.00	325.66	0		0.000	8.875
ST005	JUNCTION	0.00	161.08	0	00:45	0.000	4.296
J150	JUNCTION	216.40	216.40	0	00:40	4.481	4.481
J160	JUNCTION	161.08	161.08	0	00:45	4.296	4.296
ST102		0.00	175.20				3.052
J155	JUNCTION	175.20	175.20	0	00:38 00:38	0.000 3.052	3.052
RT000	JUNCTION	0.00		0	00:38		
	JUNCTION		503.71	0		0.000	16.546
RT001	JUNCTION	0.00	398.85	0	00:56	0.000	12.581
I100	JUNCTION	156.77	156.77	0	00:43	3.790	3.790
I110	JUNCTION	223.17	223.17	0	00:45	5.874	5.874

Table B-8 Sample SWMM Output

RT002	JUNCTION	0.00	207.96	0	00:51	0.000	6.590
I120	JUNCTION	81.60	81.60	0	00:54	2.879	2.879
I115	JUNCTION	127.87	127.87	0	00:49	3.711	3.711
SN000	JUNCTION	0.00	1706.88	0	01:18	0.000	74.027
F106	JUNCTION	229.46	229.46	0	00:38	3.929	3.929
F102	JUNCTION	119.39	119.39	0	00:40	2.305	2.305
F104	JUNCTION	372.68	372.68	0	00:36	5.426	5.426
SN001	JUNCTION	0.00	1563.88	0	01:22	0.000	62.367
SN002	JUNCTION	0.00	963.51	0	01:20	0.000	37.148
F100	JUNCTION	149.78	149.78	0	00:55	5.482	5.482
SN003	JUNCTION	0.00	882.28	0	01:16	0.000	32.001
F110	JUNCTION	249.58	249.58	0	00:40	5.056	5.056
SN004	JUNCTION	0.00	778.56	0	01:10	0.000	25.936
F120	JUNCTION	255.31	255.31	0	00:42	5.779	5.779
F125	JUNCTION	133.06	133.06	0	00:45	3.524	3.524
F130	JUNCTION	121.48	121.48	0	00:51	3.880	3.880
SN005	JUNCTION	0.00	598.39	0	01:01	0.000	18.349
F140	JUNCTION	164.71	164.71	0	00:51	5.211	5.211
SN006	JUNCTION	0.00	465.13	0	00:51	0.000	12.959
F145	JUNCTION	123.12	123.12	0	00:50	3.846	3.846
F150	JUNCTION	127.15	127.15	0	00:51	4.036	4.036
SN007	JUNCTION	0.00	230.22	0	00:42	0.000	4.951
F155	JUNCTION	230.22	230.22	0	00:42	4.951	4.951
MT000	JUNCTION	0.00	597.93	0	01:08	0.000	19.455
G100	JUNCTION	97.93	97.93	0	00:47	2.859	2.859
MT001	JUNCTION	0.00	523.89	0	01:01	0.000	16.483
G110	JUNCTION	147.92	147.92	0	00:45	3.853	3.853
MT002	JUNCTION	0.00	406.05	0	00:55	0.000	12.527
MT003	JUNCTION	0.00	165.26	0	00:48	0.000	4.700
G120	JUNCTION	166.04	166.04	0	00:43	3.920	3.920
G115	JUNCTION	125.05	125.05	0	00:48	3.751	3.751
G130	JUNCTION	165.26	165.26	0	00:48	4.700	4.700
PW000	JUNCTION	0.00	1120.96	0	00:45	0.000	22.934
PW001	JUNCTION	0.00	1046.06	0	00:43	0.000	21.457
H100	JUNCTION	93.48	93.48	0	00:36	1.460	1.460
Н115	JUNCTION	150.38	150.38	0	00:49	4.472	4.472
PW002	JUNCTION	0.00	665.92	0	00:38	0.000	11.777
H125	JUNCTION	238.37	238.37	0	00:41	5.201	5.201
H120	JUNCTION	444.33	444.33	0	00:36	6.576	6.576
H110	JUNCTION	324.93	324.93	0	00:37	5.126	5.126
BW000	JUNCTION	0.00	955.89	0	00:45	0.000	22.961
BW001	JUNCTION	0.00	536.24	0	00:47	0.000	13.641
BW002	JUNCTION	0.00	322.59	0	00:47	0.000	8.887
E105	JUNCTION	129.93	129.93	0	00:38	2.040	2.040
E115	JUNCTION	125.91	125.91	0	00:37	1.888	1.888
E128	JUNCTION	199.53	199.53	0	00:47	5.392	5.392
E100	JUNCTION	172.69	172.69	0	00:41	3.714	3.714

Table B-8 Sample SWMM Output

E110	JUNCTION	58.25	58.25	0	00:38	1.034	1.034
E120	JUNCTION	230.98	230.98	0	00:43	5.620	5.620
E124	JUNCTION	99.45	99.45	0	00:53	3.267	3.267
CT001	JUNCTION	0.00	313.01	0	00:45	0.000	8.233
CT000	JUNCTION	0.00	683.71	0	00:41	0.000	14.825
D110	JUNCTION	160.59	160.59	0	00:50	5.064	5.064
D100	JUNCTION	127.44	127.44	0	00:39	2.260	2.260
D105	JUNCTION	38.60	38.60	0	00:43	0.909	0.909
D115	JUNCTION	66.07	66.07	0	00:41	1.327	1.327
D120	JUNCTION	213.54	213.54	0	00:38	3.520	3.520
D125	JUNCTION	106.58	106.58	0	00:38	1.745	1.745
SP000	JUNCTION	0.00	763.03	0	00:59	0.000	23.040
SP001	JUNCTION	0.00	643.64	0	00:55	0.000	19.199
SP002	JUNCTION	0.00	275.83	0	00:52	0.000	9.198
C115	JUNCTION	194.52	194.52	0	00:38	3.540	3.540
C120	JUNCTION	194.75	194.75	0	00:51	6.279	6.279
C110	JUNCTION	274.99	274.99	0	00:42	6.164	6.164
C100	JUNCTION	183.63	183.63	0	00:41	3.729	3.729
B100	JUNCTION	197.39	197.39	0	00:43	4.380	4.380
SJ001	JUNCTION	0.00	637.40	0	00:48	0.000	23.951
B110	JUNCTION	291.58	291.58	0	00:42	6.182	6.182
SJ002	JUNCTION	0.00	382.84	0	01:07	0.000	17.710
B120	JUNCTION	338.85	338.85	0	00:36	4.919	4.919
SJ003	JUNCTION	0.00	321.36	0	01:09	0.000	12.714
B135	JUNCTION	346.08	346.08	0	00:37	5.358	5.358
B130	JUNCTION	223.83	223.83	0	00:38	3.761	3.761
SJ004	JUNCTION	0.00	214.46	0	00:37	0.000	3.379
B140	JUNCTION	214.46	214.46	0	00:37	3.379	3.379
A160	JUNCTION	37.90	37.90	0	00:51	1.230	1.230
C125	JUNCTION	82.11	82.11	0	00:55	2.918	2.918
NG-OUT	OUTFALL	0.00	3538.53	0	01:30	0.000	492.474
NG220	STORAGE	0.00	10361.85	0	01:03	0.000	346.791
SJ130	STORAGE	0.00	644.40	0	00:41	0.000	12.716

Table B-8 Sample SWMM Output

***** Node Surcharge Summary *****

Surcharging occurs	when water	rises above t	the top of the l	nighest conduit
				Min. Depth
Node	Type	Hours Surcharged	Above Crown Feet	Below Rim Feet
A100	JUNCTION	216.01	0.000	0.000
A104	JUNCTION	216.01	0.000	0.000
A108	JUNCTION	216.01	0.000	0.000
A110	JUNCTION	216.01	0.000	0.000
A120	JUNCTION	216.01	0.000	0.000
A130	JUNCTION	216.01	0.000	0.000
A135	JUNCTION	216.01	0.000	0.000
A140	JUNCTION	216.01	0.000	0.000
A145	JUNCTION	216.01	0.000	0.000
A155	JUNCTION	216.01	0.000	0.000
A150	JUNCTION	216.01	0.000	0.000
A165	JUNCTION	216.01	0.000	0.000
A170	JUNCTION	216.01	0.000	0.000
A175	JUNCTION	216.01	0.000	0.000
1180	JUNCTION	216.01	0.000	0.000
A200	JUNCTION	216.01	0.000	0.000
A190	JUNCTION	216.01	0.000	0.000
A210	JUNCTION	216.01	0.000	0.000
A205	JUNCTION	216.01	0.000	0.000
A220	JUNCTION	216.01	0.000	0.000
NG013	JUNCTION	216.01	0.000	0.000
A221	JUNCTION	216.01	0.000	0.000
A222	JUNCTION	216.01	0.000	0.000
A223	JUNCTION	216.01	0.000	0.000
A224	JUNCTION	216.01	0.000	0.000
A225	JUNCTION	216.01	0.000	0.000
A226	JUNCTION	216.01	0.000	0.000
A227	JUNCTION	216.01	0.000	0.000
A228	JUNCTION	216.01	0.000	0.000
A230	JUNCTION	216.01	0.000	0.000
A240	JUNCTION	216.01	0.000	0.000
A250	JUNCTION	216.01	0.000	0.000
A260	JUNCTION	216.01	0.000	0.000
A270	JUNCTION	216.01	0.000	0.000
A280	JUNCTION	216.01	0.000	0.000
A290	JUNCTION	216.01	0.000	0.000
A300	JUNCTION	216.01	0.000	0.000

J100	JUNCTION	216.01	0.000	0.000
J110	JUNCTION	216.01	0.000	0.000
J130	JUNCTION	216.01	0.000	0.000
J120	JUNCTION	216.01	0.000	0.000
A275	JUNCTION	216.01	0.000	0.000
J140	JUNCTION	216.01	0.000	0.000
J150	JUNCTION	216.01	0.000	0.000
J160	JUNCTION	216.01	0.000	0.000
J155	JUNCTION	216.01	0.000	0.000
I100	JUNCTION	216.01	0.000	0.000
I110	JUNCTION	216.01	0.000	0.000
I120	JUNCTION	216.01	0.000	0.000
I115	JUNCTION	216.01	0.000	0.000
SN000		216.01	0.000	0.000
	JUNCTION			
F106	JUNCTION	216.01	0.000	0.000
F102	JUNCTION	216.01	0.000	0.000
F104	JUNCTION	216.01	0.000	0.000
F100	JUNCTION	216.01	0.000	0.000
F110	JUNCTION	216.01	0.000	0.000
F120	JUNCTION	216.01	0.000	0.000
F125	JUNCTION	216.01	0.000	0.000
F130	JUNCTION	216.01	0.000	0.000
F140	JUNCTION	216.01	0.000	0.000
F145	JUNCTION	216.01	0.000	0.000
F150	JUNCTION	216.01	0.000	0.000
F155	JUNCTION	216.01	0.000	0.000
G100	JUNCTION	216.01	0.000	0.000
G110	JUNCTION	216.01	0.000	0.000
G120	JUNCTION	216.01	0.000	0.000
G115	JUNCTION	216.01	0.000	0.000
G130	JUNCTION	216.01	0.000	0.000
H100	JUNCTION	216.01	0.000	0.000
H115	JUNCTION	216.01	0.000	0.000
H125	JUNCTION	216.01	0.000	0.000
Н120	JUNCTION	216.01	0.000	0.000
H110	JUNCTION	216.01	0.000	0.000
BW000	JUNCTION	216.01	0.000	0.000
E105	JUNCTION	216.01	0.000	0.000
E115	JUNCTION	216.01	0.000	0.000
E128	JUNCTION	216.01	0.000	0.000
E100	JUNCTION	216.01	0.000	0.000
E110	JUNCTION	216.01	0.000	0.000
E120	JUNCTION	216.01	0.000	0.000
E124	JUNCTION	216.01	0.000	0.000
CT001	JUNCTION	216.01	0.000	0.000
CT000	JUNCTION	216.01	0.000	0.000
D110	JUNCTION	216.01	0.000	0.000
D110	OUNCITON	210.01	0.000	0.000

Table B-8 Sample SWMM Output

D100	JUNCTION	216.01	0.000	0.00	0	Outfall Loading Sum	marv					
D105	JUNCTION	216.01	0.000	0.00		******						
D115	JUNCTION	216.01	0.000	0.00								
D120	JUNCTION	216.01	0.000	0.00								
D125	JUNCTION	216.01	0.000	0.00			Flow	Avg.	Max.	Total		
C120	JUNCTION	216.01	0.000	0.00			Freq.	Flow	Flow	Volume		
C110	JUNCTION	216.01	0.000	0.00	0	Outfall Node	Pcnt.	CFS	CFS	10^6 gal		
C100	JUNCTION	216.01	0.000	0.00								
B100	JUNCTION	216.01	0.000	0.00	0	NG-OUT	91.89	92.14	3538.53	492.474		
B110	JUNCTION	216.01	0.000	0.00	0							
B120	JUNCTION	216.01	0.000	0.00	0	System	91.89	92.14	3538.53	492.474		
B135	JUNCTION	216.01	0.000	0.00	0	_						
B130	JUNCTION	216.01	0.000	0.00	0							
B140	JUNCTION	216.01	0.000	0.00	0	**********	*					
A160	JUNCTION	216.01	0.000	0.00	0	Link Flow Summary						
C125	JUNCTION	216.01	0.000	0.00	0	**********	*					
NG220	STORAGE	216.01	0.772	7.22	8							
									Time of Max		Max/	Max/
******								Flow	Occurrence		Full	Full
Node Flooding Summar						Link	Type	CFS	days hr:mir	ft/sec	Flow	Depth
*****	* *					A10	CONDITE	3422.70	0 01:31	5.70	0 00	0.26
No nodes were floode	- d					A10.4	CONDUIT	3422.70	0 01:31 0 01:25		0.09 0.16	0.20
no nodes were rioode	ea.					A10.4 A100-DF	CONDUIT		0 00:45		0.10	0.39
						A100-DF A104-DF	DUMMY	168.16	0 00:44			
**********	+++					A104-DF A108-DF	DUMMY	38.27 159.51	0 00:44			
						A108-DF A11	DUMMY	2807.68	0 01:23		0.18	0.43
Storage Volume Summa	_					Allo-DF	CONDUIT	236.01	0 00:35		0.10	0.43
							DUMMY				0 04	0.25
						A115 A12	CONDUIT	211.07 2609.65	0 00:43 0 01:19		0.04 0.38	0.25 0.60
						A12 A14	CONDUIT CONDUIT	2009.03	0 01:13		0.30	0.80
	Attornago	Ava E&I	Maximum	Max	Time of	A14 A14.5	CONDUIT	2243.62	0 01:05		0.14	0.34
Max Maximum	Average	Avg E&I	Maximum	Max	TIME OI	A14.5 A120-DF	DUMMY	281.77	0 00:43		0.10	0.30
MAXIMUM	Volume	Pcnt Pcnt	Volume	Pcnt		A125	CONDUIT	157.93	0 00:45		0.02	0.17
Occurrence Outflow		FCIIC FCIIC	VOIUME	FCIIC		A13	CONDUIT	2487.89	0 01:12			0.17
Storage Unit	1000 ft3	Full Loss	1000 ft3	Full	days	A130-DF	DUMMY	188.29	0 00:39		0.22	0.44
hr:min CFS	1000 103	rull LOSS	1000 103	rull	uays	A135 DF A135-DF	DUMMY	319.78	0 00:40			
						A140-DF	DUMMY	165.99	0 00:41			
						A145-DF	DUMMY	172.39	0 00:35			
NG220	2952.271	1 0	39166.232	9	0	A15	CONDUIT	2006.08	0 01:05		0.12	0.31
02:43 999.29	2332.271	1 0	33100.232	J	O	A150-DF	DUMMY	230.85	0 00:46		0.12	0.51
SJ130	3.991	0 0	705.859	0	0	A155-DF	DUMMY	217.92	0 00:35			
01:08 321.36	J • J J ±	0 0	100.009	O	V	A16	CONDUIT	1769.15	0 01:03		0.09	0.29
521.50						A160-DF	DUMMY	37.90	0 00:51		0.00	0.23
						A165-DF	DUMMY	498.01	0 00:38			
******	* * * *					A17	CONDUIT	1028.90	0 02:41		0.06	0.21
						777 /	COMPOTI	1020.70	0 02.41	. 7.50	0.00	0.21

Table B-8 Sample SWMM Output

A170-DF	DUMMY	230.01	\cap	00:41				BW-OUT	DUMMY	955.89	0	00:45			
A175-DF	DUMMY	199.40		00:38				C10	CONDUIT	636.12	0	01:01	4.44	0.11	0.33
A180-DF	DUMMY	301.77		00:41				C100-DF	DUMMY	183.63	0	00:41	1.11	0.11	0.33
A19	CONDUIT	1027.27	0	02:41	4.49	0.09	0.25	C11	CONDUIT	264.43	0	01:04	4.13	0.05	0.23
A190-DF	DUMMY	93.98	0	00:51	1.15	0.03	0.20	C11.5	CONDUIT	176.06	0	00:50	2.31	0.01	0.10
A20	CONDUIT	1014.36	0	02:52	3.54	0.03	0.15	C110-DF	DUMMY	274.99	0	00:42	2.01	0.01	0.10
A200-DF	DUMMY	204.52	0	00:46	3.31	0.05	0.10	C120-DF	DUMMY	194.75	0	00:51			
A205-DF	DUMMY	84.60	0	00:55				C125-DF	DUMMY	82.11	0	00:55			
A21	CONDUIT	998.16	0	02:55	3.74	0.01	0.08	CT-OUT	DUMMY	683.71	0	00:41			
A210-DF	DUMMY	243.70	0	00:49	J., 1	0.01	0.00	D10	DUMMY	313.01	0	00:45			
A22	DUMMY	3255.89	0	01:03				D100-DF	DUMMY	127.44	0	00:39			
A220-DF	DUMMY	2957.75	_	01:07				D105-DF	DUMMY	38.60	0	00:43			
A221-DF	DUMMY	58.31		00:37				D110-DF	DUMMY	160.59	0	00:50			
A222-DF	DUMMY	393.32						D115-DF	DUMMY	66.07	0	00:41			
A223-DF	DUMMY	140.08		00:36				D120-DF	DUMMY	213.54	0	00:38			
A224-DF	DUMMY	72.34		00:41				D125-DF	DUMMY	106.58	0	00:38			
A225-DF	DUMMY	137.18		00:43				E10.5	DUMMY	536.24	0	00:47			
A226-DF	DUMMY	176.66		00:45				E100-DF	DUMMY	172.69	0	00:41			
A227-DF	DUMMY	300.10		00:36				E105-DF	DUMMY	129.93	0	00:38			
A228-DF	DUMMY	159.69		00:32				E11	CONDUIT	321.54	0	00:50	3.08	0.03	0.19
A23	CONDUIT	3108.70		01:04	6.05	0.18	0.42	E110-DF	DUMMY	58.25	0	00:38			
A230-DF	DUMMY	390.42		00:36				E115-DF	DUMMY	125.91	0	00:37			
A24	CONDUIT	2939.51		01:02	5.30	0.20	0.45	E120-DF	DUMMY	230.98	0	00:43			
A240-DF	DUMMY	451.78	0					E124-DF	DUMMY	99.45	0	00:53			
A25	CONDUIT	988.36	0	01:01	4.36	0.08	0.29	E128-DF	DUMMY	199.53	0	00:47			
A250-DF	DUMMY	107.06	0	00:48				F10	CONDUIT	948.43	0	01:28	4.17	0.07	0.27
A26	CONDUIT	882.86	0	00:51	4.11	0.06	0.26	F10.2	DUMMY	1563.88	0	01:22			
A260-DF	DUMMY	147.85	0	00:48				F100-DF	DUMMY	149.78	0	00:55			
A27	CONDUIT	506.04	0	00:51	4.48	0.04	0.21	F102-DF	DUMMY	119.39	0	00:40			
A27.5	CONDUIT	157.55	0	00:40	4.30	0.01	0.12	F104-DF	DUMMY	372.68	0	00:36			
A270-DF	DUMMY	278.64	0	00:40				F106-DF	DUMMY	229.46	0	00:38			
A275-DF	DUMMY	166.58	0	00:35				F11	CONDUIT	875.41	0	01:22	4.21	0.08	0.31
A28	CONDUIT	345.28	0	00:59	3.34	0.03	0.21	F110-DF	DUMMY	249.58	0	00:40			
A280-DF	DUMMY	484.76	0	00:34				F12	CONDUIT	758.77	0	01:20	3.79	0.06	0.24
A29	CONDUIT	149.52	0	00:59	2.94	0.01	0.10	F120-DF	DUMMY	255.31	0	00:42			
A290-DF	DUMMY	237.25	0	00:42				F125-DF	DUMMY	133.06	0	00:45			
A300-DF	DUMMY	152.09	0	00:53				F13	CONDUIT	576.95	0	01:13	3.81	0.06	0.29
B10	CONDUIT	603.39	0	01:00	4.23	0.07	0.28	F130-DF	DUMMY	121.48	0	00:51			
B100-DF	DUMMY	197.39	0	00:43				F14	CONDUIT	444.29	0	01:02	3.39	0.05	0.28
B11	CONDUIT	380.45	0	01:13	2.28	0.05	0.25	F140-DF	DUMMY	164.71	0	00:51			
B110-DF	DUMMY	291.58	0	00:42				F145-DF	DUMMY	123.12	0	00:50			
B12	CONDUIT	316.39	0	01:17	2.50	0.04	0.22	F15	CONDUIT	215.89	0	00:52	3.21	0.02	0.18
B120-DF	DUMMY	338.85		00:36				F150-DF	DUMMY	127.15	0	00:51			
B13	CONDUIT	170.17		00:51	3.29	0.03	0.17	F155-DF	DUMMY	230.22	0	00:42			
B130-DF	DUMMY	223.83		00:38				G10	CONDUIT	517.18	0	01:09	3.28	0.04	0.23
B135-DF	DUMMY	346.08		00:37				G100-DF	DUMMY	97.93	0	00:47			
B140-DF	DUMMY	214.46	0	00:37				G11	CONDUIT	399.71	0	01:03	3.25	0.03	0.22

Table B-8 Sample SWMM Output

G110-DF	DUMMY	147.92	0	00:45				Conduit Surch	narge Summary				
G115-DF	DUMMY	125.05	0	00:48				******	****				
G12	CONDUIT	152.63	0	01:03	2.88	0.01	0.14						
G120-DF	DUMMY	166.04	0	00:43									
G130-DF	DUMMY	165.26	0	00:48								Hours	Hours
Н10	CONDUIT	1041.74	0	00:45	4.18	0.07	0.26			Hours Full		Above Full	Capacity
H100-DF	DUMMY	93.48	0	00:36				Conduit	Both Ends	Upstream	Dnstream	Normal Flow	Limited
н11	CONDUIT	622.77		00:44	4.02	0.04	0.24						
H110-DF	DUMMY	324.93	0	00:37				A100-DF	0.01	0.01	0.01	216.01	0.01
H115-DF	DUMMY	150.38	0	00:49				A104-DF	0.01	0.01	0.01	216.01	0.01
H120-DF	DUMMY	444.33	0	00:36				A108-DF	0.01	0.01	0.01	216.01	0.01
H125-DF	DUMMY	238.37		00:41				A110-DF	0.01	0.01	0.01	216.01	0.01
I10	CONDUIT	386.43		01:07	3.42	0.04	0.21	A120-DF	0.01	0.01	0.01	216.01	0.01
I100-DF	DUMMY	156.77		00:43				A130-DF	0.01	0.01	0.01	216.01	0.01
I11	CONDUIT	200.89		01:01	3.17	0.02	0.14	A135-DF	0.01	0.01	0.01	216.01	0.01
I110-DF	DUMMY	223.17		00:45				A140-DF	0.01	0.01	0.01	216.01	0.01
I115-DF	DUMMY	127.87		00:49				A145-DF	0.01	0.01	0.01	216.01	0.01
I120-DF	DUMMY	81.60		00:54				A150-DF	0.01	0.01	0.01	216.01	0.01
J10	CONDUIT	1231.42		00:55	5.76	0.09	0.32	A155-DF	0.01	0.01	0.01	216.01	0.01
J100-DF	DUMMY	304.93		00:37		0.03	0.02	A160-DF	0.01	0.01	0.01	216.01	0.01
J11	CONDUIT	658.17		00:49	4.22	0.06	0.27	A165-DF	0.01	0.01	0.01	216.01	0.01
J11.5	CONDUIT	413.15		00:52	3.78	0.02	0.15	A170-DF	0.01	0.01	0.01	216.01	0.01
J110-DF	DUMMY	200.11		00:40	3.70	0.02	0.10	A175-DF	0.01	0.01	0.01	216.01	0.01
J12	CONDUIT	139.21		00:55	2.51	0.01	0.09	A180-DF	0.01	0.01	0.01	216.01	0.01
J120-DF	DUMMY	340.70		00:39	2.51	0.01	0.03	A190-DF	0.01	0.01	0.01	216.01	0.01
J13	CONDUIT	482.88		00:58	4.09	0.07	0.28	A200-DF	0.01	0.01	0.01	216.01	0.01
J130-DF	DUMMY	590.31		00:33	4.03	0.07	0.20	A205-DF	0.01	0.01	0.01	216.01	0.01
J14	CONDUIT	321.38		00:57	3.26	0.03	0.22	A210-DF	0.01	0.01	0.01	216.01	0.01
J140-DF	DUMMY	252.76		00:38	3.20	0.03	0.22	A210 DF A22	0.01	0.01	0.01	216.01	0.01
J15	CONDUIT	150.58		00:58	2.92	0.01	0.12	A220-DF	0.01	0.01	0.01	216.01	0.01
J150-DF	DUMMY	216.40		00:30	2.92	0.01	0.12	A220-DF A221-DF	0.01	0.01	0.01	216.01	0.01
J155-DF	DUMMY	175.20		00:40				A221-DF A222-DF	0.01	0.01		216.01	0.01
J160-DF				00:36				A222-DF A223-DF			0.01		
MT-OUT	DUMMY	161.08		00:45				A223-DF A224-DF	0.01	0.01	0.01	216.01	0.01
	DUMMY	597.93							0.01	0.01	0.01	216.01	0.01
NG220-IN	DUMMY	7648.84		00:57				A225-DF	0.01	0.01	0.01	216.01	0.01
NG-OUT	DUMMY	3538.53		01:30				A226-DF	0.01	0.01	0.01	216.01	0.01
PW-OUT	DUMMY	1120.96		00:45				A227-DF	0.01	0.01	0.01	216.01	0.01
RT-OUT	DUMMY	503.71		01:04				A228-DF	0.01	0.01	0.01	216.01	0.01
SJ-OUT	DUMMY	757.65		00:58				A230-DF	0.01	0.01	0.01	216.01	0.01
SN-OUT	DUMMY	1706.88		01:18				A240-DF	0.01	0.01	0.01	216.01	0.01
SP-OUT	DUMMY	763.03		00:59				A250-DF	0.01	0.01	0.01	216.01	0.01
ST-OUT	DUMMY	1427.27		00:52				A260-DF	0.01	0.01	0.01	216.01	0.01
NG220-OUT	DUMMY	999.29		02:43				A270-DF	0.01	0.01	0.01	216.01	0.01
SJ130-OUT	DUMMY	321.36	0	01:09				A275-DF	0.01	0.01	0.01	216.01	0.01
								A280-DF	0.01	0.01	0.01	216.01	0.01
								A290-DF	0.01	0.01	0.01	216.01	0.01
******	*****							A300-DF	0.01	0.01	0.01	216.01	0.01

Table B-8
Sample SWMM Output

B100-DF						
B120-DF	B100-DF	0.01	0.01	0.01	216.01	0.01
B130-DF	B110-DF	0.01	0.01	0.01	216.01	0.01
B130-DF	B120-DF	0.01	0.01			0.01
B135-DF	B130-DF					
B140 DF						
BM-OUT						
C100-DF						
C110-DF						
C120-DF						
C125-DF						
CT-OUT						
D10						
D100-DF						
D105-DF						
D110-DF						
D115-DF						
D120-DF						
D125-DF						
E10.5 E100-DF O.01 O.01 O.01 O.01 E105-DF O.01 O.01 O.01 O.01 E110-DF O.01 O.01 O.01 O.01 E110-DF O.01 O.01 O.01 O.01 E115-DF O.01 O.01 O.01 O.01 E126.01 O.01 E120-DF O.01 O.01 O.01 E120-DF O.01 O.01 O.01 E120-DF O.01 O.01 O.01 E124-DF O.01 O.01 O.01 O.01 E128-DF O.01 O.01 O.01 O.01 E128-DF O.01 O.01 O.01 O.01 C16.01 O.01 F10.2 O.01 O.01 O.01 O.01 C16.01 O.01 F102-DF O.01 O.01 O.01 C16.01 O.01 F104-DF O.01 O.01 O.01 C16.01 O.01 F104-DF O.01 O.01 O.01 C16.01 O.01 F104-DF O.01 O.01 O.01 C16.01 O.01 F105-DF O.01 O.01 O.01 C16.01 O.01 F110-DF O.01 O.01 O.01 C16.01 O.01 F125-DF O.01 O.01 O.01 C16.01 O.01 F125-DF O.01 O.01 O.01 C16.01 O.01 F125-DF O.01 O.01 O.01 C16.01 O.01 F145-DF O.01 O.01 O.01 C16.01 O.01 F145-DF O.01 O.01 O.01 C16.01 O.01 F155-DF O.01 O.01 O.01 C16.01 O.01 F155-DF O.01 O.01 O.01 C16.01 O.01 G110-DF O.01 O.01 O.01 C16.01 O.01 G115-DF O.01 O.01 O.01 C16.01 O.01 G115-DF O.01 O.01 O.01 C16.01 O.01 G115-DF O.01 O.01 O.01 O.01 C16.01 O.01 G130-DF O.01 O.01 O.01 O.01 C16.01 O.01 G130-DF O.01 O.01 O.01 O.01 O.01 C16.01 O.01 G130-DF O.01 O.01 O.01 O.01 O.01 O.01 O.01 O.01						
E100-DF						
E105-DF						
E110-DF						
E115-DF						
E120-DF 0.01 0.01 0.01 216.01 0.01 E124-DF 0.01 0.01 0.01 216.01 0.01 E128-DF 0.01 0.01 0.01 216.01 0.01 F10.2 0.01 0.01 0.01 216.01 0.01 F100-DF 0.01 0.01 0.01 216.01 0.01 F102-DF 0.01 0.01 0.01 216.01 0.01 F104-DF 0.01 0.01 0.01 216.01 0.01 F106-DF 0.01 0.01 0.01 216.01 0.01 F110-DF 0.01 0.01 0.01 216.01 0.01 F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F130-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 <						
E124-DF 0.01 0.01 0.01 216.01 0.01 E128-DF 0.01 0.01 0.01 216.01 0.01 F10.2 0.01 0.01 0.01 216.01 0.01 F100-DF 0.01 0.01 0.01 216.01 0.01 F102-DF 0.01 0.01 0.01 216.01 0.01 F104-DF 0.01 0.01 0.01 216.01 0.01 F106-DF 0.01 0.01 0.01 216.01 0.01 F110-DF 0.01 0.01 0.01 216.01 0.01 F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F130-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G						
E128-DF 0.01 0.01 0.01 216.01 0.01 F10.2 0.01 0.01 0.01 216.01 0.01 F100-DF 0.01 0.01 0.01 216.01 0.01 F102-DF 0.01 0.01 0.01 216.01 0.01 F104-DF 0.01 0.01 0.01 216.01 0.01 F106-DF 0.01 0.01 0.01 216.01 0.01 F110-DF 0.01 0.01 0.01 216.01 0.01 F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F140-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G						
F10.2 0.01 0.01 0.01 216.01 0.01 F100-DF 0.01 0.01 0.01 216.01 0.01 F102-DF 0.01 0.01 0.01 216.01 0.01 F104-DF 0.01 0.01 0.01 216.01 0.01 F106-DF 0.01 0.01 0.01 216.01 0.01 F110-DF 0.01 0.01 0.01 216.01 0.01 F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F140-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G						
F100-DF 0.01 0.01 0.01 216.01 0.01 F102-DF 0.01 0.01 0.01 216.01 0.01 F104-DF 0.01 0.01 0.01 216.01 0.01 F106-DF 0.01 0.01 0.01 216.01 0.01 F110-DF 0.01 0.01 0.01 216.01 0.01 F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F130-DF 0.01 0.01 0.01 216.01 0.01 F140-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F150-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td></td<>						
F102-DF 0.01 0.01 0.01 216.01 0.01 F104-DF 0.01 0.01 0.01 216.01 0.01 F106-DF 0.01 0.01 0.01 216.01 0.01 F110-DF 0.01 0.01 0.01 216.01 0.01 F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F130-DF 0.01 0.01 0.01 216.01 0.01 F140-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F150-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td></td<>						
F104-DF 0.01 0.01 0.01 216.01 0.01 F106-DF 0.01 0.01 0.01 216.01 0.01 F110-DF 0.01 0.01 0.01 216.01 0.01 F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F130-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F150-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
F106-DF 0.01 0.01 0.01 216.01 0.01 F110-DF 0.01 0.01 0.01 216.01 0.01 F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F130-DF 0.01 0.01 0.01 216.01 0.01 F140-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F150-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
F110-DF 0.01 0.01 0.01 216.01 0.01 F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F130-DF 0.01 0.01 0.01 216.01 0.01 F140-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01						
F120-DF 0.01 0.01 0.01 216.01 0.01 F125-DF 0.01 0.01 0.01 216.01 0.01 F130-DF 0.01 0.01 0.01 216.01 0.01 F140-DF 0.01 0.01 0.01 216.01 0.01 F150-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01						0.01
F125-DF 0.01 0.01 0.01 216.01 0.01 F130-DF 0.01 0.01 0.01 216.01 0.01 F140-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G110-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01	F110-DF					
F130-DF 0.01 0.01 0.01 216.01 0.01 F140-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F150-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01						
F140-DF 0.01 0.01 0.01 216.01 0.01 F145-DF 0.01 0.01 0.01 216.01 0.01 F150-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G110-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01		0.01	0.01	0.01	216.01	0.01
F145-DF 0.01 0.01 0.01 216.01 0.01 F150-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G110-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01	F130-DF	0.01	0.01	0.01	216.01	0.01
F150-DF 0.01 0.01 0.01 216.01 0.01 F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G110-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01	F140-DF	0.01	0.01	0.01	216.01	0.01
F155-DF 0.01 0.01 0.01 216.01 0.01 G100-DF 0.01 0.01 0.01 216.01 0.01 G110-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01	F145-DF	0.01	0.01	0.01	216.01	0.01
G100-DF 0.01 0.01 0.01 216.01 0.01 G110-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01	F150-DF	0.01	0.01	0.01	216.01	0.01
G110-DF 0.01 0.01 0.01 216.01 0.01 G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01	F155-DF	0.01	0.01	0.01	216.01	0.01
G115-DF 0.01 0.01 0.01 216.01 0.01 G120-DF 0.01 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01	G100-DF	0.01	0.01	0.01	216.01	0.01
G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01	G110-DF	0.01	0.01	0.01	216.01	0.01
G120-DF 0.01 0.01 0.01 216.01 0.01 G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01	G115-DF		0.01			
G130-DF 0.01 0.01 0.01 216.01 0.01 H100-DF 0.01 0.01 0.01 216.01 0.01					216.01	
H100-DF 0.01 0.01 0.01 216.01 0.01						

0.01 0.01 H115-DF 0.01 0.01 216.01 H120-DF 216.01 0.01 0.01 0.01 0.01 H125-DF 216.01 0.01 0.01 0.01 0.01 I100-DF 0.01 0.01 0.01 216.01 0.01 I110-DF 0.01 216.01 0.01 0.01 0.01 I115-DF 0.01 0.01 0.01 216.01 0.01 0.01 I120-DF 0.01 0.01 0.01 216.01 J100-DF 0.01 216.01 0.01 0.01 0.01 J110-DF 0.01 0.01 0.01 216.01 0.01 J120-DF 0.01 0.01 0.01 216.01 0.01 J130-DF 0.01 216.01 0.01 0.01 0.01 J140-DF 0.01 0.01 216.01 0.01 0.01 J150-DF 216.01 0.01 0.01 0.01 0.01 J155-DF 0.01 0.01 0.01 216.01 0.01 J160-DF 0.01 0.01 0.01 216.01 0.01 MT-OUT 0.01 0.01 0.01 216.01 0.01 216.01 0.01 NG220-IN 0.01 0.01 0.01 0.01 0.01 0.01 216.01 0.01 NG-OUT PW-OUT 0.01 0.01 0.01 216.01 0.01 RT-OUT 0.01 216.01 0.01 0.01 0.01 SJ-OUT 0.01 0.01 0.01 216.01 0.01 SN-OUT 0.01 0.01 0.01 216.01 0.01 0.01 SP-OUT 0.01 0.01 0.01 216.01 ST-OUT 0.01 0.01 0.01 216.01 0.01

Analysis begun on: Thu Mar 05 10:29:17 2015 Analysis ended on: Thu Mar 05 10:29:19 2015

Total elapsed time: 00:00:02

Select tables from September 2012 draft of Chapter 4 – Rainfall, Urban Storm Drainage Criteria Manual Volume I

Table 4-1. Storm Duration and Area Adjustment for CUHP Modeling

Design Storm	Watershed Area (square miles)	Suggested Minimum Storm Duration	Apply DRF?
2 5 and 10	$A \le 2.0$	2 hours	No
2-, 5-, and 10- Year	2.0 < A < 15.0	2 hours	Yes – Use Table 4-3
1 Cal	$A \ge 15.0$	6 hours	Yes – Use Table 4-3
25-, 50-, 100-,	A < 15.0	2 hours	No
and 500-Year	A ≥ 15.0	6 hours	Yes – Use Table 4-4

Table 4-3. DRFs for Design Rainfall Distributions 2-, 5-, and 10-Year Design Rainfall

Time			Correcti	on Factor b	y Watersh	ed Area in	Square Mile	s^1	
(minutes)	2	5	10	15	20	30	40	50	75
5	1.00	1.00	1.00	1.00	1.00	1.00	1.00	1.00	1.00
10	1.00	1.00	1.00	1.00	1.00	1.00	1.00	1.00	1.00
15	1.00	0.97	0.94	0.91	0.90	0.85	0.75	0.65	0.56
20	1.00	0.86	0.75	0.68	0.61	0.55	0.48	0.42	0.35
25	1.00	0.86	0.75	0.68	0.61	0.55	0.48	0.42	0.35
30	1.00	0.86	0.75	0.68	0.61	0.55	0.48	0.42	0.42
35	1.00	0.97	0.94	0.91	0.90	0.90	0.90	0.90	0.89
40	1.00	0.97	0.94	0.91	0.90	0.90	0.90	0.90	0.89
45	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
50	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
55	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
60	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
65	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
70	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
75	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
80	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
85	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
90	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
95	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
100	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
105	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
110	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
115	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
120	1.00	1.00	1.00	1.02	1.02	1.01	1.01	1.01	1.00
125-180	N/A	N/A	N/A	1.00	1.00	1.00	1.00	1.00	1.00
185-360	N/A	N/A	N/A	1.23	1.28	1.30	1.32	1.33	1.33

¹For areas between the values listed in the table, correction factors can be obtained through linear interpolation between columns.

Table 4-4. DRFs for Design Rainfall Distributions 25-, 50-, 100-, and 500-Year Design Rainfall

Time	Corre	ction Factor	r by Waters	hed Area in	Square M	iles¹
(minutes)	15	20	30	40	50	75
5	1.15	1.15	1.15	1.15	1.15	1.10
10	1.15	1.15	1.15	1.15	1.15	1.10
15	1.15	1.15	1.15	1.15	1.15	1.10
20	1.25	1.18	1.10	1.05	1.00	0.90
25	0.73	0.69	0.64	0.60	0.58	0.55
30	0.73	0.69	0.64	0.60	0.58	0.55
35	0.73	0.69	0.64	0.60	0.58	0.55
40	1.05	1.02	0.95	0.90	0.85	0.80
45	1.20	1.20	1.20	1.15	1.05	0.95
50	1.15	1.15	1.15	1.15	1.05	0.95
55	1.15	1.15	1.15	1.15	1.15	1.15
60	1.15	1.15	1.15	1.15	1.15	1.15
65	1.08	1.10	1.13	1.15	1.15	1.15
70	1.08	1.10	1.13	1.15	1.15	1.15
75	1.08	1.10	1.13	1.15	1.15	1.15
80	1.08	1.10	1.13	1.15	1.15	1.15
85	1.08	1.10	1.13	1.15	1.15	1.15
90	1.08	1.10	1.13	1.15	1.15	1.15
95	1.08	1.10	1.13	1.15	1.15	1.15
100	1.08	1.10	1.13	1.15	1.15	1.15
105	1.08	1.10	1.13	1.15	1.15	1.15
110	1.08	1.10	1.13	1.15	1.15	1.15
115	1.08	1.10	1.13	1.15	1.15	1.15
120	1.08	1.10	1.13	1.15	1.15	1.15
125-180	1.08	1.10	1.13	1.15	1.25	1.25
185-360	1.05	1.10	1.10	1.10	1.10	1.13

¹For areas between the values listed in the table, correction factors can be obtained through linear interpolation between columns.

MULLER ENGINEERING COMPANY

APPENDIX B

PAGE B-42

MEMORANDUM

To: Shea Thomas and Bill DeGroot / UDFCD

Fred Koch and Brad Robenstein / Douglas County Tom Williams and Jacob James / Town of Parker

From: Derek Johns / Muller Engineering Company

Jim Wulliman / Muller Engineering Company

Date: May 30, 2013

Project #: 12-050.01

Re: Newlin Gulch Major Drainageway Planning Study,

Rueter-Hess Reservoir Flood Control Benefits



Muller Engineering Company, Inc. Consulting Engineers

777 S. Wadsworth Blvd. #4-100 Lakewood, Colorado 80226 303/988-4969 FAX 303/988-4939 www.mullereng.com

Introduction

This memorandum documents the initial results of a baseline hydrology evaluation completed for the Newlin Gulch watershed located in Douglas County. This work was completed as one of the first components of the Major Drainageway Planning (MDP) study that is currently underway for the Newlin Gulch watershed. One of the key objectives of the MDP is to update hydrologic information provided in the previous Outfall Systems Planning (OSP) study completed in 1993 for the watershed. In addition, hydrologic results will be compared to the 1977 Flood Hazard Area Delineation (FHAD) study which is the basis for the current regulatory floodplain along Newlin Gulch.

The primary issues involved in updating the Newlin Gulch hydrology was to incorporate land use changes in the watershed and evaluate the impacts of Rueter-Hess Reservoir, a large water supply reservoir that was recently constructed on Newlin Gulch. The older OSP and FHAD studies were both completed prior to construction of Rueter-Hess Reservoir and don't recognize any flood detention benefits.

The following sections include a summary of land use changes in the watershed, describe key features of Rueter-Hess Reservoir, document the hydrologic evaluation, and summarize the impacts and flood detention benefits associated with Rueter-Hess Reservoir.

Land Use Changes

Since 1993, there have been significant changes in the existing land use and the projected future land use within the watershed. To-date, most of the development has occurred in the lower portion of the watershed in or near the Town of Parker. Existing imperviousness values in the watershed have been updated based on 2012 aerial photography and information provided in land development drainage reports. Based on this information, the composite watershed imperviousness for existing conditions is currently 22.5%. This value accounts for the Rueter-Hess Reservoir maximum normal pool being at 100% imperviousness. If the reservoir pool is excluded, the composite watershed imperviousness for existing conditions is 12%. In the 1993 OSP, the existing imperviousness was reported to be 4.9%.

The future land use conditions are projected to be much higher than the estimates in the 1993 OSP. In the 1993 OSP, future land use in the upper portion of the watershed was projected to consist primarily of open space and large lot residential development and the overall composite imperviousness cover was estimated to be 12.6%. Based on new land use information provided by the Town of Parker, Douglas County, and the City of Castle Pines, more land development is planned and at higher densities than

Memorandum May 30, 2013

what was estimated in 1993. As shown on the Future Land Use Map (Figure 1), there is a significant amount of development ranging from medium density residential areas (40% imperviousness) to business/commercial areas (85 to 90% imperviousness) that is planned in the upper portion of the watershed in Castle Pines. This includes the 3300-acre Canyons residential development that is planned immediately upstream of Rueter-Hess Reservoir along with Castle Pines Town Center and Lagae Ranch developments near I-25. In the lower portion of the watershed (below Rueter-Hess Reservoir), future developments that are planned include the Meridian Business Park (75% imperviousness) and several residential developments. Based on this new land use information, the composite watershed imperviousness for future conditions is estimated to be 35% (26% without Rueter-Hess) which is almost 3 times higher than the 12.6% imperviousness assumed in the 1993 OSP.

Rueter-Hess Reservoir

Rueter-Hess Reservoir is a water supply reservoir owned by Parker Water and Sanitation District (PWSD). It is located on the mainstem of Newlin Gulch in the central portion of the watershed. The construction of the reservoir was completed in 2012 and consists of a 170-foot tall earthen dam that is designed to store 72,000 acre-feet of water. Once it is filled to its maximum normal pool, the reservoir footprint will cover 1.8 square miles or approximately 12% of the entire Newlin Gulch watershed. The reservoir was built for water supply storage and not flood control.

Service Spillway. Outflows from Rueter-Hess reservoir are controlled through a multi-chambered tower that connects to two outlet conduits. The service spillway is comprised of two of the upper chambers on the outlet works tower, each approximately10-feet wide and 5-feet tall. The maximum normal pool elevation for the reservoir is elevation 6215.1 (NAVD88) which is equal to the crest of the service spillway. According to an evaluation conducted by the reservoir design engineer, the service spillway can convey both the 100-year and 500-year storm events.

Auxiliary Spillway. The auxiliary (or emergency) spillway consists of a large concrete labyrinth weir located on the west abutment of the dam. The auxiliary spillway crest is at elevation 6216.7 which is 1.6-feet above the service spillway crest. The auxiliary spillway is designed to convey extreme flood events (greater that the 500-year).

Hydrologic Evaluation

The hydrologic evaluation for the Newlin Gulch watershed was based on updated topographic mapping and land use information. A new subwatershed delineation was performed using the more current mapping and in accordance with UDFCD guidelines to keep the average subwatershed size to approximately 100-acres. The new delineation resulted in subdividing the 15.0 square mile watershed into 111 subwatersheds with an average subwatershed size of approximately 90-acres.

Percent imperviousness values for the subwatersheds were based on the most current land use information for both existing and future conditions. Hydrographs for the subwatersheds were generated using the Colorado Urban Hydrograph Procedure (CUHP). The hydrographs were then routed through the drainageway network using EPA's Storm Water Management Model (SWMM). The SWMM model was also used to evaluate the impacts of routing flood flows through Rueter-Hess Reservoir. Storage/discharge data for the reservoir was incorporated into the SWMM model based on rating curve tables shown on a record drawing provided by PWSD.

The hydrologic modeling was completed for the 100-year event based on future land use conditions. To evaluate the impacts of Rueter-Hess Reservoir, the modeling was performed for conditions with and without the reservoir. The assumptions for these two conditions are described below.

2

Memorandum May 30, 2013

With Rueter-Hess Reservoir. This option accounts for the inherent flood detention/attenuation that the reservoir currently provides.

- 1. It was decided by the project sponsors to ignore the service spillway and route flows only through the auxiliary spillway. This is a more conservative approach. However, this option would allow some flexibility for future changes to the service spillway configuration.
- 2. The reservoir was assumed to be full to the auxiliary spillway crest (elevation 6216.7) prior to the storm event. The reservoir subwatershed was modeled at 100% imperviousness.
- 3. The resulting 100-year peak discharges for this option are presented in Figure 2 and show that discharges downstream of the reservoir would be lower than both the 1977 FHAD and the 1993 OSP discharges. The reservoir surcharge (rise in water level) for this option in the 100-year event would be approximately 0.8-feet.

With-Out Rueter-Hess Reservoir. This option assumes that Rueter-Hess Reservoir is not in place, so there is no reservoir pool or flood detention routing.

- The reservoir subwatershed was modeled based on historic topographic conditions and 2% imperviousness.
- 2. The resulting 100-year peak discharges from this option are also shown on Figure 2 and indicate that peak flows are 250 to 750% higher than the "With Rueter-Hess Reservoir" option, 160% percent higher the 1993 OSP discharges, and 190% higher than the 1977 FHAD discharges.

Flood Control Benefits of Rueter-Hess Reservoir

This hydrologic evaluation shows that Rueter-Hess Reservoir provides substantial reductions in peak flood discharges in Newlin Gulch. The reduction in flood discharges is inherent because the reservoir surface area is so large relative to the upstream watershed. In addition, these flood detention benefits occur with the current reservoir configuration and no impacts to reservoir operations or water storage volume.

Recognizing the lower flood discharges from Rueter-Hess Reservoir would provide several benefits for the Newlin Gulch watershed. These benefits include:

- 1. Prevent Expansion of Regulatory Floodplain: Figure 3 shows a sample map of the 100-year regulatory floodplain in Stonegate Village located downstream of Rueter-Hess Reservoir. The map shows that the regulatory floodplain is in close proximity to the existing residential lots. Recognizing the flood peak reduction from Rueter-Hess Reservoir would maintain discharges below the current regulatory discharges and, therefore, prevent the expansion of the floodplain into residential and commercial properties. If the flood discharge reduction from RH reservoir is not recognized, then the 100-year regulatory discharges would increase by a factor of 2 as shown in the "Without RH Reservoir" option and result in a wider floodplain that would encroach onto numerous residential and commercial properties.
- Avoid Increases to Flood Insurance Rates: If the floodplain were to expand, flood insurance
 premium rates for properties would likely increase. Recognizing the lower flood discharges would
 prevent this situation from occurring.
- 3. Avoid Lowering Property Values: If the floodplain were to expand, it is possible that property values would decrease. In addition, infrastructure improvements for properties within the expanded floodplain could be limited by floodplain regulations (i.e., it may be prohibited or more costly for a property owner to expand or modify a home or building). Recognizing the lower flood discharges would prevent this from occurring.

Memorandum May 30, 2013

- 4. Reduce Costs for Roadway Crossings: Recognizing the flood peak reduction from Rueter-Hess Reservoir would also help to reduce costs for future roadway crossings or replacement of existing roadway crossings of Newlin Gulch. For example, if a new bridge crossing over Newlin Gulch needs to be replaced, the bridge span could be shorter using the lower flow rates and, therefore, less costly to construct.
- 5. Reduce Costs for Future Drainageway Improvements: Future drainageway infrastructure that will likely be needed along Newlin Gulch such as stream stabilization improvements will be more cost effective if they can be designed using the lower flood discharges.

Conclusion

In conclusion, Rueter-Hess Reservoir provides significant reduction in peak flood discharges for the Newlin Gulch drainageway downstream. Recognizing this would provide significant benefits for property owners downstream and would reduce costs for future infrastructure improvements within the Newlin Gulch drainageway.

In order for the flood peak reduction benefits from Rueter-Hess Reservoir to be officially recognized by regulatory agencies (i.e., UDFCD, FEMA, and the Colorado Water Conservation Board), an "adequate assurances" agreement would need to be executed with the reservoir owner, PWSD, ensuring no adverse changes would be made to the existing auxiliary spillway.


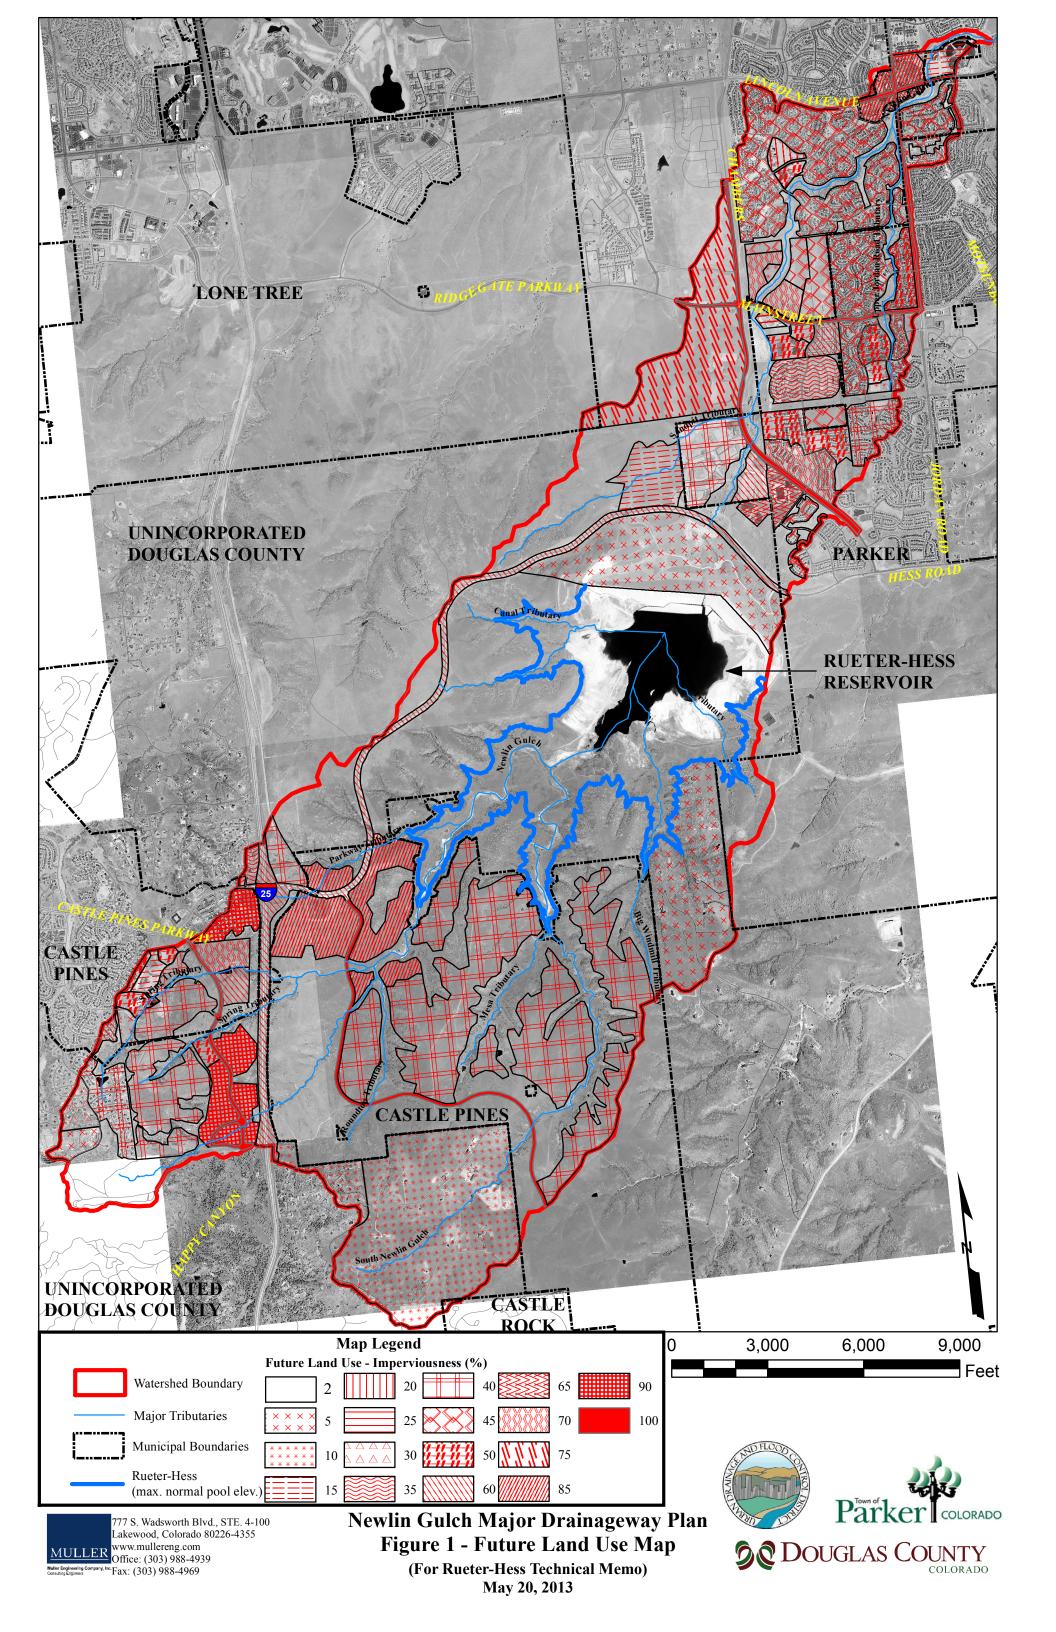


Figure 2 - Newlin Gulch Peak Flow Profile - Future Development



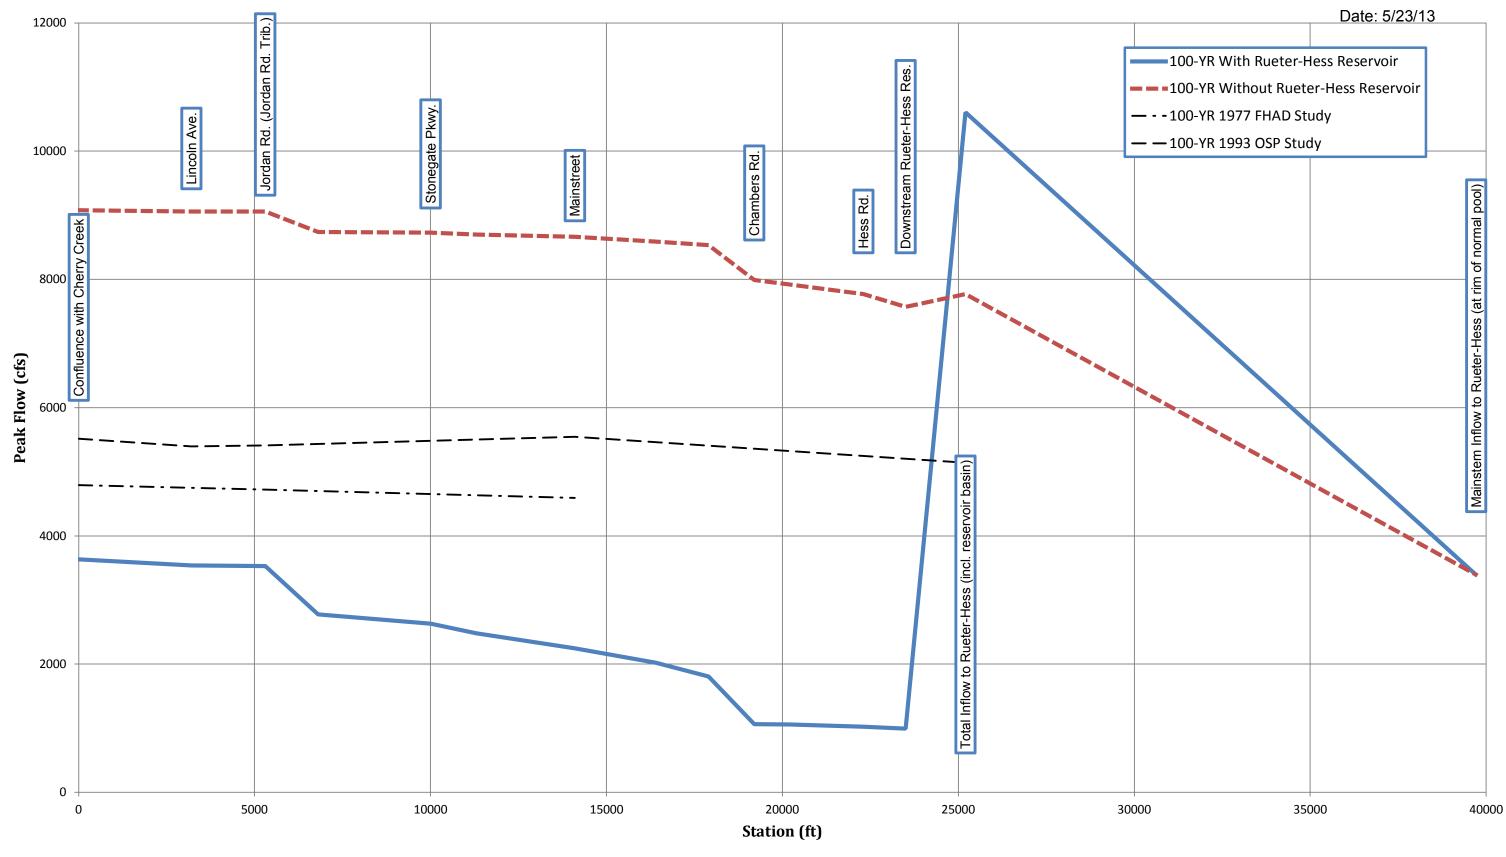

DATE: 5/23/13 **FIGURE 3**

NEWLIN GULCH REGULATORY FLOODPLAIN

IN THE CENTRAL PORTION OF STONEGATE VILLAGE

Table C-1 Rueter-Hess Reservoir Routing Alternatives

					1993 (OSP **	** Current Study							
								100-				100-		
				1977 FHAD	100-Yr	100-Yr		(Existing La	and Use)			(Future Lai	nd Use)	
	FHAD	OSP	Current	* 100-Yr	Existing	Future	Wit	th RH	Witho	ut RH	Wit	:h RH	Witho	ut RH
	Cross	Design	Design				Service	Auxiliary Spillway			Service	Auxiliary Spillway		
Location	Section	Point	Point	(cfs)	(cfs)	(cfs)	Spillway (cfs)	(cfs)†	I=100% (cfs)	I=2% (cfs)	Spillway (cfs)	(cfs)†	I=100% (cfs)	I=2% (cfs)
Newlin Gulch														
Cherry Creek	28	180	NG000	4790	5357	5513	2843	2843	10968	6438	3581	3581	12882	8191
Lincoln Ave. (U/S)		177	NG001		5198	5396	2796	2795	10945	6430	3486	3486	12848	8174
Jordan Rd. (U/S)	23	176	NG002	4720	5220	5412	2793	2793	10951	6431	3478	3478	12855	8176
Stonegate Parkway (U/S)			NG004				2213	2212	10479	6122	2683	2683	12300	7839
Mainstreet (U/S)	16	166	NG006	4590	5330	5545	1945	1945	10301	6032	2253	2253	12092	7784
Chambers Rd. (U/S)			NG009				706	905	9306	5551	763	1025	10980	7192
Hess Rd.			NG011				325	890	9024	5431	325	1010	10626	7017
Rueter-Hess Reservoir Outflow			NG012				49	880	8822	5309	56	995	10381	6838
RH Total Inflow (Including Reservoir Subwatershed)			NG220				8822	8822	N/A	N/A	10381	10381	N/A	N/A
Mainstem and Tributary Inflow to RH		150	NG013		4969	5138	5871	5871	5871	4738	7657	7657	7657	6210
Mainstem Inflow to RH			NG014				2454	2454	3108	3108	3255	3255	4183	4183
I-25 (U/S)		103	NG019		321	311	426	426	426	426	514	514	514	514
Tributaries														
Jordan Rd. Tributary at Newlin Confluence		276	SJ000		545	785	690	690	690	690	755	755	755	755
South Newlin at Mesa Confluence		128	SN001		1106	1167	1388	1388	1388	1388	1564	1564	1564	1564
Mesa Tributary at South Newlin Confluence		224	MT000		420	470	493	493	493	493	598	598	598	598
Roundtop Tributary at Newlin Confluence		217	RT000		383	393	429	429	429	429	504	504	504	504
Spring Tributary at Newlin Confluence		219	ST000		773	840	1009	1009	1009	1009	1427	1427	1427	1427

Notes:

^{* 1977} FHAD flows based on 24-hour storm and WSP-2 and TR-20 models.

^{** 1993} OSP flows based on 3-hour storm and CUHP/UDSWMM models.

[†]Selected Alternative for Baseline Hydrology Updated June 6, 2013

AGREEMENT REGARDING THE INTENT TO ASSURE THE FLOOD ROUTING CAPABILITY OF RUETER-HESS RESERVOIR IN DOUGLAS COUNTY

Agreement No. 14-05.05

WITNESSETH THAT:

WHEREAS, DISTRICT in a policy statement previously adopted (Resolution No. 14, Series of 1970), expressed an intent to assist public bodies which have heretofore enacted floodplain zoning measures; and

WHEREAS, several of the major drainageways within, or flowing into, DISTRICT have water supply, irrigation, or other non-flood control reservoirs located on them; and

WHEREAS, some of these reservoirs, by virtue of their size and/or their embankment and spillway configuration, provide significant but inadvertent flood routing capabilities which reduce the 100-year flood discharge downstream from the reservoirs; and

WHEREAS, Colorado Revised Statute §37-87-104(2) states that "No such (entity or person who owns, controls, or operates, a water storage reservoir) shall be liable for allowing the inflow to such reservoir to pass through it into the natural stream below such reservoir"; and

WHEREAS, the owners of such reservoirs can, and on occasion do, make changes to their embankment and spillway configurations, up to and including removal of the structure; and

WHEREAS, the above-language from §37-87-104, C.R.S. clearly indicates that it would be unwise public policy to rely upon these non-flood control reservoirs for any flood protection; and

WHEREAS, DISTRICT has previously adopted a "Policy for Delineation of Floodplains Below Water Supply and Other Non-Flood Control Reservoirs" (Resolution No. 36, Series of 1986); and

WHEREAS, the Policy requires that non-flood control reservoirs not be considered in the drainageway hydrology unless adequate assurances have been obtained by the Executive Director of DISTRICT to preserve the flood routing capability of the reservoirs; and

WHEREAS, Rueter-Hess Reservoir (hereinafter called "RESERVOIR") is a water storage reservoir which provides significant inadvertent flood routing capability which reduces the 100-year discharge downstream from RESERVOIR; and

WHEREAS, The Newlin Gulch Major Drainageway Plan & Flood Hazard Area Delineation (hereinafter called "MASTER PLAN") specifies the RESERVOIR's planned 100-year discharge; and

WHEREAS, OWNER is the owner of RESERVOIR, a water storage reservoir located south and east of the intersection of Hess Road and Chambers Road in unincorporated Douglas County; and

WHEREAS, PARTIES desire to make arrangements regarding the preservation of the planned 100-year discharge in the event OWNER plans future changes to RESERVOIR; and

WHEREAS, PARTIES acknowledge there is significant infrastructure cost savings to PARKER, DOUGLAS and DISTRICT as a result of OWNER signing this Agreement, and that OWNER is executing this agreement in the spirit of intergovernmental cooperation for the benefit of PARKER, DOUGLAS and DISTRICT; and

WHEREAS, OWNER is developing long term recreational opportunities and facilities at RESERVOIR which will require partnerships and cooperation from PARKER and DOUGLAS, among others; and

WHEREAS, in the same spirit of cooperation that has resulted in this Agreement, PARKER and DOUGLAS have committed to OWNER that they will participate in the development of recreational improvements at RESERVOIR including both physical improvements and staffing contributions, the details of which PARKER, DOUGLAS and OWNER will determine together in good faith.

NOW, THEREFORE, in consideration of the mutual promises contained herein, PARTIES hereto agree as follows:

SCOPE OF AGREEMENT

This Agreement defines the responsibilities and financial commitments of PARTIES with respect to RESERVOIR.

2. OPPORTUNITY TO MAINTAIN FLOOD ROUTING CAPABILITY

If OWNER plans physical changes to RESERVOIR which would increase the 100-year discharge above the planned 100-year discharge, OWNER shall provide an opportunity for PARKER, DOUGLAS, and DISTRICT to maintain the 100-year discharge at the planned 100-year discharge, subject to the terms and conditions of Paragraph 6 below.

3. MAINTENANCE OF THE PLANNED 100-YEAR DISCHARGE

PARKER, DOUGLAS and DISTRICT agree to jointly take whatever actions are necessary, available, and appropriate, based upon the sole discretion of PARKER, DOUGLAS and DISTRICT, to assure that the flood routing capability of RESERVOIR shall be maintained at the planned 100-year discharge, subject to annual budget and appropriation.

4. RECOGNITION OF FLOOD ROUTING CAPABILITY IN MASTER PLAN

The MASTER PLAN contains specific language recognizing the flood routing capability of RESERVOIR and expressing the need to preserve that routing capability by whatever means are available and appropriate should changes be proposed which would decrease the planned level of flood routing capability and increase the 100-year discharge above the planned 100-year discharge

The flood routing capability of RESERVOIR, as set forth in the MASTER PLAN, is as follows: During the 100-year flood, RESERVOIR reduces the peak flow from 10,381 cubic feet per second into RESERVOIR to a peak flow of 995 cubic feet per second out of RESERVOIR.

PAYMENT OF COSTS

If PARKER, DOUGLAS and/or DISTRICT desire OWNER to limit or attempt to limit the 100-year downstream discharge to the planned 100-year discharge, PARKER and/or DOUGLAS and/or DISTRICT shall pay, in advance, all costs attributable thereto, including but not limited to studies, revisions or additions to plans, physical changes to RESERVOIR or dam structures, and additional construction, subject to annual budget and appropriation. As used in this paragraph, "costs" includes construction, engineering, operation and maintenance, attorney's fees, court costs, and other direct or indirect costs.

6. NOTICE

OWNER shall notify PARKER, DOUGLAS and DISTRICT, in writing, of any plans to make physical changes to RESERVOIR. To take advantage of the opportunity referred to in Paragraph 2, PARKER, DOUGLAS and/or DISTRICT must notify OWNER, in writing, of their intention to do so promptly upon reciving written notification of OWNER's plans to make physical changes to RESERVOIR, and in no event more than 90 days after being notified.

- A. The NOTICE contact for OWNER shall be the Chair of the Parker Water & Sanitation District Board of Directors, 18100 East Woodman Drive, Parker, Colorado 80134.
- B. The NOTICE contact for PARKER shall be the Director of Public Works, 20120 East Main Street, Parker, Colorado 80138.
- C. The NOTICE contact for DOUGLAS shall be the County Engineer, 100 Third Street, Castle Rock, Colorado 80104.
- D. The NOTICE contact for DISTRICT shall be the Executive Director, 2480 West 26th Avenue, Suite 156B, Denver, Colorado 80211.
- E. Any notices, demands or other communications required or permitted to be given by any provision of this Agreement shall be given in writing, delivered personally or sent by registered mail, postage prepaid and return receipt requested, addressed to PARTIES at the addresses forth above or at such other address as either party may hereafter or from time to time designate by written notice to the other party given when personally delivered or mailed, and shall be considered received in the earlier of either the day on which such notice is actually received by the party to whom it is addressed or the third day after such notice is mailed.

7. OWNER APPROVAL

Notwithstanding any provision herein to the contrary, OWNER retains the right to approve, reject, or approve with conditions, in OWNER's sole discretion, any plans of PARKER, DOUGLAS or DISTRICT to maintain the flood routing capability of RESERVOIR; provided that OWNER shall inform PARKER, DOUGLAS and DISTRICT in writing of OWNER's reasons for a rejection or a conditional approval. OWNER further retains the right to manage all aspects of any work relating

to the maintenance of RESERVOIR's flood routing capability as contemplated by this Agreement, including the selection of contractors performing engineering, design or construction work on property owned or controlled by OWNER. It is the intent of this provision that OWNER retain sole control over all aspects of RESERVOIR while allowing PARKER, DOUGLAS and DISTRICT to preserve the flood control benefits of RESERVOIR.

8. LIABILITY

Each party hereto shall be responsible for any suits, demands, costs or actions at law resulting from its own acts or omissions and may insure against such possibilities as appropriate.

9. AMENDMENTS

This Agreement contains all of the terms agreed upon by and among PARTIES. Any amendments to this Agreement shall be in writing and executed by PARTIES hereto to be valid and binding.

10. <u>SEVERABILITY</u>

If any clause or provision herein contained shall be adjudged to be invalid or unenforceable by a court of competent jurisdiction or by operation of any applicable law, such invalid or unenforceable clause or provision shall not affect the validity of the Agreement as a whole and all other clauses or provisions shall be given full force and effect.

11. APPLICABLE LAWS

This Agreement shall be governed by and construed in accordance with the laws of the State of Colorado. Jurisdiction for any and all legal actions arising under the Agreement shall lie in the District Court in and for the County of Douglas, State of Colorado.

12. <u>ASSIGNABILITY</u>

No party to this Agreement shall assign or transfer any of its rights or obligations hereunder without the prior written consent of the nonassigning party or parties to this Agreement.

13. BINDING EFFECT

The provisions of this Agreement shall bind and shall inure to the benefit of PARTIES hereto and to their respective successors and permitted assigns.

14. ENFORCEABILITY

PARTIES hereto agree and acknowledge that this Agreement may be enforced in law or in equity, by decree of specific performance or damages, or such other legal or equitable relief as may be available subject to the provisions of the laws of the State of Colorado.

15. <u>APPROPRIATIONS</u>

Notwithstanding any other term, condition, or provision herein, each and every obligation of PARKER and/or DOUGLAS and/or OWNER and/or DISTRICT stated in this Agreement is subject to the requirement of a prior appropriation of funds therefore by the appropriate governing body of the OWNER, PARKER, DOUGLAS and/or DISTRICT.

16. NO THIRD PARTY BENEFICIARIES

It is expressly understood and agreed that enforcement of the terms and conditions of this Agreement, and all rights of action relating to such enforcement, shall be strictly reserved to

PARTIES, and nothing contained in this Agreement shall give or allow any such claim or right of action by any other or third person on such Agreement. It is the express intention of PARTIES that any person or party other than the OWNER, PARKER, DOUGLAS or DISTRICT receiving services or benefits under this Agreement shall be deemed to be an incidental beneficiary only.

17. NO WAIVER OF GOVERNMENTAL IMMUNITY ACT

The parties hereto understand and agree that the OWNER, PARKER, DOUGLAS AND DISTRICT, their officials, officers, directors, agents and employees, are relying on, and do not waive or intend to waive by any provisions of this Agreement, the monetary limitations or any other rights, immunities and protections provided by the Colorado Governmental Immunity Act, C.R.S. § 24-10-101, *et seq.*, as from time to time amended, or otherwise available to PARTIES.

18. RECITALS

The Recitals to this Agreement are incorporated herein by this reference.

19. ENTIRETY

This Agreement merges and supercedes all prior negotiations, representations and agreements between the parties hereof and constitutes the entire agreement between the parties concerning the subject matter hereof.

WHEREFORE, PARTIES hereto have caused this instrument to be executed by properly authorized signatures as of the date and year above written.

URBAN DRAINAGE AND FLOOD CONTROL DISTRICT

Title_Executive Director

Date 11/13/2014

PARKER WATER AND SANITATION

DISTRICT

(SEAL)

ATTEST:

Title Executive-Director District Manager

Date 10 29 14

APPROVED:

Board Rosslufun

TOWN OF PARKER

(SEAL)

ATTEST:

Carol Baumgartner, Town Clerk

APPROVED:

James Maloney, Town Attorney

BOARD OF COUNTY COMMISSIONERS
OF THE COUNTY OF DOUGLAS

DOUGLAS J. DEBORD, County Manager

APPROVED AS TO FISCAL CONTENT:

APPROVED AS TO LEGAL FORM:

ANDREW COPLAND, Finance Director

KRISTIN DECKER, Asst. County Attorney

AGREEMENT REGARDING THE INTENT TO ASSURE THE FLOOD ROUTING CAPABILITY OF RUETER-HESS RESERVOIR IN DOUGLAS COUNTY

Agreement No. 13-

EXHIBIT A: LOCATION

